


SCOUT REPORT
NEW MEXICO
OIL CONSERVATION COMMISSION

See map

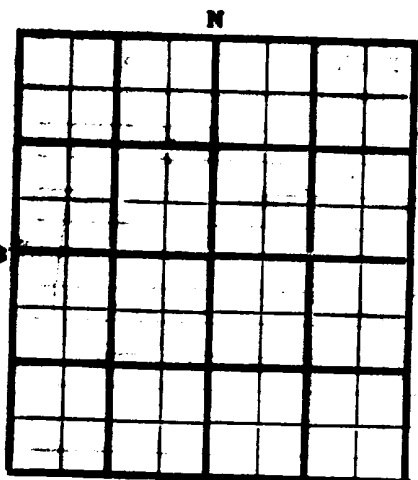

Company

Republic

Farm Name

Robinson B

Land Classification

Grat.

Sec.

35

Top 17

Feet from Line:

N. 320 2230

Elevation

3542

Contractor

Wm Walsh

Spudded 6-26

Completed 10-27

Bond Status

ACID RECORD

Casing and Cementing Record
Amount

Size	Feet	Inches	Sec. Cement
8 1/4	501		50
7	2098		100

Gals.

Prod.

Prod.

Top Pay

Total Depth

SHOOTING RECORD

No. of Quarts

40

Shot at

2620-50 Feet


No. of Quarts

90

Shot at

2620-50 Feet

Date		Date	
6-24	Blk. R/L	8-30	T.D. 3020 Gr L
6-28	φ 70 R/L		Fishing bit
7-6	φ 1070 B	8-6	φ 3090 Gr L
	2 1/2 BWPA 350	9-13	φ 1320 Gr L
7-18	φ 1612 A		Fishing bit
7-19	φ 2170 B		50 3165-70
7-26	T.D. 2520 L		
	WOC	SEP 27 1939	T.D. 3020 L
7-2	φ 2626 L		φ 400
	φ 2550 L		50
	1/4 2610-20 3 1/2 M2	SEP 27 1939	T.D. 3302 L
8-9	3/4 2620-25 S		50
	φ 2705 L		
	3 3/4 2638-42 L	OCT 4 1939	T.D. 3302
8-16	φ 2885 L		Shot after
	5 1/2 2738-44	OCT 11 1939	Then 016
8-23	T.D. 3030 Gr L		T.D. 3302
	Fishing bit		



LOG OF OIL OR GAS WELL

Roswell, New Mexico

LOCATE WELL CORRECTLY

Company Republic Production Company Address Artesia, New Mexico.

Lessor or Tract Robinson Field Loose Hills State New Mexico

Well No. 3-3 Sec 35 T17 R35 Meridian N. M. P. M. County Sidg

Location 330 ft. N. of 3 Line and 330 ft. E. of 3 Line of Sec. 35 Elevation 5545
(Derrick floor relative to sea level)

The information given herewith is a complete and correct record of the well and all work done thereon so far as can be determined from all available records.

Signed H. M. Baird *MBaird*

Date November 5, 1939. Title Drp.

The summary on this page is for the condition of the well at above date.

Commenced drilling June 24, 1939., 19... Finished drilling Sept. 16, 1939., 19...

OIL OR GAS SANDS OR ZONES

(Denote gas by G)

No. 1, from 2618 to 2620 No. 4, from 2641 to 2644

No. 2, from 2624 to 2626 No. 5, from ... to ...

No. 3, from 2630 to 2631 No. 6, from ... to ...

IMPORTANT WATER SANDS

No. 1, from 340 to 350 No. 3, from ... to ...

No. 2, from ... to ... No. 4, from ... to ...

CASING RECORD

Size casing	Weight per foot	Threads per inch	Make	Amount	Kind of shoe	Cut and pulled from	Perforated		Purpose
							From	To	
<u>3 1/2</u>	<u>26</u>	<u>8</u>		<u>400</u>	<u>Cam.</u>				
<u>3 1/2</u>	<u>24</u>	<u>10</u>		<u>2490</u>	<u>Float 1</u>				

MUDDING AND CEMENTING RECORD

Size casing	Where set	Number sacks of cement	Method used	Mud gravity	Amount of mud used
<u>3 1/2</u>	<u>490</u>	<u>50</u>	<u>Balliburton</u>		
<u>3 1/2</u>	<u>2490</u>	<u>100</u>	<u>"</u>		<u>5 tons</u>

PLUGS AND ADAPTERS

Heaving plug—Material ... Length ... Depth set ...

Adapters—Material ... Size ...

SHOOTING RECORD

Size	Shell used	Explosive used	Quantity	Date	Depth shot	Depth cleaned out
<u>3 1/2</u>		<u>Nitre-glycerine</u>	<u>40 Qts</u>	<u>9-17-39</u>	<u>2630-50</u>	<u>2640</u>
<u>3 1/2</u>		<u>"</u>	<u>30 "</u>	<u>10-5-39</u>	<u>2620-50</u>	<u>2630</u>

TOOLS USED

Rotary tools were used from ... feet to ... feet, and from ... feet to ... feet.

Cable tools were used from Surface feet to 5302 feet, and from ... feet to ... feet.

DATES

Put to producing October 22,

The production for the first 24 hours was ...

FOLD MARK

30-015-03790

OGRID 26478