

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE\*  
(Other instruction on re-  
verse side)

Budget Bureau No. 1004-0135  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC 028936-g

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Brigham

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Loco Hills-Q-G-SA

11. SEC., T., R., M., OR BLK. AND  
SURVEY OR AREA

Unit P, Sec. 31-T17S-R30E

12. COUNTY OR PARISH

Eddy

13. STATE

NM

SUNDRY NOTICES AND REPORTS ON WELLS


(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ P&A - WIW

2. NAME OF OPERATOR  
Yates Petroleum Corporation

3. ADDRESS OF OPERATOR  
105 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface  
330 FSL & 990 FEL, Sec. 31-T17S-R30E

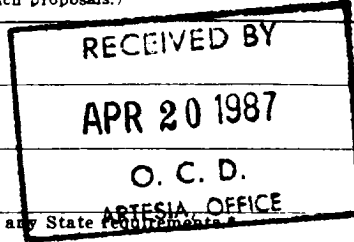

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other)

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON\* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other)

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT\* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) \*

Plugged well as follows:

Tagged CIBP at 2698'. Spot 25 sx cement.

Spot 35 sx cement plug at 2350'.

Perforated 4 shots at 1225'. Squeeze w/75 sx cement to 700 psi. Tag plug at 1060'.

Mixed mud and circulated clean.

Perforated 4 shots at 390'. Attempt to load hole and pressure test perfs, but unable to load hole.

Spot 50 sx cement at 382'. RIH to tag plug, plug was not there.

Re-spot plug w/50 sx cement. Did not tag plug.

Spot 50 sx cement plug at 382'. Tag plug at 300'.

Hooked pump to backside of 7"; unable to pump down 7".

Perforated 4 shots at 50'. Spot 25 sx cement.

Spot 20 sx cement and had cement to surface.

Installed dry hole marker. Note: Heavy mud between plugs.

Well P&A 4-10-87.

18. I hereby certify that the foregoing is true and correct

SIGNATURE

*Monty Goodlett*

TITLE

Production Supervisor

DATE

4-13-87

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

ACCEPTED FOR RECORD

Post ID-2  
4-24-87  
P&A

APR 16 1987

GS

\*See Instructions on Reverse Side