

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-015-04439
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	B-4108
7. Lease Name or Unit Agreement Name	Tallmadge
8. Well No.	1
9. Pool name or Wildcat	Loco Hills Queen-Gybg-San Andres

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator YATES PETROLEUM CORPORATION	
3. Address of Operator 105 South 4th St., Artesia, NM 88210	
4. Well Location Unit Letter N : 990 Feet From The South Line and 1650 Feet From The West Line Section 32 Township 17S Range 30E NMPM Eddy County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon as follows:

1. TIH with tubing and tag CIBP at 2625' (NOTE: CIBP has 35' of cement on top). Load hole with plugging mud. Spot a 25 sack Class C cement plug on top of CIBP.
2. Perforate 7" casing with 6 holes at 1250' and 6 holes at 545'.
3. TIH with wireline set cement retainer and set retainer at 1150'. Sting into retainer and establish injection rate. Squeeze with 60 sacks Class C cement. Leave 35' of cement on top of retainer. TOOH with tubing.
4. TIH with wireline set cement retainer and set retainer at 445'. Sting into retainer and establish circulation. Squeeze with 60 sacks Class C cement from 445-545'. Leave 35' of cement on retainer. TOOH with tubing.
5. Spot a 15 sack Class C cement plug at surface.
6. Install regulation abandonment marker.

NOTIFY OCD-ARTESIA (505-748-1283) 24 HOURS PRIOR TO COMMENCING PLUGGING OPERATIONS

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Rusty Klein TITLE Operations Technician DATE July 12, 2000
TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Mrs. Stubblefield TITLE Field Rep II DATE 2/14/2000
CONDITIONS OF APPROVAL, IF ANY:

WELLNAME: Tallmadge No. 1 FIELD: Loco Hills Queen Groyburg - San Andres
 LOCATION: N 990' FSL 11650' FWL Sec 32, T17S, R30E, Eddy Co. NM
 GL: _____ ZERO: _____ AGL: _____ KB: _____
 SPUD DATE: 11-11-39 COMPLETION DATE: 1-3-40
 COMMENTS: This Well has been Shut in since 9-66

CASING PROGRAM		
SIZE/WT/GR/CONN	DEPTH SET	
8 5/8" 28#	495'	
7" 20#	2705'	
2705'-2870' Open Hole		

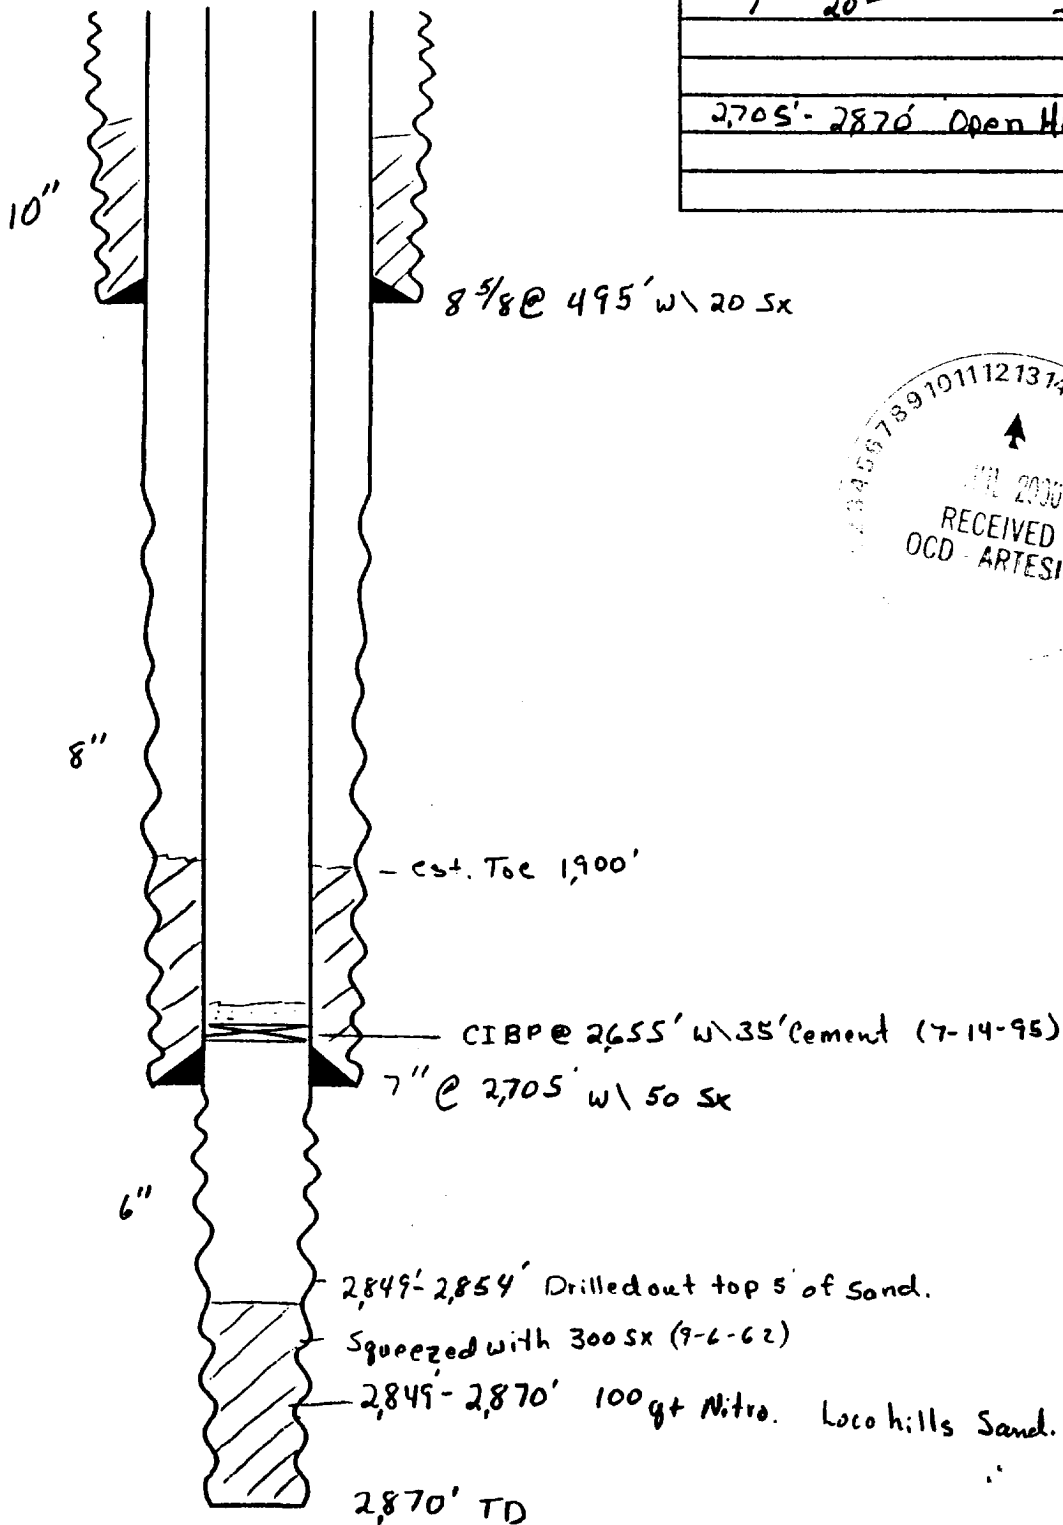

Top Salt 495
 Bottom Salt 1175


WELLNAME: Tallmadge No. 1 FIELD: Loco Hills Queen Groyburg - San Andres
 LOCATION: N 990' FSL 1650' FWL Sec 32, T17S, R30E, Eddy Co. NM

GL: _____ ZERO: _____ AGL: _____ KB: _____

SPUD DATE: 11-11-39 COMPLETION DATE: 1-3-40

COMMENTS: This Well has been Shut in since 9-66

CASING PROGRAM		
SIZE/WT/GR/CONN		DEPTH SET
8 5/8" 28#	495'	
7" 20#	2705'	
2705' - 2870' Open Hole		

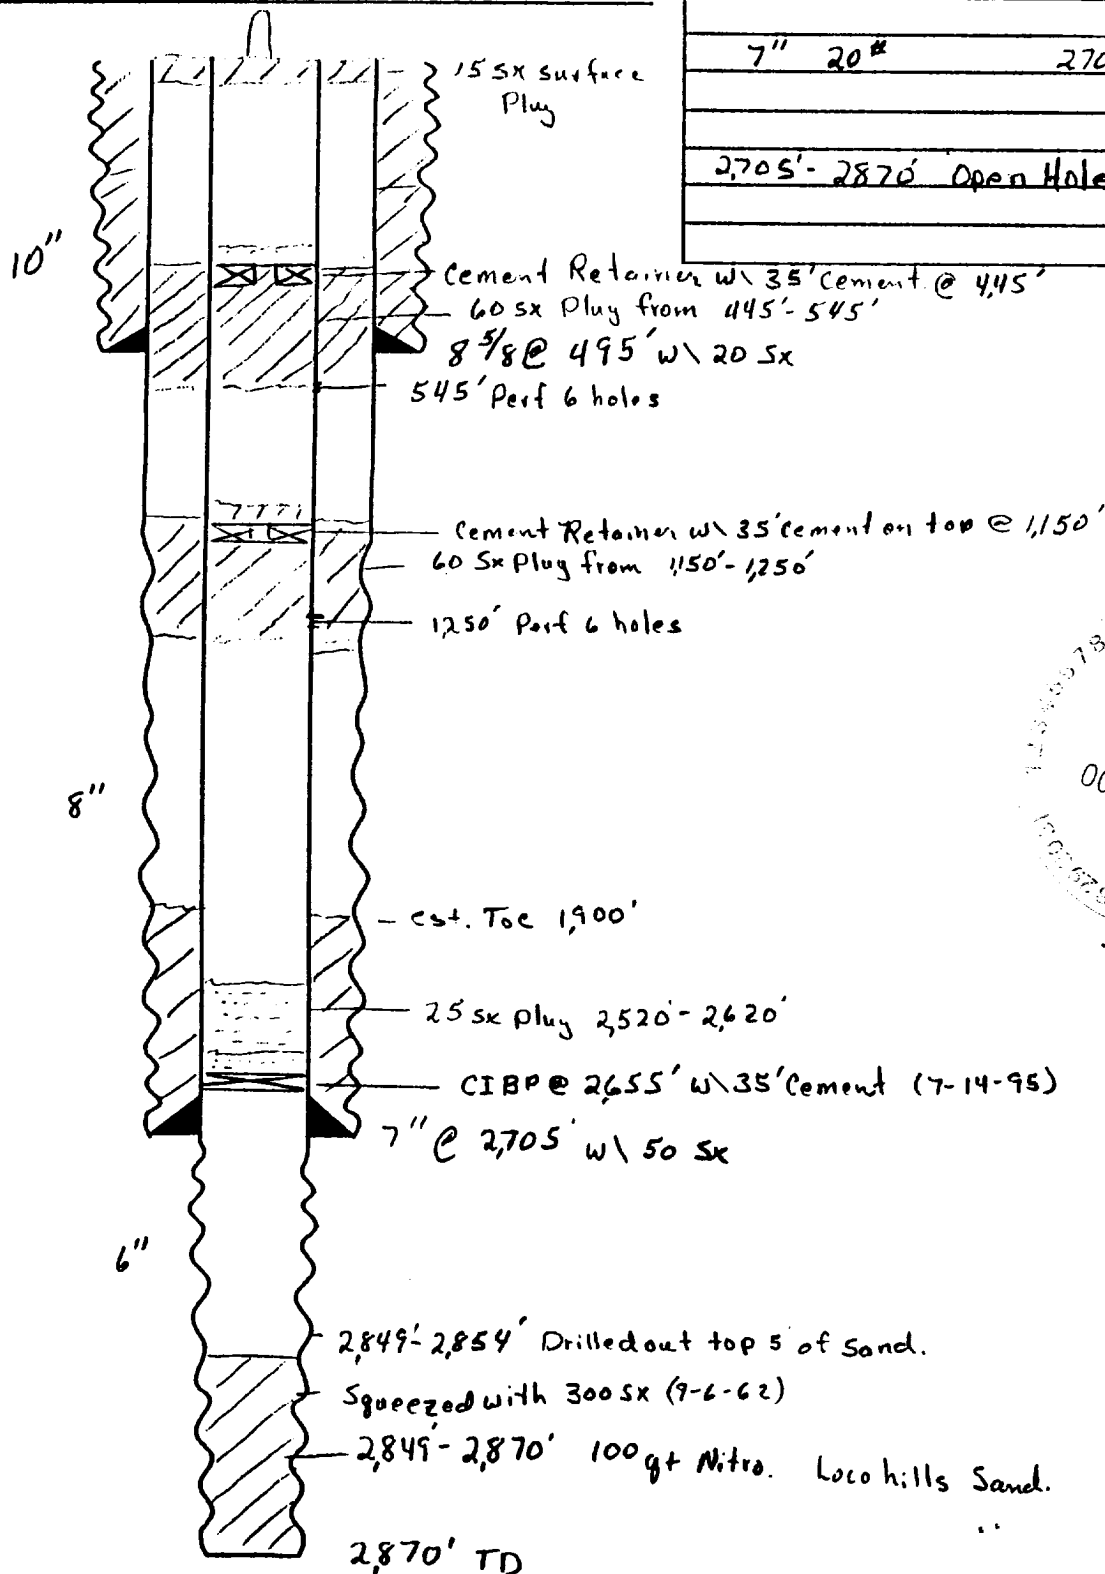

Top Salt 495
 Bottom Salt 1175

- SKETCH NOT TO SCALE -

DATE: 5-18-2000 MH