16.

MILKA OLO, O. COPY

UI ED STATES DEPARTMENT OF THE INTERIOR (Other Instruction verse side)

SUBMIT IN TRIE

ATE*

Budget Bureau No. 42-R1424

5. LEASE DESIGNATION AND SERIAL NO.

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

LC 029426 (b)

	GEOL	OGICAL	SURVEY		
SUNDRY	NOTICES	AND	REPORTS	ON	WELLS

	(Do not use this form for proposal Use "APPLICAT	s to drill or to deepen or plug ION FOR PERMIT—" for such p	back to a different reservoir D		
1.	OIL GAS OTHER		10N 1 0 1077	7. UNIT AGREEMENT NA	ME
2.	NAME OF OPERATOR		JAN 1 2 1977	8. FARM OR LEASE NAM	
	Atlantic Richfield Com	pany	_	H. E. West	B''
3.	ADDRESS OF OPERATOR		a. c. c.	9. WELL NO.	
	P. O. Box 1710, Hobbs,	New Mexico 88240	ARTESIA, OFFICE	8	
4.	LOCATION OF WELL (Report location cle See also space 17 below.) At surface	arly and in accordance with any	State requirements.	Grayburg Jack	
	660' FNL & 660' FEL (U	nit letter D)		11. SEC., T., R., M., OR B. SURVEY OR AREA	LK. AND
	21.2 0 331 122 (31		×	Sec 9-17S-3	1E
14	. PERMIT NO.	15. ELEVATIONS (Show whether D	F, RT, GR, etc.)	12. COUNTY OR PARISH	13. STATE
	·	3882 ' GR		Eddy	N.M.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:			SUBSEQUENT REPORT OF:				
TEST WATER SHUT-OFF		PULL OR ALTER CASING		WATER SHUT-OFF		REPAIRING WELL	
FRACTURE TREAT		MULTIPLE COMPLETE		FRACTURE TREATMENT		ALTERING CASING	
SHOOT OR ACIDIZE		ABANDON*		SHOOTING OR ACIDIZING		ABANDONMENT*	
REPAIR WELL		CHANGE PLANS		(Other)			Ĺ
(Other)	Plug &	Abandon	X	(Note: Report resul Completion or Recor	lts of multiple npletion Report	completion on Well and Log form.)	l

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

This well is uneconomical to produce in the present status & no remedial possibilities exist. TD 3542'. Present completion interval OH 3105-3542'.


8-5/8"OD SW csg set @ 634' & cmtd w/100 sx.

7" OD 20# csg set @ 3105' & cmtd w/200 sx.

Propose to plug & abandon in the following manner:

- 1. Rig up, install BOP, attempt to pull pkr.
- 2. Make trip w/bit & scraper to 3050'.
- 3. RIH w/cmt retr on tbg, set retr @ 3025' & squeeze OH w/200 sx LWL cmt.
- 4. If unable to pull pkr, cut tbg above pkr & POH w/tbg. Make trip w/bit & csg scraper.
- 5. RIH w/7" cmt retr, set above pkr & squeeze OH 3105-3542' w/200 sx LWL cmt. PO retr & set cmt plugs in 7" csg across Yates & 7 Rivers @ 1740-1850' & across base of salt @ 1575'.
- 6. Perforate 7" csg @ 600' & set cmt retr @ 550'. Circ cmt to surf between 8-5/8" X 7"
- 7. Set cmt plug @ surface & install regulation dry hole marker, clean & install regulation.

			•	
18. I hereby certify that the foregoing is true and correct	-			
SIGNED	TITLE_	Dist. Drlg. Supv.	DATE <u>5/14/76</u>	
(This space for Federal or State office use)				
APPROVED BY The Land	TITLE	ACTING DISTRICT ENGINEER	DATE JAN 1 1 1977	
APPROVED DI	11111111			

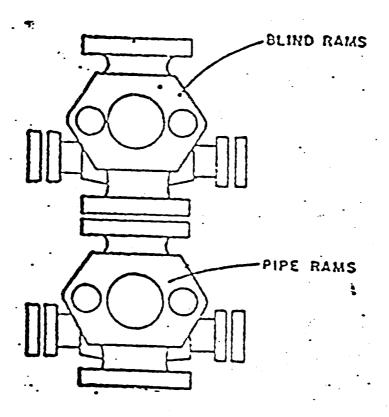

ATLANTIC RICHFIELD COMPANY Blow Out Preventer Program

Lease Name	H. E. West "B"
Well No.	8
Location	660' FNL & 660' FEL
	Sec 9-17S-31E, Eddy County

working condition during drilling. A:
wellhead fittings to be of sufficient pressure to operate in a safe manner working condition during drilling. All

M. S. GEOLOGICAL SURVEY
ARTESIA. NEW MEXICO