


STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input type="checkbox"/>
LAND OFFICE	<input type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

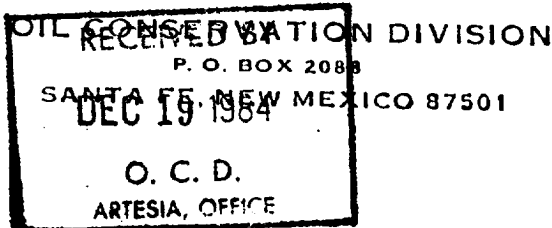

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.
E-6353

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Harvey E. Yates Company	8. Farm or Lease Name Arco 8 State Com
3. Address of Operator P. O. Box 1933, Roswell, New Mexico 88201	9. Well No. 1
4. Location of Well UNIT LETTER <u>L</u> <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>8</u> TOWNSHIP <u>17S</u> RANGE <u>29E</u> NMPM.	10. Field and Pool, or Wildcat Und. <u>South Empire Morrow</u>
15. Elevation (Show whether DF, RT, GR, etc.) 3639'	12. County Eddy

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11/11/84 MI & RU CU. Perf @ 3607' to 3657' (8 holes, 1 spf).
11/13/84 Spot 250 gal 15% SRA
11/15/84 Set CIBP @ 3590' w/35 sxs cmt on top, PBTD @ 3555'.
11/16/84 Perf 3010' to 3028' (11 holes). Spot 250 gas 15% SRA wash acid across form.
11/18/84 Acidize w/3000 gal SRA & 22 ball sealers & flush w/2% KCL.
11/21/84 Frac San Andres & perf 3010 to 3028' w/60,000 gal wtr Frac-40 w/3% HCL, 20,000#
20-40 sand, & 100,000 12-20 sd.
11/22/84 Hook well up to production.
12/17/84 Form wtr rec well began producing oil.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. J. Deans TITLE V. P. of Operations DATE 12/18/84

Original Signed By
Mike Williams

APPROVED BY Oil & Gas Inspector TITLE Oil & Gas Inspector DATE DEC 31 1984

CONDITIONS OF APPROVAL, IF ANY: