

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

CISF  
Op

**OIL CONSERVATION DIVISION**

2040 Pacheco St.  
Santa Fe, NM 87505

DISTRICT I

P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. <b>30-015-31635</b>
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. <b>V4282</b>
7. Lease Name or Unit Agreement Name <b>OPL GOE State</b>
8. Well No. <b>1</b>
9. Pool name or Wildcat <b>Undsg. Cedar Lake Morrow</b>

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)


1. Type of Well:  
OIL WELL  GAS WELL  OTHER  **Drill Hole**

2. Name of Operator  
**Occidental Permian Limited Partnership**

3. Address of Operator  
**P.O. Box 50250 Midland, TX 79710-0250**

4. Well Location  
Unit Letter **P** : **660** Feet From The **South** Line and **860** Feet From The **East** Line  
Section **36** Township **17S** Range **30E** NMPM **Eddy** County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
**3594'**

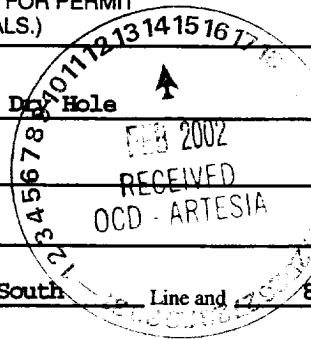

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

SEE OTHER SIDE

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE *David Stewart* TITLE Sr. Regulatory Analyst DATE 2/14/02

TYPE OR PRINT NAME David Stewart TELEPHONE NO. 915-685-5717

(This space for State Use) **ORIGINAL SIGNED BY TIM W. GUM**  
**DISTRICT II SUPERVISOR**

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE **FEB 19 2002**

CONDITIONS OF APPROVAL, IF ANY:

ATTACHMENT C-103 OPL GOE STATE #1

11/24/2001 CMIC:RICK MESSENGER

RIG DOWN PICK UP MACHINE; INSTALL TORQUE WHEEL; TIH TO TCO ; PU KELLY & DRLG FLOAT, PLUG & CEMENT; DRILLING NEW FORMATION @ 401345 HJRTS; DRILLED 10 FT OF NEW HOLE; PICK UP CLOSE HYDRIL & TESTED SHOE TO 11.5#/GAL. EQ. (625#), TESTED OK; DRILLING; CHANGE ROTARY SPROCKET; DRILLING AHEAD, NO PROBLEMS;

11/25/2001 CMIC:RICK MESSENGER

DRILLING; WL SURV EY @ 4510 - 1/4 DEGREES; DRILLING; SERVICE RIG; DRILLING; CIRC; PU & SI TO WELD CONNECTION ON FLOWLINE; DRILLING;

11/26/2001 CMIC:RICK MESSENGER

DRILLING; WL SURVEY @ 4984' - 3/4 DEGREES; DRILLING; SERVICE RIG; DRILLING;

12/02/2001 CMIC:JAMES BAUCOM

POH CHANGE BHA, TIH WASH 20' TO BOTTOM, NO FILL, DRILLING W/30-50K WT

12/03/2001

DRILLING AND WL SURVEYS W/ 30-50K WT

12/04/2001 CMIC:BOB LANGE

DRILLING F/ 7716' TO 7797' W/ SURVEY. TRIP FOR PRESSURE LOSS, 70 STANDS & A SINGLE, PIN END. TRIP IN HOLE. DRILLING F/ 7797' TO 7830'. TRIP FOR PRESSURE LOSS.

12/05/2001 CMIC:BOB LANGE

TRIP IN HOLE, CUT DRILLING LINE, TRIP IN HOLE. DRILLING F/ 78730' TO 7858'. WIRELINE SURVEY @ 7809' - 2.75 DEGREES. DRILLING F/ 7858' TO 7872'. PICK UP & SHUT IN WELL TO WELD MUD LINE. INDIAN FIRE & SAFETY ON LOCATION FOR HOT WORK. DRILLING F/ 7872' TO 7953'. WIRLINE SURVEY @ 7904' - 1.75 DEGREES. DRILLING F/ 7953' TO 8005'. NO PROBLEMS AT REPORT TIME.

12/06/2001 CMIC:BOB LANGE

DRILLING F/ 8005' TO 8230' W/ SURVEYS. NO PROBLEMS AT REPORT TIME.

12/07/2001 CMIC:BOB LANGE

DRILLING F/ 8230' TO 8308'. LOST PRESSURE, PUMP SOFLINE & TRIP FOR PRESSURE LOSS. LAY DOWN OLD 20# PIPE & PICK UP 25 JTS. NEW 20# PIPE. CHANGE BIT & TRIP IN HOLE. DRILLING F/ 8308' TO 8350' W/ SURVEY. NO PROBLEMS AT REPORT TIME.

12/08/2001 CMIC:BOB LANGE

DRILLING F/ 8350' TO 8566' W/ SURVEY. NO PROBLEMS AT REPORT TIME.

12/09/2001 CMIC:BOB LANGE

DRILLING G/ 8566' TO 8700' W/ SURVEY. DRILLED INTO A CRACK, TORQUED UP & BECAME STUCK. WORK STUCK PIPE FREE. DRILLING F/ 8700' TO 8966' W/ SURVEYS. NO PROBLEMS AT REPORT TIME.

12/10/2001 CMIC:BOB LANGE

Daily Remarks:

DRILLING F/ 8960' TO 9294'. BIT TORQUEING UP. TRIP FOR BIT, REAM 60' TO BOTTOM. DRILLING F/ 9294' TO 9325'. NO PROBLEMS AT REPORT TIME.

12/11/2001 CMIC:BOB LANGE

DRILLING F/ 9325' TO 9685'. NO PROBLEMS AT REPORT TIME

12/12/2001 CMIC:BOWKER

DRILLING AHEAD WITH NO PROBLEMS;

12/13/2001 CMIC:RICK MESSENGER

DRILLING; SERVICE RIG & WORK ON ROTATING HEAD; DRILLING;