

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-79

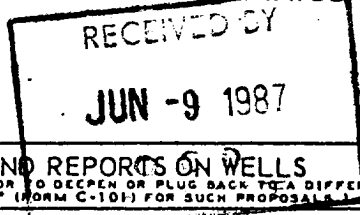

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <u>P&A</u>		7. Unit Agreement Name
2. Name of Operator <u>Yates Petroleum Corporation</u>		8. Farm or Lease Name <u>Martin</u>
3. Address of Operator <u>105 South 4th St., Artesia, NM 88210</u>		9. Well No. <u>2</u>
4. Location of Well UNIT LETTER <u>K</u> <u>1650</u> FEET FROM THE <u>West</u> LINE AND <u>2310</u> FEET FROM THE <u>South</u> LINE, SECTION <u>15</u> TOWNSHIP <u>18S</u> RANGE <u>26E</u> NMPM.		10. Field and Pool, or Wildcat <u>Atoka San Andres</u>
15. Elevation (Show whether DF, RT, GR, etc.) <u>3354' DF; 3345.5' GR</u>		12. County <u>Eddy</u>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

Plugged well as follows:
RUPU. Laid down rods and pump.
Set CIBP at 1275'. Circulate 5-1/2' casing with 10# brine gel.
Plugs set as follows:
Plug #1 1275-1030' 25 sacks Class "C"
Plug #2 858-600' 25 sacks Class "C"
Plug #3 30'-surface 10 sacks Class "C"

Install dry hole marker.
Plugged completed 6-2-87.

Posted ID-2
6-12-87
P&A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Juanita Goodlett TITLE Production Supervisor DATE 6-5-87

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: