

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-00307
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name ATOKA SAN ANDRES UNIT
8. Well No. 121
9. Pool name or Wildcat ATOKA SAN ANDRES

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER INJECTION	
2. Name of Operator PENNZOIL EXPLORATION & PRODUCTION COMPANY	
3. Address of Operator P O BOX 50090 MIDLAND TEXAS 79710-0090	
4. Well Location Unit Letter <u>N</u> : <u>330</u> Feet From The <u>SOUTH</u> Line and <u>2310</u> Feet From The <u>WEST</u> Line Section <u>11</u> Township <u>18S</u> Range <u>26E</u> NMPM <u>EDDY</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3325' GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Tag CIBP @ 1561' and drill out. Circ hole clean.
2. Ran GR/CNL log from 1696' to 600'.
3. Perf San Andres 1517' - 1690' total 116 holes 6 runs w/4" Csngr. guns 2 JSPF.
4. Acidize w/6500 gals 15% HCL, dropping 150 ball sealers.
5. Install injection assembly, set AD-1 Tension pkr. @ 1468', EOT 1471', perform mechanical integrity test as per State Regs. Placed well on injection.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Sharon Hindman TITLE Production Assistant DATE 8/4/97


TYPE OR PRINT NAME Sharon Hindman TELEPHONE NO. 915 686-3505

(This space for State Use) ORIGINAL SIGNED BY THE STATE

DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE AUG 28 1997

CONDITIONS OF APPROVAL, IF ANY:

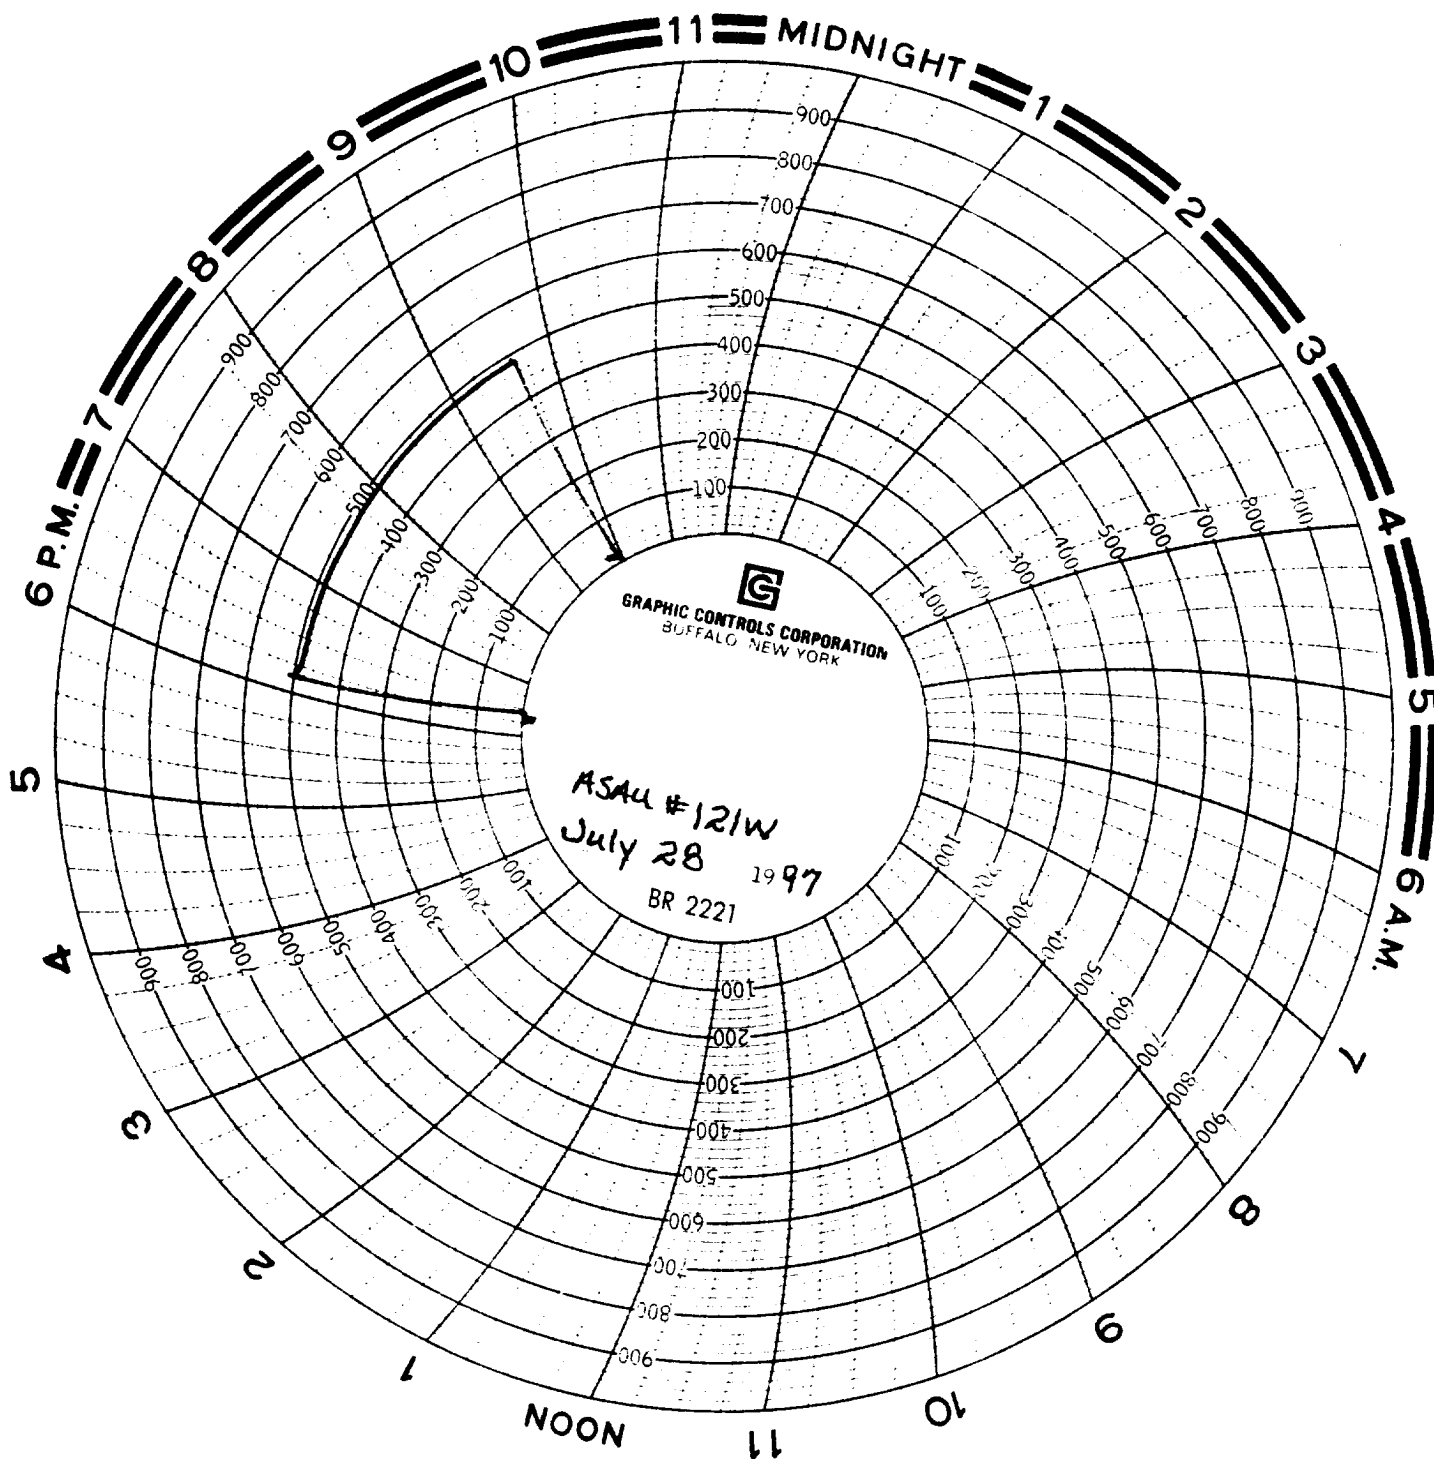

Thong Press 0*

Cang Press 480*

BRADEN Hotel Press 0*