

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPL  
(Other instructions  
verse side)

Form approved.  
Budget Bureau No. 1004-0-1  
Expires August 31, 1985

45P

SUNDRY NOTICES AND REPORTS ON WELLS


(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT" for such proposals.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER

2. NAME OF OPERATOR  
ARCO Oil and Gas Company

3. ADDRESS OF OPERATOR  
P. O. Box 1610, Midland, Texas 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.  
See also space 17 below.)  
At surface 660 FSL & 660 FWL Unit Letter M

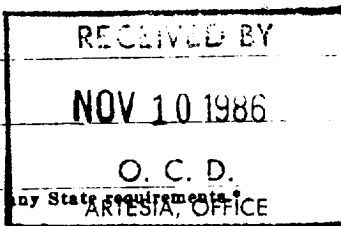

5. LEASE DESIGNATION AND SERIAL NO.  
LC-061783 (b)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME  
Empire ABO Unit "L"

8. FARM OR LEASE NAME

9. WELL NO.  
9

10. FIELD AND POOL, OR WILDCAT  
Empire ABO

11. SEC., T., R., M., OR BLE. AND SURVEY OR AREA  
3-18S-27E

12. COUNTY OR PARISH  
Eddy

13. STATE  
NM

14. PERMIT NO.  
30-015-00753

15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
3543 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREAT

MULTIPLE COMPLETE

FRACTURE TREATMENT

ALTERING CASING

SHOOT OR ACIDIZE

ABANDON\*

SHOOTING OR ACIDIZING

ABANDONMENT\*

REPAIR WELL

CHANGE PLANS

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

- 9-5-86 RU PU. SITP 885#. SICP 0#. Test ann to 600#. OK. POH w/CA, left 3000' 9/64" cable & paraffin cutter in hole.
- 9-6-86 Fish w/full rec.
- 9-8-86 Set RBP @ 5200'. Test to 500#. OK. Run pipe recovery log/5169-surf. Indic TOC @ 4090. Perf 4 sqz holes @ 4060 in 5-1/2" csg. Set pkr @ 3950. Circ out 8-5/8 X 5-1/2 ann w/100#.
- 9-9-86 Set CR @ 3950. Sqz perf @ 4060 w/960sx "H" w/40% gel followed by 100sx C1 "H" neat. Circ cmt out 8-5/8" X 5-1/2 ann/
- 9-10-86 DO CR @ 3950. DO cmt f/3952-4000.
- 9-11-86 DO cmt & stringers to 4150. Test csg f/suf to 5901 to 500#. OK. POH w/RBP.
- 9-12-866 RIH w/CA. RD. PU.

ACCEPTED FOR RECORD

NOV 6 1986

CARLSBAD, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

915-688-5672

SIGNED

*Ken W. Gosnell*

TITLE

Engr. Tech. Spec.

DATE

10-31-86

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side