

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

NM OIL CONS COMMISSION
Drawer DD
Artesia, NM 88211-0130

APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Anadarko Petroleum Corporation

3. Address and Telephone No.

PO Box 130, Artesia, NM 88211-0130 (505) 677-2411

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UL-G, 2310' FNL & 2290' FEL, Sec. 8, T18S, R29E

5. Lease Designation and Serial No.

LC-050906

6. If Indian, Allottee or Tribe Name

NA

7. If Unit or CA, Agreement Designation

Ballard Grayburg
San Andres Unit

8. Well Name and No.

Ballard Tract 5, Well 5

9. API Well No.

30-015-03333

10. Field and Foot, or Exploratory Area

Loco Hills-On-GB-SA

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(es) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non Routine Fracturing

☐ Water Shut Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Note: See attached well diagram for well information.

1. RUPU. TOH with rods & tbg.
2. Set CIBP at 2715' and dump 35' cement on top. This plug isolates the San Andres formation.
3. Set a CIBP at 2300' and dump 35' cement on top. This plug isolates the Grayburg formation.
4. Set a CIBP at 2200'. GIH with tbg and circulate salt gel mud. Spot 60 sx Class C cement from 2200' up to 1850'. TOH. This plug isolates hole in casing at 2253' and covers Queen formation.
5. Perforate 4 squeeze holes at 835' (100' below salt). GIH with pker and cement squeeze with 30 sx Class C with 2% CaCl, leaving 100' of cement in and out of 7" csg. WOC. TOH. Tag top of plug. This plug covers base of salt.
6. Perforate 4 squeeze holes at 360' (top of salt). GIH with pker and cement squeeze with 30 sx Class C cement with 2% CaCl, leaving 100' of cement in and out of 7" csg. WOC. TOH. Tag top of plug. This plug covers top of salt and 8 5/8" csg shoe.

(Cont'd)

14. I hereby certify that the foregoing is true and correct

Signed

Title Field Foreman

Date 01-24-95

(This space for Federal or State office use)

Approved by Shannon J. Shaw
Conditions of approval, if any:

Title PETROLEUM ENGINEER

Date 2/16/95

Anadarko Petroleum Corporation
Sundry Notice
Ballard Tract 5, Well 5
01-24-95
Page 2 2178.6

7. Perforate 4 squeeze holes at 50'. Circulate cement down 7" and up 8 5/8" csg. Dig out around 8 5/8" csg and ready mix to surface. This is the surface plug.
8. Cut off all csg and anchors. Set P&A marker. Will do surface restoration after receiving orders from BLM.



PETROLEUM CORPORATION


Mailing Address:
P. O. Drawer 130
Artesia, New Mexico 88211-0130

Office Location:
132829 #1
Lovington Hwy.
Loco Hills, New Mexico 88255
Off: (505) 677-2411
Fax: (505) 677-2414

11/7/94

Elev - 3515' GL

Ballard 5-5

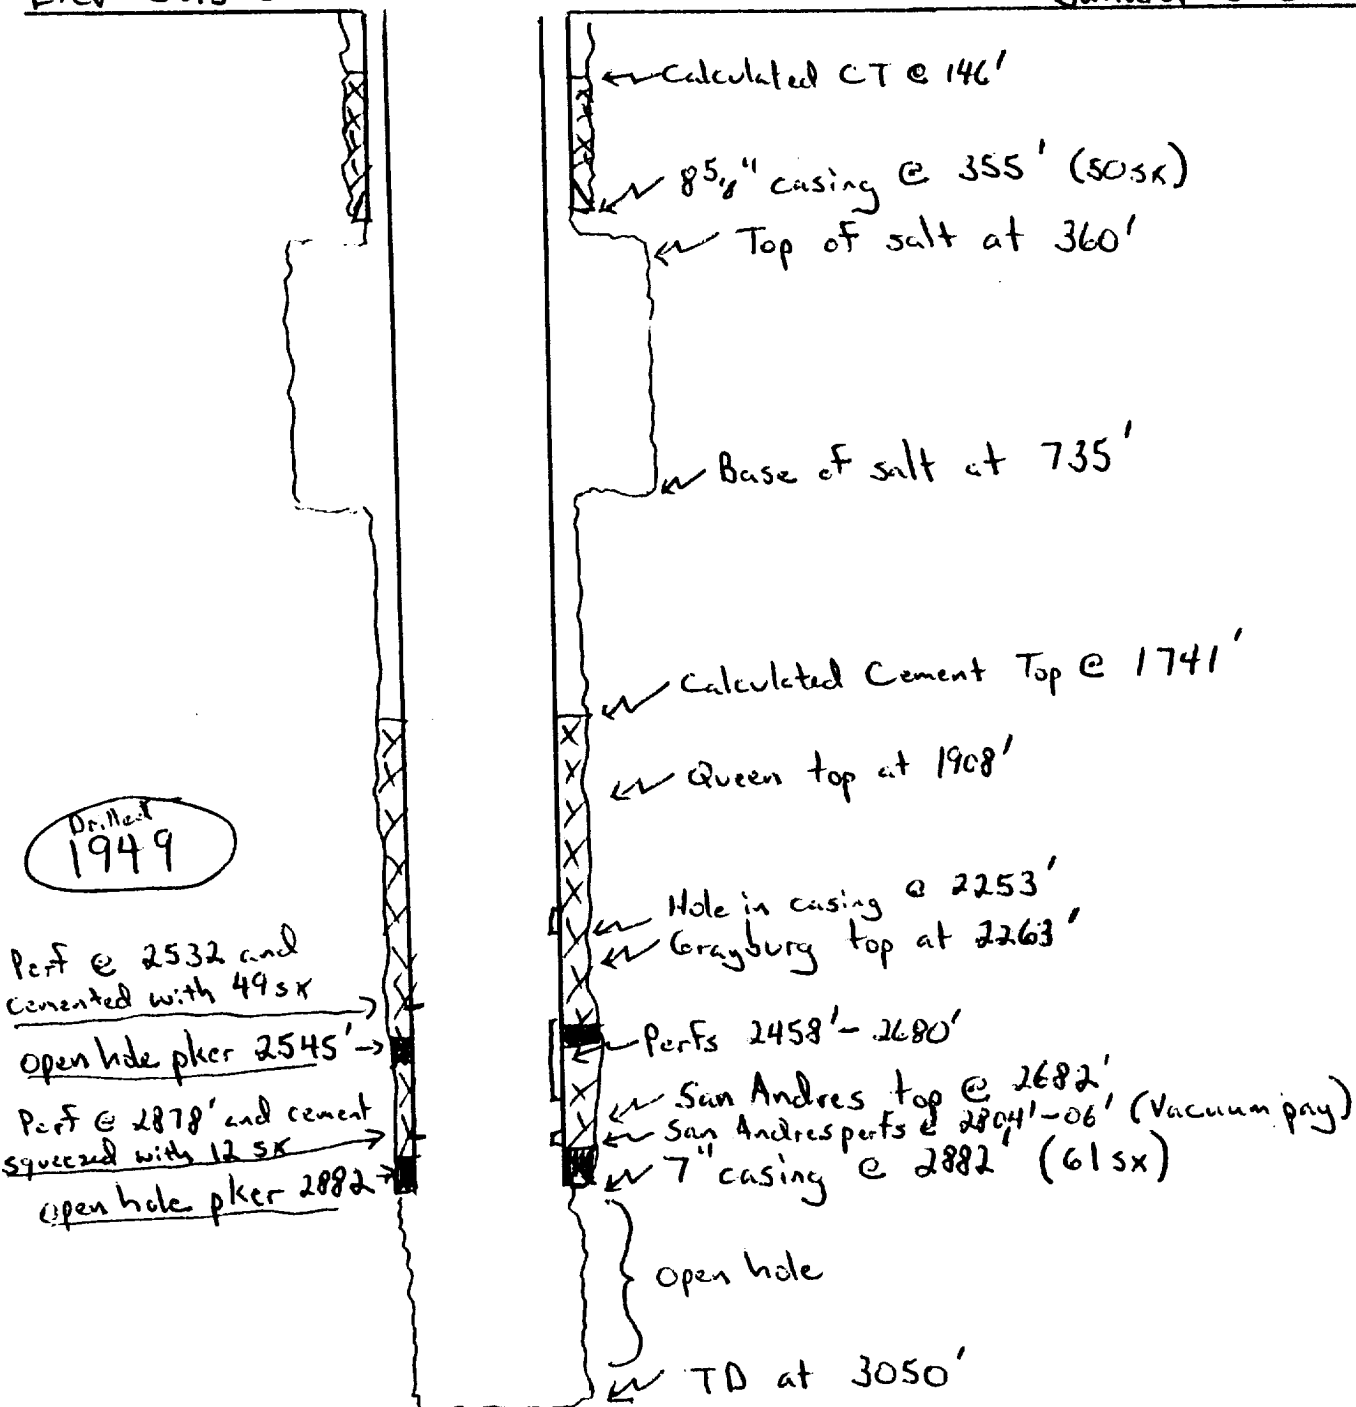



PETROLEUM CORPORATION

Mailing Address:
P. O. Drawer 130
Artesia, New Mexico 88211-0130

Office Location:
132829 #1
Lovington Hwy.
Loco Hills, New Mexico 88255
Off: (505) 677-2411
Fax: (505) 677-2414

11/7/94

Elev - 3515' GL

After P + A

Ballard S-5

