

Form 9-331
(May 1963)UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on reverse side)Form approved.
Budget Bureau No. 42-R1421.

5. LEASE DESIGNATION AND SERIAL NO.

LC-065014

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Max Friess MA

9. WELL NO.

3

10. FIELD AND POOL, OR WILDCAT

Grayburg Jackson QGSA

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

30-17S-31E

12. COUNTY OR PARISH

Eddy

13. STATE

N.M.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☒ GAS WELL ☐ OTHER ☐2. NAME OF OPERATOR ARCO Oil and Gas Company ✓ AUG 14 1979
Division of Atlantic Richfield Company

3. ADDRESS OF OPERATOR

P. O. Box 1710, Hobbs, New Mexico 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1980' FNL & 1980' FEL (Unit letter G)

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3595' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZING ☐REPAIR WELL ☐

(Other) Plug & Abandon

PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

TD 3451', PB D 3420'. Presently completed from perfs 2908-2910' & 3250-3274'. CIBP @ 2846' 10-3/4" OD 28.6# spiral weld csg set @ 586'. Cmdt w/100 sx.

7" OD 17 & 20# J-55 csg, set @ 3451'. Cmdt w/100 sx.

TOC @ 2400' FS.

The present Grayburg Jackson QGSA is depleted in this well. No other zones appear to be economically productive. Propose to P&A in the following manner:

1. Rig up, load csg w/fresh water, run CBL 2846' to surf.
2. Perforate 2' - 2 JSPF @ +2800' as determined by CBL.
3. Set retr @ +2750' & circ salt saturated cmt to surf.
4. Spot 100' cmt plug 650-550'.
5. Cut off wellhead 3' below GL. Spot cmt in top 10'-12' of 7" & 10-3/4" csg. Spot heavy mud between all cmt plugs.
6. Install regulation dry hole marker @ surf. Clean & level location for abandonment.

RECEIVED

18. I hereby certify that the foregoing is true and correct

SIGNED

Albert R. Stall

TITLE Dist. Drlg. Supt.

DATE 8/1/79


(This space for Federal or State office use)

APPROVED BY (Orig. Sgl.) ALBERT R. STALL

TITLE ACTING DISTRICT ENGINEER

DATE AUG 13 1979

CONDITIONS OF APPROVAL, IF ANY:

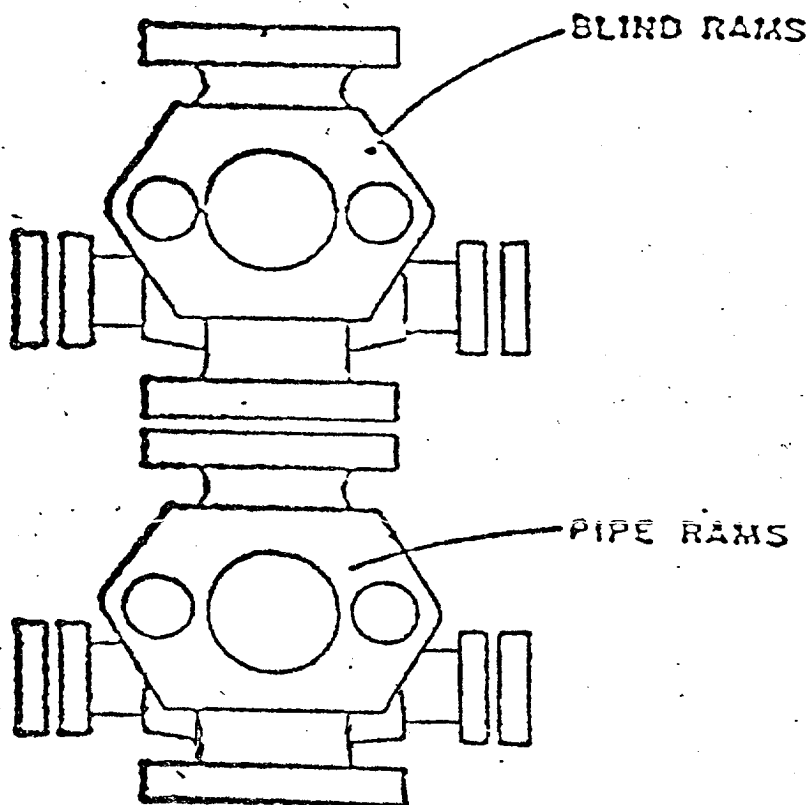

ATLANTIC RICHFIELD COMPANY
Blow Out Preventer Program

Lease Name Max Friess MA

Well No. 3

Location 1980' FNL & 1980' FEL
Sec 30-17S-31E, Eddy County

BOP to be tested before installed on well and will be maintained in good working condition during drilling. A wellhead fittings to be of sufficient pressure to operate in a safe manner.

RECEIVED
FEB 1980
U.S. DEPT. OF THE INTERIOR
BUREAU OF LAND MANAGEMENT