

RECEIVED BY
MAY 1985

SEP 25 1985

UNITED STATES DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

O. C. D. SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
ARTESIA, OFFICE Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> WTW P & A	7. UNIT AGREEMENT NAME West Loco Hills Grb #4 SD 1
2. NAME OF OPERATOR Newmont Oil Company	8. FARM OR LEASE NAME Tract 4
3. ADDRESS OF OPERATOR P. O. Box 1305 Artesia, N.M. 88210	9. WELL NO. 2
1. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990' FSL 2310' FWL Sec. 12-18S-R29E	10. FIELD AND POOL, OR WILDCAT Loco Hills (Q.G. SA)
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 3504'
12. COUNTY OR PARISH Eddy	13. STATE N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Plugged and abandoned well as follows....

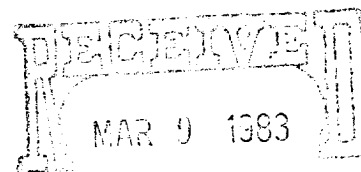
1/18/83....Set CIBP @ 2542'.

1/19/83....Spotted 25 sacks on top of bridge plug. Perf 4 shots @ 1027'. Squeezed 50 sack into perfs @ 300 psi

1/20/83....Pressured plug to 1000 psi. Tagged plug with wireline @ 770'. Perf. 4 shots @ 400'. Bullhead squeezed 50 sacks.

1/22/83...Tagged plug @ 135' with wireline. Pumped 60 sacks, circulated to pit, Set P&A marker

Location ready for inspections

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWEIL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Area Manager

DATE

3/8/83

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

9-23-85

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side