

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT


OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-73

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	<input type="checkbox"/>
LAND OFFICE	<input type="checkbox"/>
OPERATOR	<input checked="" type="checkbox"/>

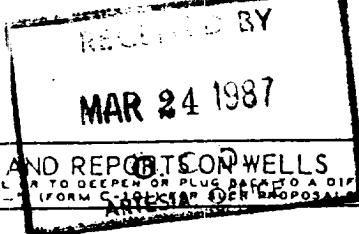

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-103) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P&A	7. Unit Agreement Name
2. Name of Operator Yates Petroleum Corporation	8. Farm or Lease Name Midwest HH Com
3. Address of Operator 105 South 4th St., Artesia, NM 88210	9. Well No. 1
4. Location of Well UNIT LETTER <u>F</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>West</u> LINE, SECTION <u>21</u> TOWNSHIP <u>18S</u> RANGE <u>27E</u> NMPM.	10. Field and Pool, or WHDCat Undes. Strawn
15. Elevation (Show whether DF, RT, GR, etc.) 3345' GR	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged well as follows:
Made several attempts to set CIBP, could not set.
Contacted NMOCD, Artesia and got permission to spot plug as follows:
Spotted 25 sx cement plug at 8820'. Tagged plug at 8430'.
Mix mud and circulate hole.
Cut and pulled 4 1/2" casing from 6195'.
RIH with 3-7/8" bit, 2 subs and tubing to 3709'. Hook up swivel and pump.
Drill 2-1/2 hrs, no hole made. Consult with NMOCD, Artesia. Drill remaining of PM with no hole made. Called Les Clements, NMOCD, Artesia, and obtained approval to set cement plug after drilling on bridge all day. POOH w/tubing, subs and bit.
Spot 35 sx cement plug at 3709'. Tagged plug at 3600'.
Spotted 35 sx cement plug at 3250'.
Spotted 35 sx cement plug at 1675'. Tagged plug at 1558'.
Spotted 35 sx cement plug at 300'.
Set 10 sx surface plug.
Cut off wellhead. Weld on plate and dry hole marker.
Plugging completed 3-18-87.

Post ID-2
4-3-87
P&A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Supervisor DATE 3-20/87

APPROVED BY [Signature] TITLE Geologist DATE 1/16/89

CONDITIONS OF APPROVAL, IF ANY: