

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

CISF
Ep

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-015-22906
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Empire Abo Unit "I"
8. Well No. 292
9. Pool name or Wildcat Empire Abo


SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	
2. Name of Operator ARCO Permian	
3. Address of Operator P.O. Box 1089 Eunice, NM 88231	
4. Well Location Unit Letter P 4 Feet From The 485 N Line and 1070 Feet From The W Line Section 4 Township 18S Range 28E NMPM Eddy County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3663.6' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD: 6350' PBD: 6288' CIBP: 6044' PERFS: 6066-6084'

09/15/97: Set CR @ 6195'. Squeeze 6200-6220' w/100 sxs Class "C" Neat. Perf 6106-6130' w/4" csg gun, 2 JSPF, 48 holes. Acidize 6106-6130' w/2000 gals acid using 75 ball sealers. Set CIBP @ 6095'. Perf abo 6066-6084' Acidize w/1000 gals 15% acid using 50 ball sealers. Set CIBP @ 6044'. Load and test CIBP to 580#, held OK. Well T&A'd. Pressure test chart attached.

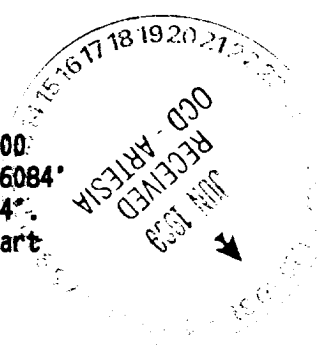

This Approval of Temporary Abandonment Expires Sept 15, 2002

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SGNATURE Kellie D. Murrish TITLE Administrative Assistant DATE 06/29/99
TYPE OR PRINT NAME Kellie D. Murrish TELEPHONE NO. 505-394-1649

(This space for State Use)

APPROVED BY [Signature] DATE 7-16-99
CONDITIONS OF APPROVAL, IF ANY: