


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

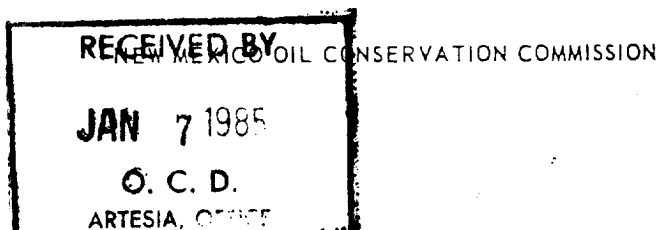

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. V-409

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL - WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER -	7. Unit Agreement Name
2. Name of Operator Santa Rita Exploration Corp. ✓	8. Farm or Lease Name Phoenix St
3. Address of Operator P.O. Box 798, Artesia, New Mexico 88210	9. Well No. #1
4. Location of Well UNIT LETTER D 330 FEET FROM THE North LINE AND 990 FEET FROM THE West LINE, SECTION 36 TOWNSHIP 17S RANGE 31E NMPM.	10. Field and Pool, or Wildcat Und. Maljamar GB-SA
15. Elevation (Show whether DF, RT, GR, etc.) 3827' GL	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input checked="" type="checkbox"/> Perf & acid job
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12/13/84 Ran cement Bond Log  
12/26/84 Ran 2 3/8" tubing  
12/27/84 Spot acid at 4018-4051  
Perforated at 3883,85,87,3900,04,06,08,17,19,21,44,46,48,  
50,62,64,66,81,82,83,4018,19,20,24,33,34,46,50,51  
Total of 29 holes  
Acidized with 1500 gals 15% NE acid  
Swabbed well back  
12.28.84 Swabbed well back

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Mike Williams TITLE Production Clerk DATE 1/3/85

APPROVED BY Mike Williams TITLE Oil & Gas Inspector DATE JAN 9 1985  
CONDITIONS OF APPROVAL, IF ANY: