

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

N.M. Oil Cons. Division  
811 S. 1st Street  
Artesia, NM 88210-2834

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

5. Lease Designation and Serial No.  
NM0676A5

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

North Hackberry Yates Unit

8. Well Name and No.

N. HACKBERRY YATES #115

9. API Well No.

30 015 04616

10. Field and Pool, or Exploratory Area

HACKBERRY YATES RVRS, NORTH

11. County or Parish, State

EDDY CO., NM

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other WATER INJECTION WELL

2. Name of Operator


SOUTHWEST ROYALTIES, INC.

3. Address and Telephone No.

P.O. BOX 11390; MIDLAND, TEXAS

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UNIT LETTER P 660' FSL & 660' FEL, SEC 23, T19S, R30E

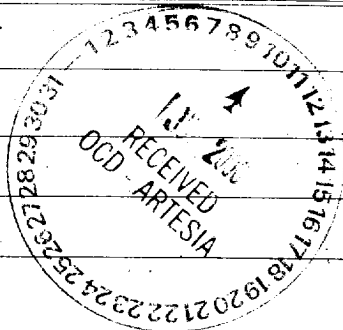

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other


- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

PROPOSE TO P&A:

- 1) CUT OFF STUCK TBG @ 1,600' FS. POH W/TBG.
- 2) CIRCULATE HOLE WITH 9#/GAL MUD.
- 3) RIH & W/4-1/2" CMT RETAINER AND SET @ 1550'.
- 4) PMP 40 SX CLASS "C" CMT THRU RETAINER. (50% EXCESS FOR SQUEEZING PERFS)
- 5) STING OUT OF RETAINER AND PMP 3 SX ON TOP OF CMT RETAINER (43.5' OF CMT).
- 6) PMP 48 SX CLASS "C" CMT FROM 590' - 807' FOR 8-5/8" SHOE PLUG..
- 7) PMP 10 SX CLASS "C" CMT FOR 145' SURFACE PLUG.
- 8) CUT OFF WELL HEAD AND INSTALL 4' X 4" DRY HOLE MARKER.
- 9) FILL IN PITS, CLEAN LOCATION, FILL IN CELLAR, AND RESTORE SURFACE.

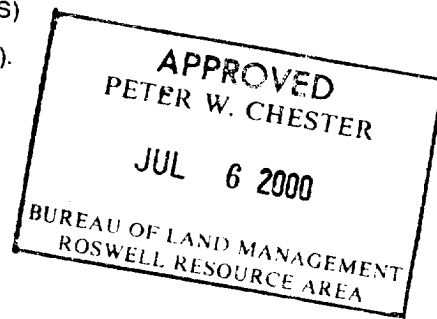

14. I hereby certify that the foregoing is true and correct

Signed

Title AREA SUPERVISOR

Date 06/29/00

(This space for Federal or State Office use)

Approved by

Title

Date

Conditions of approval, if any: