

November 1983
Form 201 (2-77)

DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different formation.
Use "APPLICATION FOR PERMIT—" for such proposals.)

RECEIVED

OIL WELL ☒ GAS WELL ☐ OTHER ☐

1. NAME OF OPERATOR

Siete Oil & Gas Corporation ✓

MAR 03 '88

2. ADDRESS OF OPERATOR

P. O. Box 2523, Roswell, NM 88202

O. C. D.

ARTESIA OFFICE

3. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also above 11 below.)

At surface

330 'FNL & 2260' FEL, NW/4 NE/4

4. LEASE IDENTIFICATION AND SERIAL NO.

NM025777 ✓

5. IF APPLICABLE, ALLOTTEE (or LEASE NAME)

6. NAME OF LEASE NAME

✓ Kechane Federal

7. WELL NO.

#1 ✓

8. SURFACE AND SUBS. OR WILDCAT

Shugart ✓ Q, 5/2, GB, 5/2

9. SEC. T. R. N. OR BLM. AND

GRANT OR AREA

Sec. 24: T18S, R31E

10. COUNTY OR PARISH

Eddy

11. STATE

NM

12. PERMIT NO.

13. ELEVATIONS (Show whether SF, ST, OR, OR)

3720GR ✓

14. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANE

X

SUBSEQUENT REPORT ON:

WATER SHUT-OFF

FRACURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

15. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Plugging Procedure (see attached sketches)

1. Set CIBP @ 3775' + - Set 100' Cement plug on top of CIBP ✓

2. Set 100' Cement plug @ 2200'

* Perf @ ±1100' and pump 150 sk CI.'c' to tie back into 8 5/8" csg. ccs

3. Set 100' Plug @ From 850' to 950' across 8 5/8" surface shoe

4. Perforate 7" casing @ 400' & circulate cement to surface

5. Install 4' legal marker @ surface

Note: 10#/gal Brine to be used between all plugs

16. I hereby certify that the foregoing is true and correct

SIGNED [Signature]

TITLE Production/Reservoir Engineer

DATE 02/23/88

(This space for Federal or State office use)

APPROVED BY _____

TITLE _____

DATE 2-26-88

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

SIETE OIL & GAS CORPORATION

WELL: Keonane Federal No. 1
FIELD: Snugart Y-7Rvrs-Q-G-SA
INTERVAL: 3811'-17'

LOCATION:
330' FNL & 2260' FEL
Section 18, T-18S, R-31E
Eddy County, N.M.


IP: Flowed 120 BOPD on 1/2" choke w/ 980 PSI TP

Comp: 5-3-61

Present Status: Shutin; Well Acquired by Siete O&G in August, 1985

Cum. Oil recovery: 7570 BO, Last Production June, 1985

ELEVATION: 3721' GL

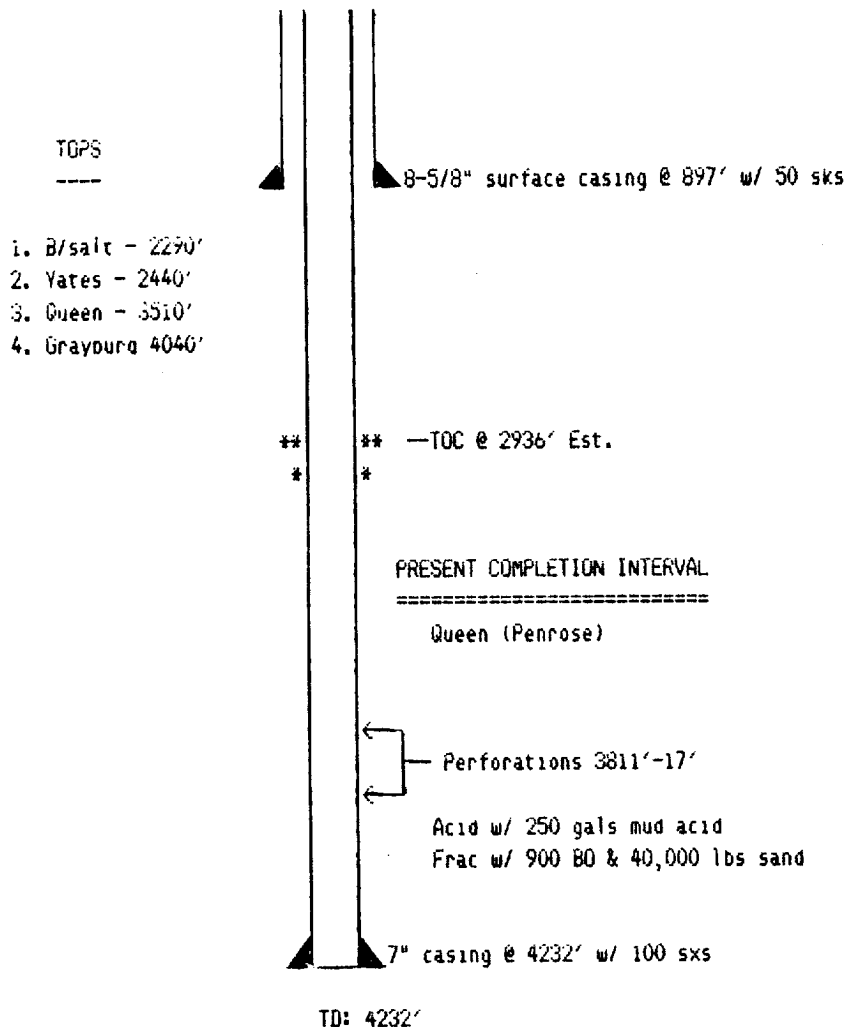

DRAWN BY: JER

DATE: February 23, 1988

- SIETE OIL & GAS CORPORATION

WELL: Keonane Federal No. 1
FIELD: Shugart Y-7Rvrs-Q-G-SA
INTERVAL: 3811'-17'

LOCATION:
330' FNL & 2260' FEL
Section 18, T-18S, R-31E
Eddy County, N.M.


IP: Flowed 120 BOPD on 1/2" choke w/ 980 PSI TP

Como: 5-5-61

Present Status: Shutin; well Acquired by Siete O&G in August, 1985

Cum. Oil recovery: 7570 BO, Last Production June, 1985

Proposed Plugging Detail

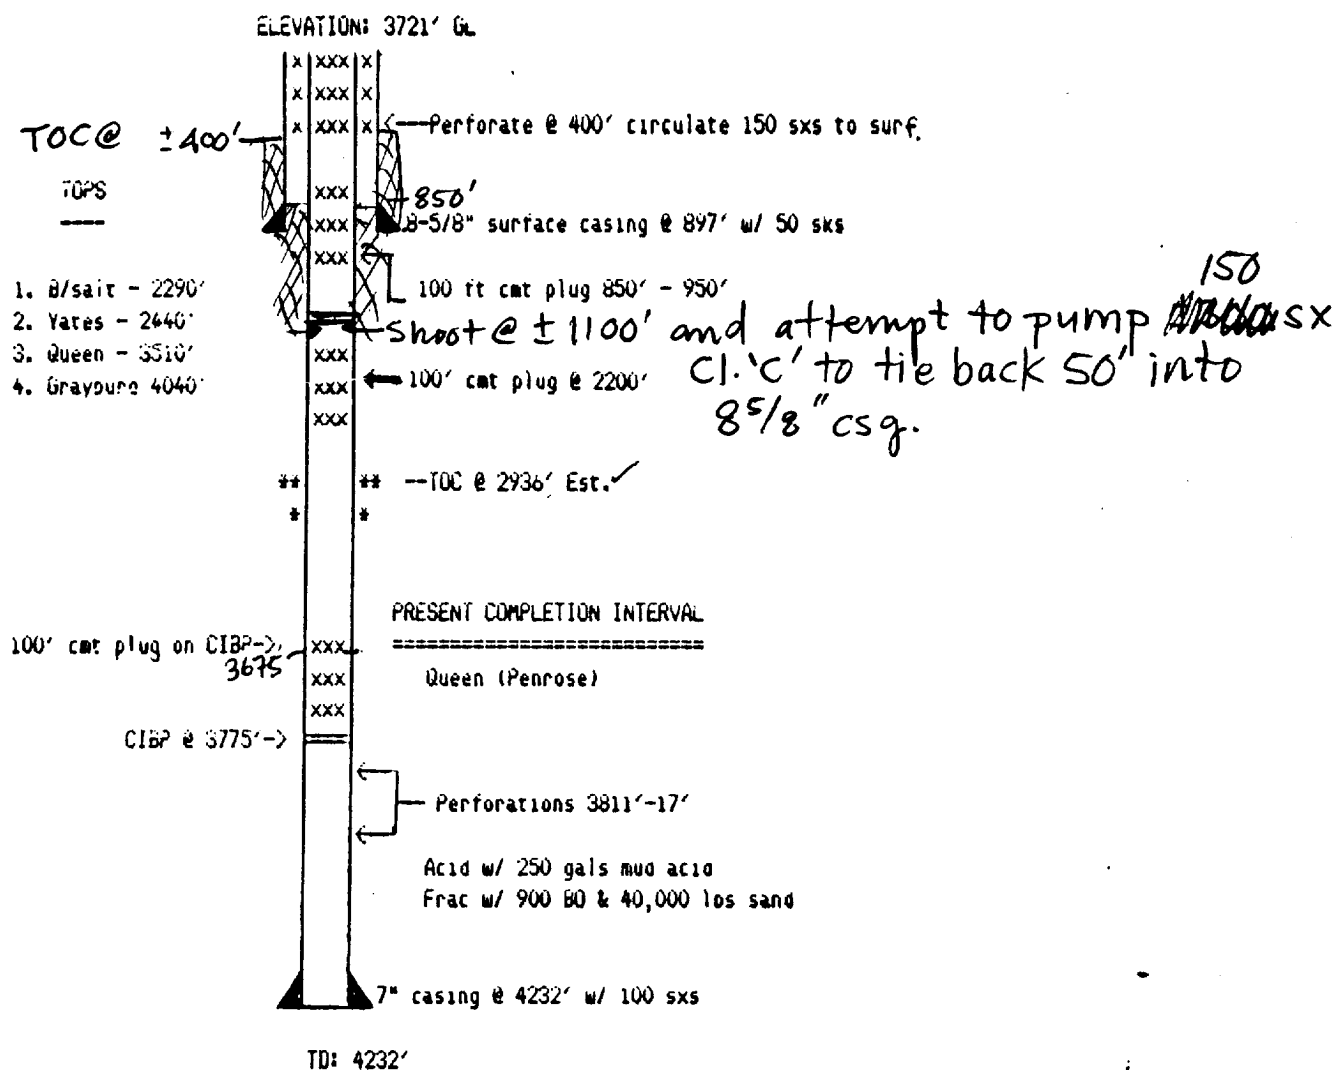

DRAWN BY: JER

DATE: February 23, 1988