

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

Cons.  
N.M. Div-Dist. 2  
1301 W. Grand Avenue  
Artesia, NM 88210  
FORM APPROVED  
Budget Bureau No. 1004-0135  
March 31, 1993  
5. Designation and Serial No.  
L.C. 064577A

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals

**SUBMIT IN TRIPLICATE**

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Aghom Operating, Inc.

3. Address and Telephone No.

P.O.Box 12663 Odessa, Texas 79768 (915) 5500804

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2310 FSL, 2310 FWL, Sec.3, T19S, R31E, Unit K

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

B.I Hanson Federal

8. Well Name and No.

1

9. API Well No.

05722  
30-015-05772

10. Field and Pool, or Exploratory Area

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☐ Other

- ☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Notify BLM 24 hrs before starting

8/58 @ 837'w/ 550sx.cmt

5 1/2 @ 3925 w/ 305 sx cmt perf. 2693 - 2717, 3392 - 3406, 3415 - 3426

1. Set CIBP @ 2600 cap w/ 35' cmt.


2. Spot 100' plug @ 1200' salt tag

3. Per. 5 1/2 @ 887 sqz. 100' plug woc tag ( shoe )

4. Spot cmt 35' to surface

5. Cut off well head install dry hole marker

**SEE ATTACHED FOR  
CONDITIONS OF APPROVAL**

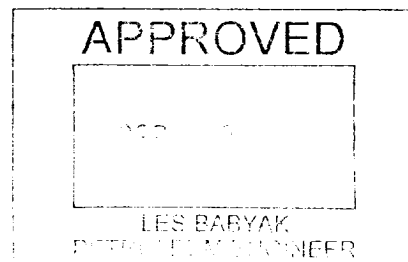

14. I hereby certify that the foregoing is true and correct

Signed Franky William Jr.

Title President

Date 8-27-01

(This space for Federal or State office use)

Approved by file  
Conditions of approval, if any:

Title

Date