


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

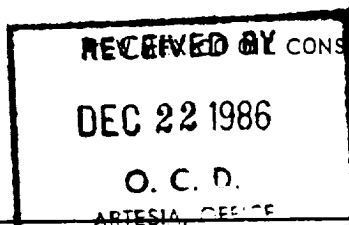

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-85

5a. Indicate Type of Lease
State <input type="checkbox"/> Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator <b>CONOCO INC.</b>	8. Farm or Lease Name <b>Julie Com</b>
3. Address of Operator <b>P. O. Box 460, Hobbs, N.M. 88240</b>	9. Well No. <b>1</b>
4. Location of Well UNIT LETTER <b>H</b> , <b>1980</b> FEET FROM THE <b>North</b> LINE AND <b>990</b> FEET FROM THE <b>East</b> LINE, SECTION <b>17</b> TOWNSHIP <b>19S</b> RANGE <b>25E</b> NMPM.	10. Field and Pool, or Wildcat <b>North Dagger Draw Penn</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3523 SL</b>	12. County <b>Eddy</b>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- ① MIRU. POOH w/ Hg. Set CIBP @ 7960'. Spotted 7 sxs cmt on CIBP. Pumped 45 bbls 9/16 brine mud.
- ② Spotted 25 sxs from 6700'-6850'. Pumped 10 bbls 9/16 brine mud.
- ③ Shot 4 holes @ 5510'. Set ret @ 5465'. Pumped 1000 sxs class "H" cmt and did not get returns @ surface. Spotted 25 sxs on top of retainer
- ④ Shot 4 holes @ 2200'. Set ret @ 2150'. Pumped 525 sxs class "H" and got returns @ surface. Spot 25 sxs cmt from 431'-206'.
- ⑤ Spot 7sxs from 50'-surface. Install P & A marker and rig down on 11-12-86.

Post ID-2  
1-2-86  
PX A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Deanne DF Finney TITLE Administrative Supervisor DATE 12-18-86

APPROVED BY Daniel Moore TITLE Geologist DATE 5/24/87

CONDITIONS OF APPROVAL, IF ANY:

NMCOO-Artesia(3) File