


GEORGE L. SCOTT, JR.
FRANK S. MORGAN
JAMES G. McCLELLAND

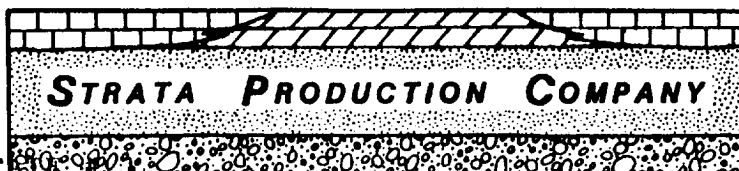

648 PETROLEUM BLDG.
ROSWELL, NM 88201
(505) 622-1127
(505) 622-5891

CHAPARRAL STEEL
SEC 32, T-19-S, R-32-E

03-03-89 PU & rep top jt 4-1/2" csg. Tag TO csg stub @ 6069',
WO stub 5'. Set csg @ that point. SDON.

03-04-89 TIH w/ Taper mill, DC's & tbg. Milled I.D. 4-1/2" @
csg patch from 6069' to 6080'. TOH w/ mill. SDON.

03-05-89 SIH w/ bit, DC's and tbg. SD @ 1:00 P.M. due to high
winds & snow.

03-06-89 SDON.

03-07-89 Drlg past patch to 6137'. Stk pipe in hole & circ
hole clean to TD.

03-08-89 Drld to 6137', tools stk in hole. Not able to drl any
deeper. Worked pipe for 3-1/2 hrs, got string free. TOH w/
tools, discovered one (1) cone missing from bit. SDON.

03-09-89 Strip off BOP, SOH laying dwn csg. TIH w/ tbg & 6"
impression block (IB). SOH laying tbg. SDON.

03-10-89 TOH w/ rest of tbg. Bearing Scvs PU 256 jts 2-3/8"
N-80 tbg & 153 jts 4-1/2" N-80 11.6# csg & del to Artesia yard.
Rel all equip 03-09-89, will rel rig later today. Will place 1 jt
csg in WH & mount a valve on WH for future use. IB indic that top
of 4-1/2" csg stub appeared to be a pin (evidence of threads on
block). The TO csg was over on one side of hole & crushed in
from the side resembling a "half moon" configuration. Be advised
that approx 15 BO was rcvrd while cleaning out btwn 4735' &
5950'. (Pssbly Delaware Oil).

DRILLING REPORT TERMINATED.