


NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.G.S.	☐
LAND OFFICE	☐
OPERATOR	☒

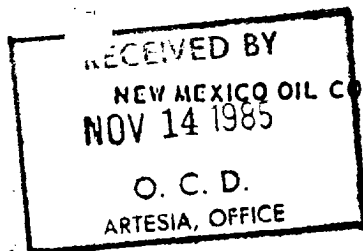

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

3a. Indicate Type of Lease	State ☒ Fee ☐
3. State Oil & Gas Lease No.	L-6367

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO RE-ENTER A WELL IN A DIFFERENT RESERVOIR.
SEE APPLICATION FOR PERMIT TO DRILL (FORM C-101) FOR SUCH PROPOSALS.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER Dry Hole

2. Name of Operator
Southland Royalty Company

3. Address of Operator
21 Desta Drive, Midland, Texas 79705

4. Location of Well
UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM
THE West LINE, SECTION 19 TOWNSHIP 19S RANGE 29E N.M.P.M.

7. Unit Agreement Name

8. Name of Lease Name
Scanlon Draw "19" St

9. Well No.
1

10. Field and Pool, or Wildcat
Turkey Track (Morrow)

12. County
Eddy

15. Elevation (Show whether DF, RT, GR, etc.)
3376.2' GR

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	☒ PLUG AND ABANDONMENT
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	
		OTHER ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU PBCP unit. Remove tree. Instl BOP. Rise & POH w/pkr. RIH OE & circ hole w/10# mud. Spot 30 sx cmt 9570-9299'. Pull 40 stds tbg.
2. RIH w/tbg. Spot 30 sx cmt @ 9670'. Pulled 40 stds tbg. WOC 4 hrs. POH w/tbg.
3. RIH w/gauge ring to 8250'. POH.
4. RIH w/sinker on sand line to check PBTD.
5. Ran sinker bars to 9400'. POH. RIH w/bit & scg scraper to 9580'. POH. LD bit & scraper. RIH w/tbg OE. Spot 30 sxs cmt @ 9570'. Pull 40 stds.
6. Tag plug @ 9332'. Spot 10# mud. Pull to 9025' & spot 25 sx cmt. POH w/tbg. Remove BOP & csg spool. Weld on pull nipple to 5 1/2" csg.
7. Ran free point. Shot off @ 7000'. & POH w/5 1/2" csg.
8. Circ hole w/10# mud @ 7550'. Spotted 10 sxs cmt @ 7550' & 10 sxs @ 7320'. Spotted 70 sxs cmt @ 7050'. WOC. Tag @ 6804'. Spotted 51 sxs @ 4250', 51 sxs @ 3690' & 39 sxs @ 2447'. POH.
9. Well plugged & abandoned 10-25-85. Tag plug @ 2610'. Pull to 445' & spot 27 sx cmt. Circ 8 sx surf plug @ 30'. Cut off wellhead. Instl dry hole marker. RD plugging unit.

Post #D-2
11-29-85
P4A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Danell Roberts TITLE Operations Engineer DATE 11/7/85

APPROVED BY Danell Moore TITLE Geologist DATE 3/6/87

CONDITIONS OF APPROVAL, IF ANY: