

Details of bop test

Southern Union Production Company


Montray #1

8/5/74

Contractor: Ard Drlg. Rig 7

Test by Yellow Jacket Tools and Services, Inc.

====Transposition of the pressure recorder chart====

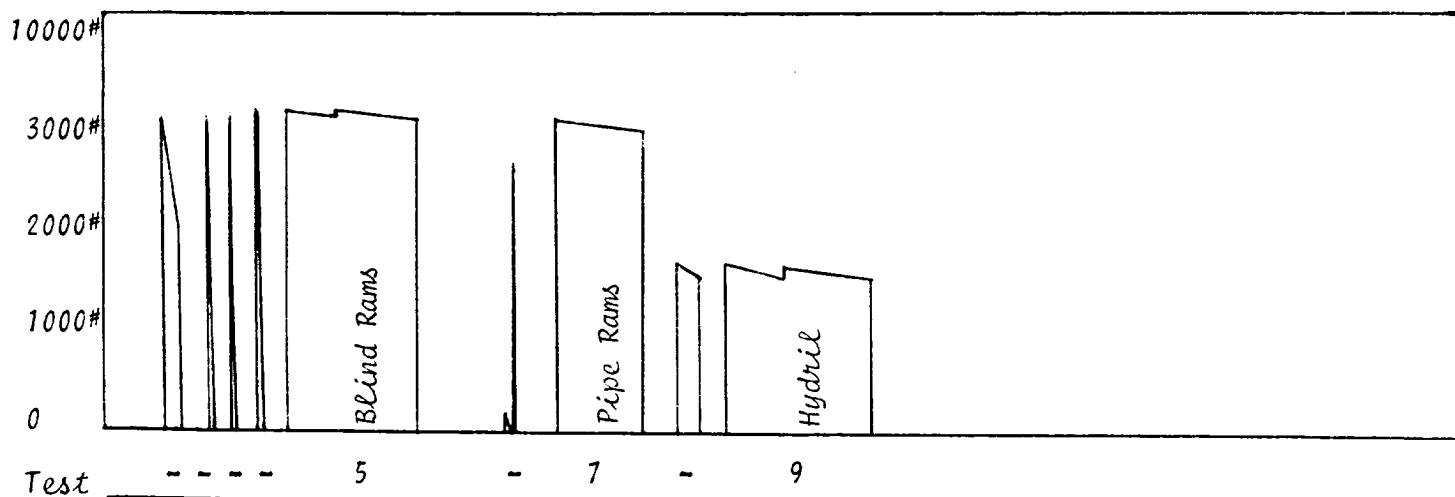

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Sitting Bull Falls Area, Dallas District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig nipping up.

TESTING: Blind Rams with all valves closed next to stack - pressure applied thru test entry of blind flange off blind rams bop.

Test #1 Pressured to 3000# with leak to flange between pipe rams bop and adaptor spool. Tightened.

Test #2 Repeated test. Pressured to 3000# with loss of pressure. No test.

Test #3 Repeated test. Pressured to 3000# with leak to door seal of blind rams bop (doghouse side). Tightened.

Test #4 Repeated test. Pressured to 3000# with leak to both rod packings of blind rams bop. Tightened.

Test #5 Repeated test. Pressured to 3000# with slight loss of pressure;