

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other PLUGGED AND ABANDONED	5. Lease Designation and Serial No. NM-13968
2. Name of Operator YATES PETROLEUM CORPORATION (505) 748-1471	6. If Indian, Allottee or Tribe Name N/A
3. Address and Telephone No. 105 South 4th St., Artesia, NM 88210	7. If Unit or CA, Agreement Designation N/A
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 660' FSL & 1270' FEL, SESE, Sec. 15-T21S-R21E, NMPM	8. Well Name and No. Huber IA Federal #2
	9. API Well No. 30-015022217
	10. Field and Pool, or Exploratory Area Boyd Canyon Permo Penn
	11. County or Parish, State Eddy, NM

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


TYPE OF SUBMISSION	TYPE OF ACTION
<input type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion or on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

CONTINUED FROM PREVIOUS PAGE:

POOH with tubing to 1250'. WOC 3-1/2 hours. RIH with 2-3/8" tubing and tagged top of cement at 2941'. Spotted 95 bbls plug mud from 2941-1350'. POOH with tubing to 1353'. Mixed and spotted 35 sacks Class C cement from 1353-1252'. POOH with tubing. Shut down for night. 2-8-95 - TIH with tubing and tagged top of cement at 1245'. Spotted 75 bbls plug mud from 1245' to surface. POOH with tubing to 310'. Mixed and pumped 30 sacks Class C cement from 310-210'. POOH with tubing to 50'. Spotted 15 sacks Class C cement from 50' to surface. POOH and laid down tubing. Nippled down BOP. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 2-7-95.

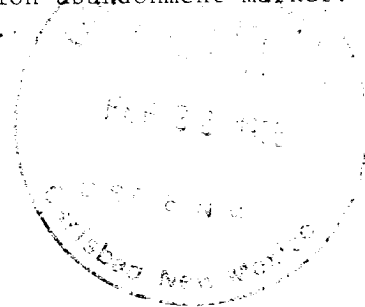

14. I hereby certify that the foregoing is true and correct

Signed Kurtley K. Lee Title Production Clerk Date 2-17-95

(This space for Federal or State office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any: