


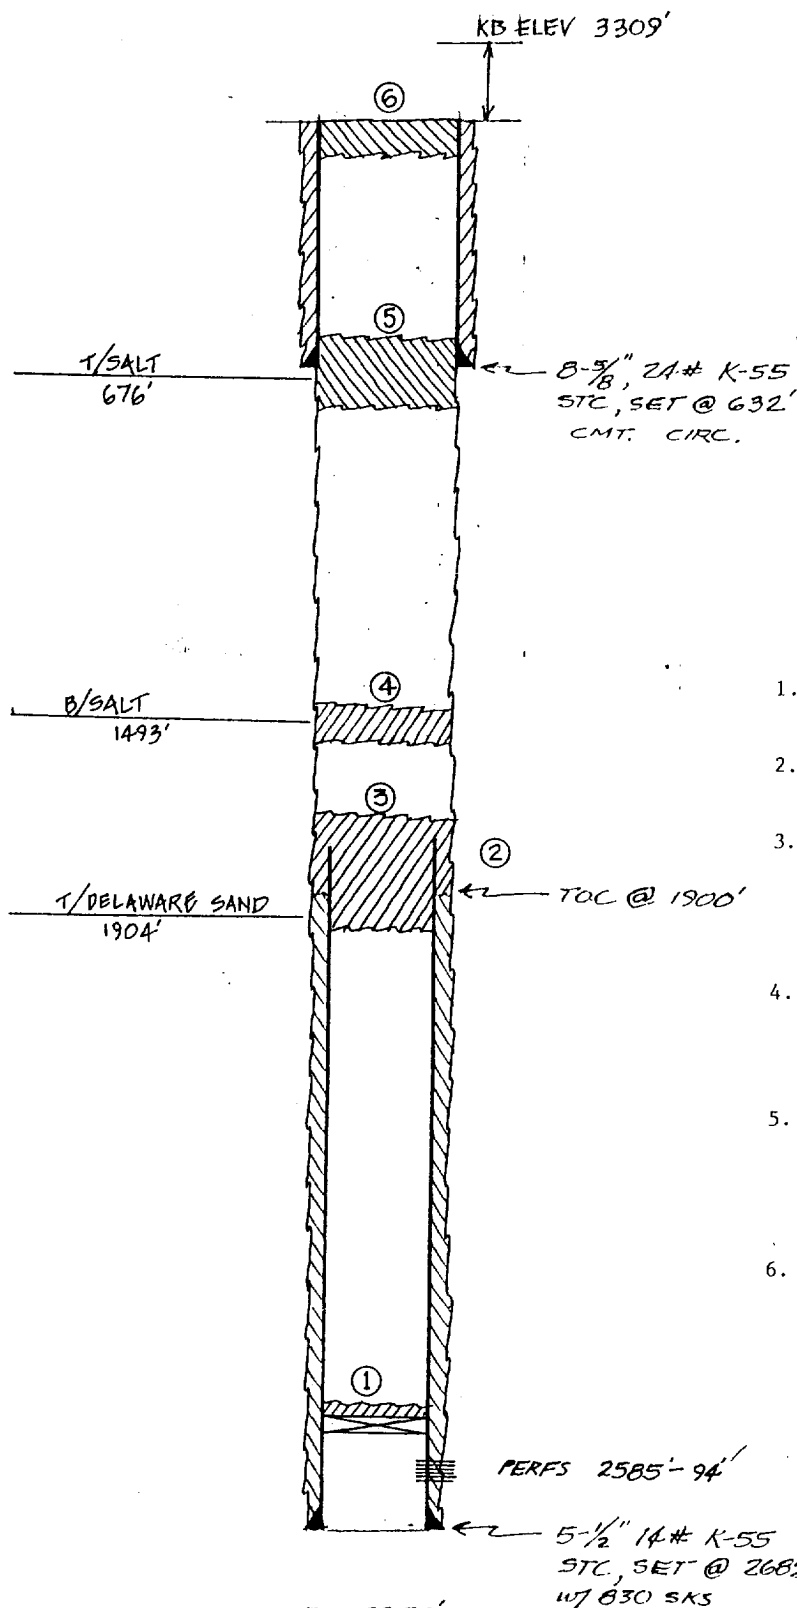

1. Set CIBP @ 2550' w/l sk cmt on top.
2. Shoot off csg @ approximately 1900'.
3. Spot 35 sx cmt plug from 1954' to 50' above top of csg stub, across top of Delaware Sand @ 1904' & csg stub. Tag top of plug.
4. Spot 65 sx. cmt plug from 1543' to 1443', across base of salt @ 1493'. Tag top of plug.
5. Spot 65 sx cmt plug from 726' to 582', across top of salt @ 676' and 8-5/8" csg shoe @ 632'. Tag top of cmt.
6. Spot 15 sx cmt from 50' to surface.

PROPOSED
PLUGGING

J. M. HUBER CORPORATION
FEATHERSTONE McCOY NO. 2
Yarrow Delaware Field
Eddy County, New Mexico