


STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	<input checked="" type="checkbox"/>
FILE	<input checked="" type="checkbox"/>
U.S.G.S.	
LAND OFFICE	
OPERATOR	<input checked="" type="checkbox"/>

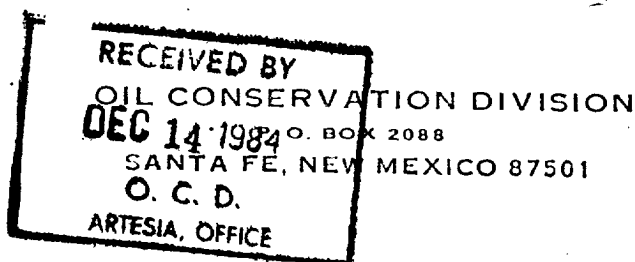

30-015-23036

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator HCW Exploration, Inc. ✓	8. Farm or Lease Name Ann Com
3. Address of Operator P.O. Box 10585, Midland, TX 79702	9. Well No. 1
4. Location of Well UNIT LETTER <u>G</u> <u>1655</u> FEET FROM THE <u>North</u> LINE AND <u>1980</u> FEET FROM THE <u>East</u> LINE, SECTION <u>15</u> TOWNSHIP <u>24-S</u> RANGE <u>28-E</u> NMPM.	10. Field and Pool, or Wildcat <u>Midland</u> <u>Bone Springs, Wet</u>
15. Elevation (Show whether DF, RT, GR, etc.) 3022' KB	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 11/23/84 MIRU Baber Well Service. POOH w/ 182 rods (71-7/8" & 111-3/4"). SDFN. Notified New Mexico Oil Conservation Commission, (Mr. Mike Williams). DC \$ 1,500.
- 11/24/84 POOH w/ 71 rods, 206 jts 2 3/8" EUE, 8rd, N-80 tbq. GIH w/ Pengo 9 5/8" wireline CIBP set @ 6250'. Found FL @ 5700'. GIH w/ 2 3/8" EUE, 8rd tbq to top of CIBP. SDFN. DC \$ 5,000.
- 11/26/84 Load hole w/ 9.5 mud laden brine. Spot 35 sx cmt top of BP. Pull up to 4200' spot 35 sx plug from 4076'-4200'. Pull up to 2000', spot 35 sx plug from 1876'-2000'. Pull up to 650', spot 35 sx plug from 526'-650'. POOH spot 10 sx surface plug. DC \$ 7,000.
- 11/27/84 RD Baber Well Service Unit. Dig out cellar, cut off wellhead, weld on plate, install dryhole marker & clean up location. DC \$ 1,500.

Post ID-2
3-1-85
P4A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Supt DATE 12/12/84
APPROVED BY [Signature] TITLE Geologist DATE 2-22-85
CONDITIONS OF APPROVAL, IF ANY: