

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-~~26790~~ 26796

5. Indicate Type of Lease
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name

Sueno 15

1. Type of Well:
OIL WELL ☐ GAS WELL ☒ OTHER ☐

2. Name of Operator
Nearburg Producing Company

8. Well No. 1

3. Address of Operator
P.O. Box 823085, Dallas, TX 75382-3085

9. Pool name or Wildcat
Delaware Wildcat

4. Well Location
Unit Letter E : 660 Feet From The West Line and 2,500 Feet From The North Line

Section 15 Township 22S Range 27E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3,097.2' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Notify OCD & Time to witness tags.
2. MIRU pulling unit NOWH & NUBOP
3. Come hole with tbg.
4. Go in w/Wireline B.P. set 4750 & cap 35' cement
5. Circulate hole w/9# mud to # 10 line w/25# gel/barril.
6. Set 30 sk plug 3000 ft.
7. Come out hole w/tbg. & free pt csg.
8. Cut csg & lay down
9. Set 35 sk plug 50' in & 50' out (tag & tub)
10. Set 30 sk plug at 1200' 1200-1200'
11. Set 30 sk at 400' 500' & tag.
12. Clean location, cut well head, install P/A marker w/ 10 sk. surface plug

RECEIVED

OCT 27 1995

OIL CON. DIV.
DIST. 2

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ernest Saucedo TITLE P/A Supervisor DATE 10-27-95

TYPE OR PRINT NAME Ernest Saucedo Baber/Gibson TELEPHONE NO.

(This space for State Use)

ORIGINAL SIGNED BY TIM W. GUM
DISTRICT II SUPERVISOR



APPROVED BY _____ TITLE _____ DATE 10/30/95

CONDITIONS OF APPROVAL, IF ANY:

BR

NPC
 SUPNO 1541
 15-22-27

B6X
 10/30/95

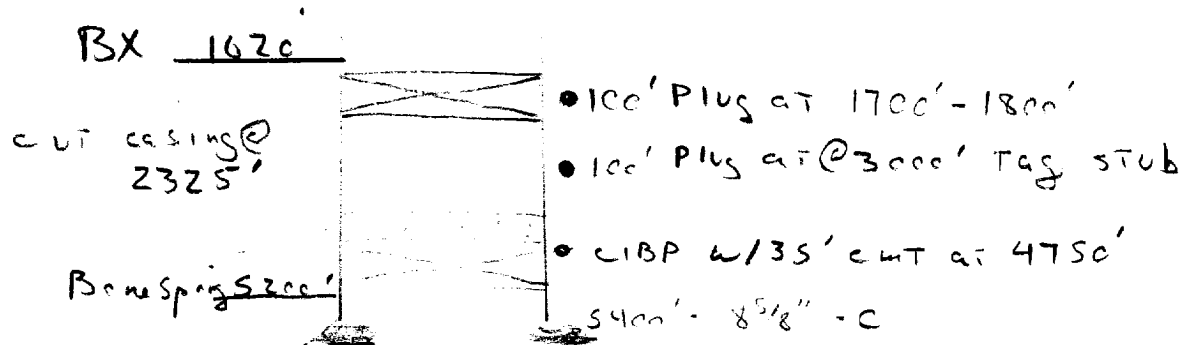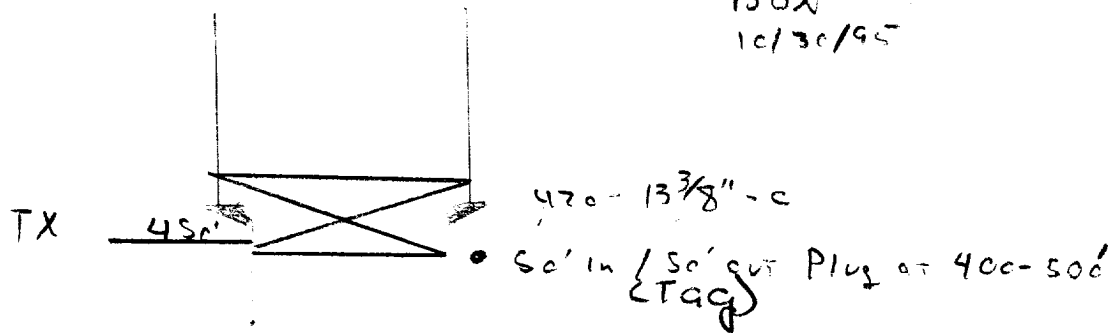

• fill hole w/
 10# brine?
 25# gel / barrel

Wellcamp 8810

9475'
 Penn 9970 - CIBP w/ 35' CMT

STRAWN 10200
 10440' - CIBP w/ 35' CMT.

10610' - 5 1/2" TOC - 5300'