

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-26905
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name Nymeyer "A"

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER T/A (Never Produced)
--

2. Name of Operator P & P Producing, Inc. Well No. 3
--

3. Address of Operator P. O. Box 3178 Midland, Texas 79702

9. Pool name or Wildcat O. C. D. East Loving Delaware
--

4. Well Location Unit Letter <u>K</u> : <u>2130</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>West</u> Line Section <u>15</u> Township <u>23S</u> Range <u>28E</u> NMPM <u>Eddy</u> County

10. Elevation (Show whether DF, RKB, RT, GR, etc.) RKB 3011 GR 2999
--

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- Set CIBP @ 6106 & dump 35' cmt on T/plug w/SW mud.
- Spot 25 sx cmt 3854-3754' w/mud to cover DVT.
- Spot 25 sx cmt to cover T/Delaware & B/salt at 2570'.
- Spot 25 sx cmt 605-505' for 8 5/8" shoe plug. Salvage wellheads.
- Spot 50 ft plug in surface.
- Install D.H. marker at edge of pad, w/specific directions to P/A borehole.
- Clean location, backfill cellar, etc.
- Leave location & road intact at request of farmer, Mr. C. M. Carrasco, Jr. Loving, NM (505)745-3343.

NOTE: 1. There will be no salvaged casing. Refer to attached schematic drawing. Rods and pump jack have been removed.
 2. This C-103 was approved 3-24-94. Well has not been plugged.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bob Yeates TITLE Consulting Engineer DATE 10-24-94
 TYPE OR PRINT NAME Bob Yeates TELEPHONE NO. 915 - 683-4768

(This space for State Use)

APPROVED BY ORIGINAL SIGNED BY RAY SMITH TITLE OIL AND GAS INSPECTOR DATE NOV 14 1994

CONDITIONS OF APPROVAL, IF ANY:



**PARKER & PARSELEY
DEVELOPMENT COMPANY**

SUBJECT

ENGINEERING CHART

SHEET NO. 2 OF 2


Contractor:

NYMYER "A" No. 3

DATE 2-21-94

PLUG & ABANDON

BY Bevates

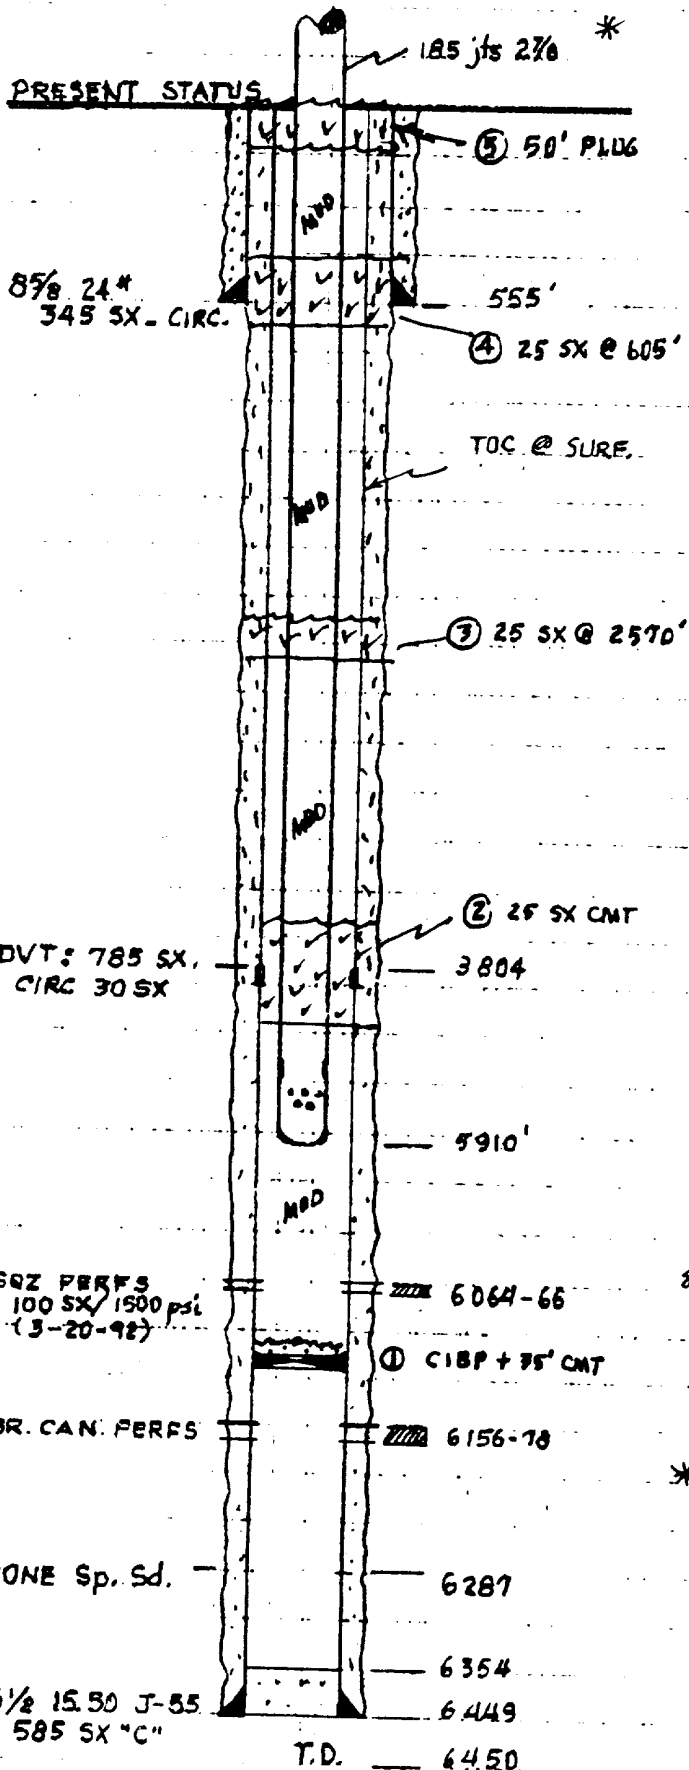

PROCEDURES: (TBG may have been salvaged).

DIRECTIONS: F/ Loving on Ash St. to Nymyer road. Go Left or North to just before RR track & turn right on pavement. First well in field on right. Will be pumping well on N. side of road (Nymyer A No. 2) across fr "A" #3.

NOTE: If well tbq has been removed, a workstring of 2 7/8 is available in P&P Pardue Farms yard, E. on Ash St. fr Loving. (Call Shockey Helton / 505-369-8938).

1. MIREUPLU. Strap out tbq. Dig working pit.
2. R.H. w/ CIBP & set plug at 6106'. Load well w/ FW & spot 35' cmt on T/ plug w/ mud.
3. L.O. tbq & spot 25 sx cmt at 3854' (Plug #2).
4. L.O. tbq, spot 25 sx cmt @ 2570 (Plug #3) and 25 sx at 605' (Plug #4).
5. Salvage wellheads.
6. Spot 50' cmt plug in surface. Haul water off.
7. Backfill cellar & pit, clear location & install D.H. marker at edge of pad w/ directions to P/A wellbore. Remove all equipment & tools.
8. Leave location of road intact for farmer, Mr. C.M. Carrasco, jr., Loving, N.M., phone (505) 745-3343.

* If well-tubing has been all, or partially removed, contact Parker & Parsley Foreman, Shockey Helton to arrange for (2 7/8) work string.
(mobile) 505-369-8938
(home) 505-398-8295
and removal of salvaged equipment.