

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

OIL CONSERVATION DIVISION

DISTRICT I
P.O. Box 1980, Hobbs NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-015-28268	
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>	
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name WILLOW LAKE '25'	
8. Well No. NO. 1	
9. Pool name or Wildcat WILLOW LAKE (DELAWARE)	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER DRY HOLE	
2. Name of Operator MERIDIAN OIL INC.	
3. Address of Operator P.O. 51310, Midland, TX 79710-1810	
4. Well Location Unit Letter O : 990' Feet From The SOUTH Line and 1650' Feet From The EAST Line Section 25 Township 24S Range 28E NMPM EDDY County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 2919'	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☒
OTHER: **SET SURF. CSG & PLUG AND ABANDON** ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2/25/95: SPUD. DRILL A 12 1/4" HOLE TO 545'. RAN 12 JTS OF 8 5/8" 28# CSG AND SET @ 545'.
USED FOUR CENTRALIZERS. CMED W/LEAD: 425 SXS 'C' + 2% CACL2 + .25 PPS CELLO-FLAKE, TAIL
W/248 SXS 'C' + 3% CACL2. CIRC TO SURF. WOC 17 HRS.

DRILL TO 5275'. NO SHOWS. DECIDED TO PLUG AND ABANDON.

3/4/95: SET PLUG @ 4879' W/45 SXS

SET PLUG @ 4601' W/40 SXS. WOC. TAG PLUG @ 4522'. SET PLUG @ 2696' W/35 SXS. SET PLUG @ 1239' W/35 SXS. SET PLUG @ 588' W/45 SXS. WOC. TAGGED CMT @ 455'. SET PLUG @ SURFACE.

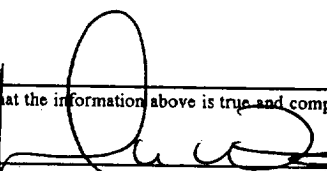
Post ID-2
5-12-95
PFA

RECEIVED

MAR 28 1995

OIL CON. DIV.
DIST. 2

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE **REGULATORY ASSISTANT** DATE **3/21/95**
TYPE OR PRINT NAME **DONNA WILLIAMS**

TELEPHONE NO. **915-688-6943**

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: