

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Draw on this or re-
verse side)
Artesia, 1 88210

Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.
NM-11042

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. CIL ☐ WELL GAS ☒ WELL OTHER ☐

2. NAME OF OPERATOR
J.C. WILLIAMSON

3. ADDRESS OF OPERATOR
P.O. BOX 16 MIDLAND, TEXAS 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
660' FSL & 1980' FWL

7. UNIT AGREEMENT NAME
ROSS DRAW

8. FARM OR LEASE NAME
ROSS DRAW UNIT

9. WELL NO.
1

10. FIELD AND POOL, OR WILDCAT
ROSS DRAW DELAWARE (GAS)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
Sec. 27-T26S-R30E

14. PERMIT NO.
API# 30-015-21035

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
2008.2' DF

12. COUNTY OR PARISH
EDDY

13. STATE
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Set WL BP @ 3350' w/35' cement on top, 6/13/94.

2. Cut csg. 5-1/2" @ 2473', pull and lay down.

3. G.I.H. @ 2-3/8" tbg. to 2499', mud up.

4. Set 25 sax plug @ 2499'.

5. Tag plug @ 2424'.

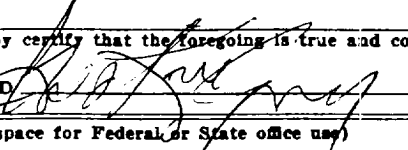
6. Set 150 sax @ 808' tag @ 560'.

7. Set 25 sax in surface and place marker; P&A'd 6/16/94.

RECEIVED
JUN 22 12 56 PM '94
CALIF. AREA

Post ID 2
8-5-94
P4H

18. I hereby certify that the foregoing is true and correct

SIGNED 
(This space for Federal or State office use)

TITLE ENGINEER

DATE 06-21-94

APPROVED BY 
CONDITIONS OF APPROVAL, IF ANY:

TITLE PETROLEUM ENGINEER

DATE 7/19/94

*See Instructions on Reverse Side