

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB No. 1004-0135
Expires November 30, 2000

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Bill + Aatsy Rich

3a. Address

Charisbad, NM

3b. Phone No. (include area code)

(505) 887-3928

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 14, T-25S, R-26E
1450 FSL + 1650 FEL

5. Lease Serial No.

NM 19423

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.

White City 14 Federal #2

9. API Well No.

30-015-25641

10. Field and Pool, or Exploratory Area

Undesignated Delaware

11. County or Parish, State

Edley

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

☐ Acidize

☐ Alter Casing

☐ Casing Repair

☐ Change Plans

☐ Convert to Injection

☐ Deepen

☐ Fracture Treat

☐ New Construction

☒ Plug and Abandon

☐ Plug Back

☐ Production (Start/Resume)

☐ Reclamation

☐ Recomplete

☐ Temporarily Abandon

☐ Water Disposal

☐ Water Shut-Off

☐ Well Integrity

☐ Other

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

See Attached

RECEIVED
BUREAU OF LAND MGMT.
CLOUDSAND FIELD OFFICE
2002 FEB 22 AM 10 43

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed)

Bill Rich

Title

Owner

Signature

Bill Rich

Date

2/22/02

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

(ORIG. SSB) JOE G. LITZ

Title

Assistant Secretary

Date

2/25/2002

Conditions of
certify that the
which would er

not warrant or
subject lease

Office

CFO

Accepted for record

only

FEB 22 2002

Title 18 U.S.C.
States any false

for any person knowingly and willfully to make to any department or agency of the United
matter within its jurisdiction.

White City 14 Federal #2

Sec 14, T-25S, R-24E

1450 FSL + 1450 FEL

Eddy County NM

P+ A Procedure

1. MI#RUPU, POOTH w/rods + pump lay down rods.
2. NU BOP + POOTH w/Tbg, RV Wireline + set CIBP @ 1900'
3. TIH w/Tbg circ hole w/10" SHT gcl + set 255x cmt plug 1900' to 1750'. POOTH w/Tbg + NA BOP
4. Free Point 7" CSG + cut 50' above free point. POOTH + lay down 7" CSG.
5. TIH w/Tbg + set 255x cmt plug ~~50'~~ above + below 7" STUB
6. Set 255x cmt plug @ 13³/₈" shoe 500' to 300'
7. Set 105x surface plug
8. Set 4" P+A marker 4' above ground level

W/ Well information

Bill + Patsy Rich

White City 14 Fed #2, P+A DATE

Sec 14, T-25S, R-24E


1450 FSL + 1450 FEL

Eddy County, NM

9. Clean location remove all equipment rip location + seed w/required seed.

White City, N.M.
 Sec 14, T-25S, R-26E
 1450' FSL + 1450' FSL
 Eddy County, NM

Proposed F&A Wellbore Diagram

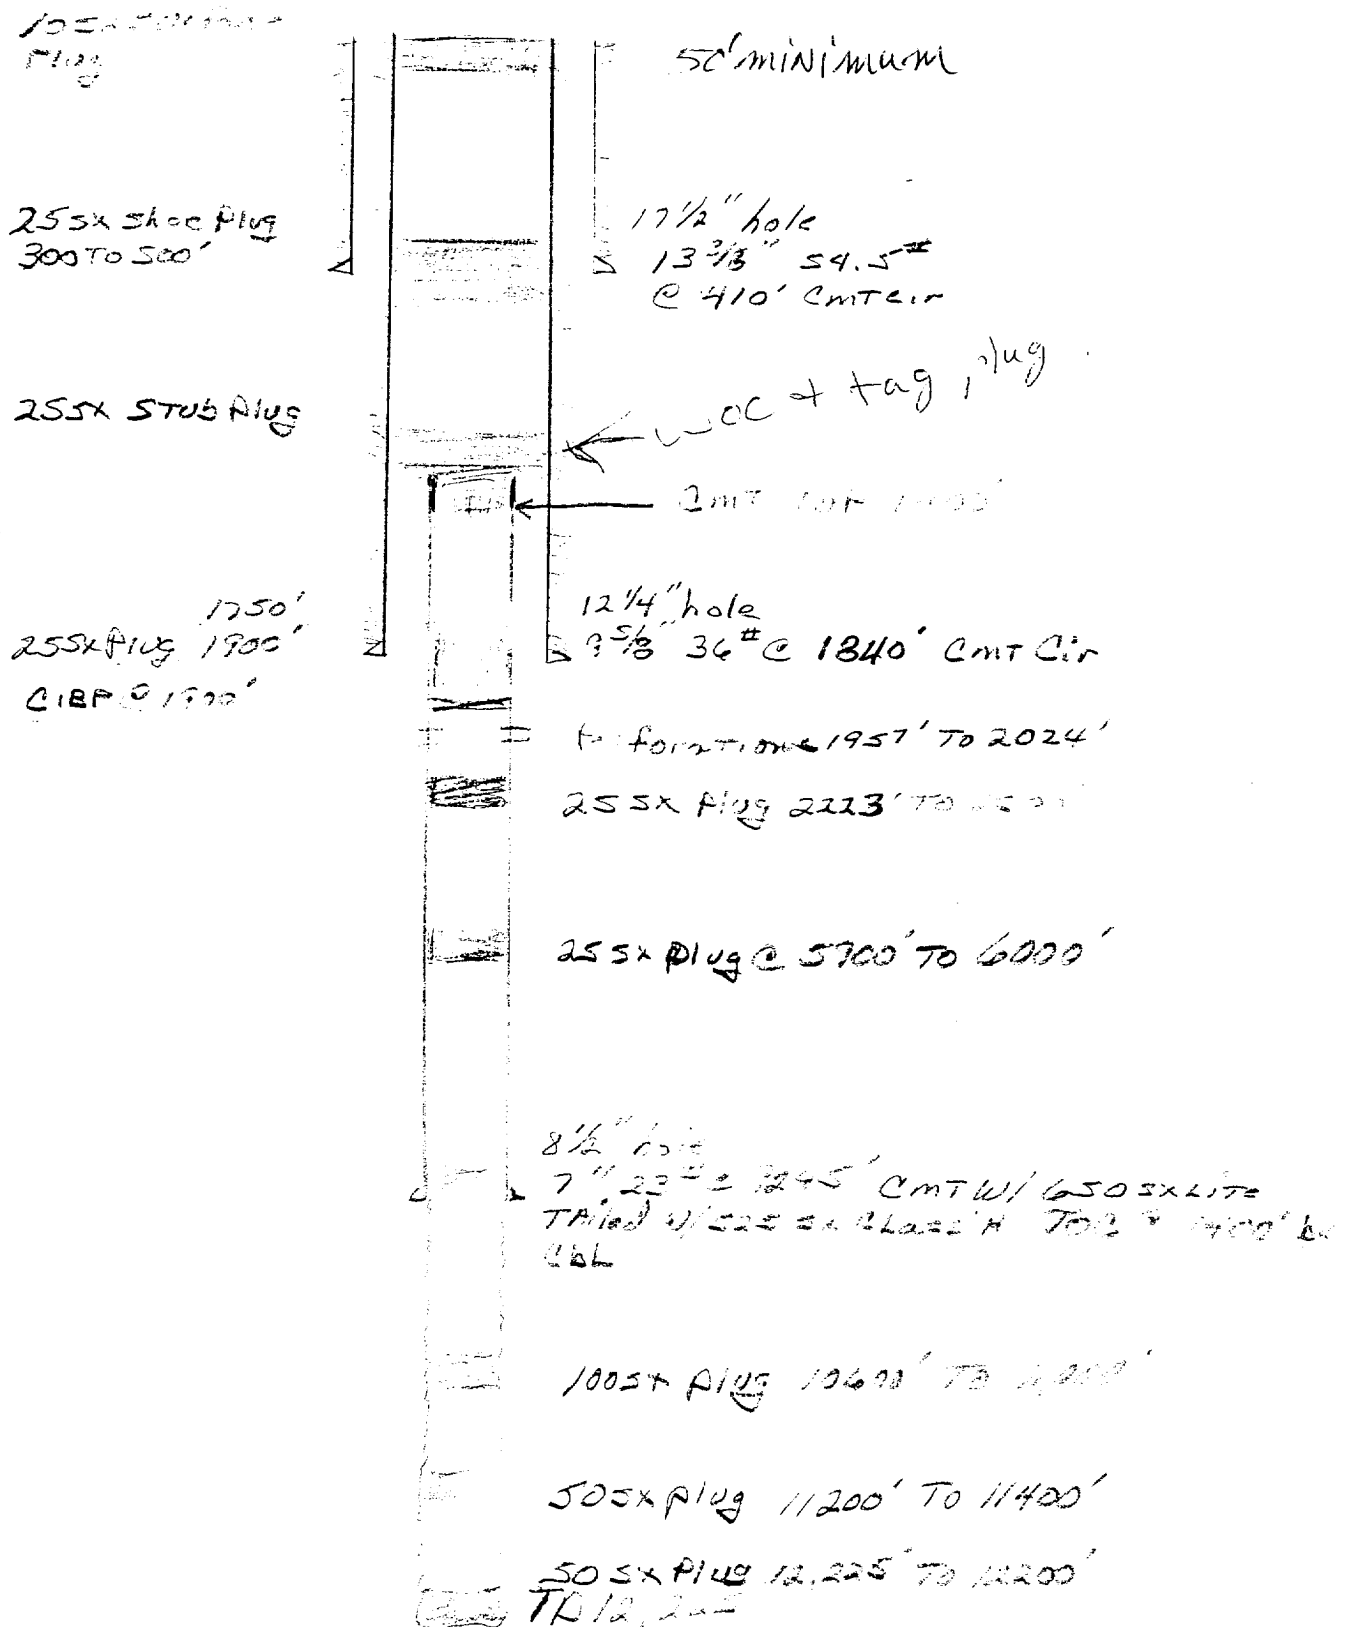

REPORT