

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-015-29560
5. Indicate Type of Lease	STATE ☒ FEE ☐
6. State Oil & Gas Lease No.	V-4035
7. Lease Name or Unit Agreement Name	
Cottonwood "36" State	
8. Well No.	1
9. Pool name or Wildcat	Wildcat
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	
3322' GR	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
Penwell Energy, Inc.

3. Address of Operator
600 N. Marienfeld, Ste. 1100; Midland, Texas 79701

4. Well Location
Unit Letter K : 1980' Feet From The West Line and 1980 Feet From The South Line
Section 36 Township 25S Range 26E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3322' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1.) MIRU work-over unit and T00H w/tbg.
- 2.) Set CIBP @ 5,300' +/-.
- 3.) TIH w/tbg. and displace hole w/10# plug mud.
- 4.) Spot 25 sack Class "C" cement plug on top of CIBP and T00H w/tbg.
- 5.) Perforate 4 squeeze holes @ 3,050' +/-.
- 6.) Establish returns up 5 1/2" X 8 5/8" annulus and cement 5 1/2" casing to surface w/500 sacks of Class "C" Lite containing 2% calcium chloride. Shut in overnight.
- 7.) TIH w/tbg. and spot 50 sack Class "C" cement plug @ 1900' +/- . TAG
- 8.) Spot 30 sacks of Class "C" cement @ 400' +/- . WOC and tag plug.
- 9.) Spot 5 sack cement plug from 50' - surface.
- 10.) Cut off wellhead, cap casing w/steel cap, install dry hole marker, remove deadmen and clean location.

(SEE ATTACHED SCHEMATICS)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bill Pierce TITLE Manager of Operations DATE Oct. 20, 2000

TYPE OR PRINT NAME Bill Pierce TELEPHONE NO. 915 683-2534

(This space for State Use)


APPROVED BY Mrs. S. Stoppel TITLE Field Rep II DATE 10/25/2000

CONDITIONS OF APPROVAL, IF ANY:

* Notify N.M.O.C.D. to witness Plugging Operations.

API	30-015-29560	Field Name	Wildcat	Area	Permian Basing	Operator	Penwell Energy, Inc.	County	Eddy	State/Province	New Mexico
KB Elev (ft)	3332.00	Ground Elev (ft)	3322.00	Casing Flange Elev (ft)	3322.00	KB-Ground (ft)	10.00	KB-CF (ft)	10.00	Spud Date	5/18/97

<no holes>: 7/25/97

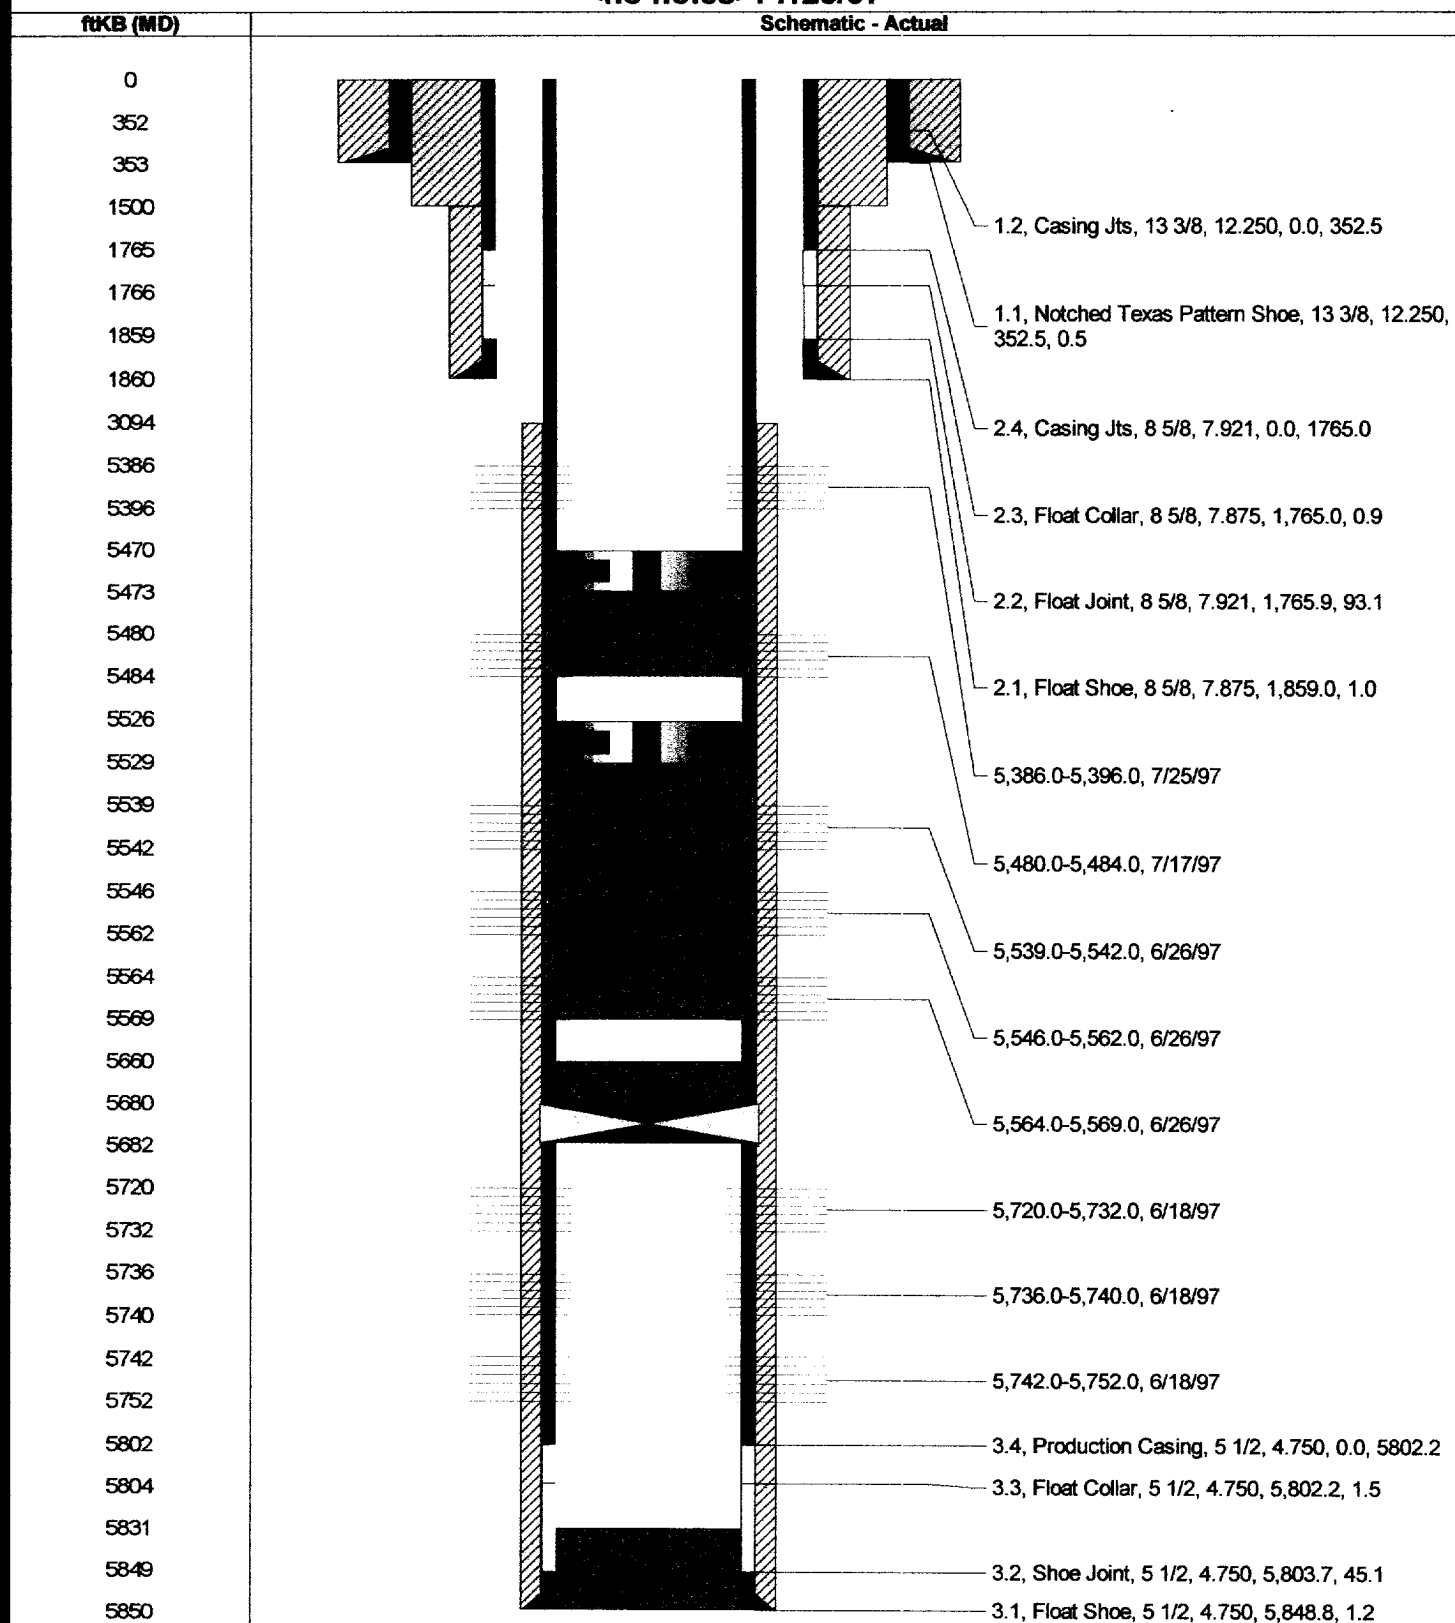

API	30-015-29560	Field Name	Wildcat	Area	Permian Basing	Operator	Penwell Energy, Inc.	County	Eddy	State/Province	New Mexico
KB Elev (ft)	3332.00	Ground Elev (ft)	3322.00	Casing Flange Elev (ft)	3322.00	KB-Ground (ft)	10.00	KB-CF (ft)	10.00	Spud Date	5/18/97

<no holes>: 7/25/97

ftKB (MD)

Schematic - Actual

0
50
100
352
353
400
1400
1500
1765
1766
1859
1860
1900
3000
3050
3051
3094
5050
5300
5302
5386
5396
5470
5473
5480
5484
5526
5529
5539
5542
5546
5562
5564
5569
5660
5680
5682
5720
5732
5736
5740
5742
5752
5802
5804
5831
5849
5850

