òn (Other Instruct reverse sid

Form approved.

5. LEASE DESIGNATION AND SERIAL NO.

Budget Bureau No. 1004-0136

## UL ED STATES DEPARTMENT OF THE INTERIOR

Expires: December 31, 1991

	31	UREAU OF	LAND MANA	SEMEN'	r 429		NM-9812	22
APPLIC	CATIO	N FOR PE	RMIT TO E	RILL	OR DEEPEN		6. IF INDIAN, ALLOTTEE C	OR TRIBE NAME
. TYPE OF WORK	L 🛛		DEEPEN [				7. UNIT AGREEMENT NA	ME /
b. TYPE OF WELL				SIN	GLE MULTII	PLE	8. FARM OR LEASE NAME, WELL	, NO.
OIL S GR WELL S WW NAME OF OPERATOR	ell	OTHER		<b>Z</b> 0			Skelly Unit	#911
Texaco Exploration	& Produ	iction Inc. (N	lack Energy A	gent)	1973		9. API WELL NO.	
ADDRESS AND TELEPHONE NO.					<del>/////////////////////////////////////</del>		30-015-	
P.O. Box 960, Artes	ia NM 8	8211-0960	(505) 74	48-1288	}		10. FIELD AND POOL, OR	
LOCATION OF WELL							Undes, Fren Padd	
At surface	` •		310 FSL & 990		· · · · · · · · · · · · · · · · · · ·		11. SEC., T., R., M., OR B AND SURVEY OR ARI	LK. EA
At proposed prod. zone	•		Uhit	1	100		Sec 21 T17S	
4. DISTANCE IN MILES AN	D DIRECTION	ON FROM NEARI	est town or pos t of Loco Hills.	T OFFICE	* 14.7g	7	12. COUNTY OR PARISH Eddy	NM
DISTANCE FROM PROPO	SED*	9 miles eas	t of Loco IIIiis.	~ <del></del>	OF ACRES IN LEASE	17. NO 0	OF ACRES IN LEASE	
5. LOCATION TO NEAREST PROPERTY OR LEASE L (Also to nearest drip	.INE. FT.	;, if any)	990		4160	TOT	THIS WELL 2	20
8. DISTANCE FROM PROPO TO NEAREST WELL, DR OR APPLIED FOR, ON TH	ISED LOCAT	TION* OMPLETED	407	19. PRC	5500	20, ROT	ARY OR CABLE TOOLS  Rotary	
21. ELEVATIONS (Show w				l			22. APPROX. DATE WORK 3/1/0	
23.			PROPOSED CAS	ING AND	CEMENTING PROGRA	AM		
	CRALL	SIZE OF CASING	WEIGHT PER F		SETTING DEPTH		QUANTITY OF CEMEN	(T
17 1/2	<del> </del> -	55,13 3/8	48		450		Circ	
1 / 1/4	17.3	35,15 5/6				<del></del>	0 00 00	
	1.5	5 8 5/8	24		1620	1	Suff to Circ	
12 1/4 7 7/8 Texaco E &	J-5 P Inc. p				5500 at to test the Paddoo		Suff to Circ n Andres formation f	
12 1/4 7 7/8 Texaco E & productive, 5 1/2" c	J-5  P Inc. p asing will ion. Spec Location hity Map	oroposes to dr ll be cemente cific program	rill to a depth s d. If non-produ s as per Onsho 4. Cer 5. Hyd	uctive, tore Oil tification	5500  It to test the Paddoo the well will be plug and Gas Order #1 a	gged and a are outline eration Pl	Suff to Circ on Andres formation for abandoned in a manouled in the following at the follow	r consistent tachments:
12 1/4 7 7/8  Texaco E & productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin	J-5  P Inc. p asing will ion. Spec Location hity Map	oroposes to dr ll be cemente cific program	rill to a depth s d. If non-produ s as per Onsho 4. Cer 5. Hyd Exh	uctive, tore Oil tification trogen Sibit #7-	5500  Int to test the Paddoo the well will be plug and Gas Order #1 a	gged and a are outling eration Pl	Suff to Circ on Andres formation for abandoned in a manouled in the following at the follow	r consistent tachments:
12 1/4 7 7/8  Texaco E & productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin	J-5 z P Inc. p asing wil ion. Spec Location hity Map	oroposes to dr ll be cemente cific program	rill to a depth s d. If non-produ s as per Onsho 4. Cer 5. Hyd Exh	uctive, tore Oil tification trogen Sibit #7-	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  on Sulfide Drilling Ope H2S Warning Sign	gged and a are outling eration Pl	Suff to Circ on Andres formation for abandoned in a manouled in the following at the follow	r consistent tachments:
12 1/4 7 7/8  Texaco E & productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program	J-5  P Inc. p asing wil ion. Spec Location ity Map ation Ver	oroposes to draw to the comment of t	ill to a depth s d. If non-products as per Onsho 4. Cert 5. Hyd Exh Exh 6. Bloo	uctive, i ore Oil tificatio Irogen S ibit #7- ibit #8- wout Pi	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  In Sulfide Drilling Ope H2S Warning Sign H2S Safety Equip	ged and a are outline eration Pl u	Suff to Circ on Andres formation for abandoned in a manouled in the following attended to the fo	r consistent tachments:
12 1/4 7 7/8  Texaco E & productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C	P Inc. p asing wil ion. Spec Location ity Map ition Ver	oroposes to draw to the cemented cific program n Plat cification Map	17 rill to a depth s d. If non-products as per Onsho 4. Cert 5. Hyd Exh Exh 6. Blov Exh	uctive, tore Oil tification  Irogen Sibit #7- ibit #8- wout Project	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  In Sulfide Drilling Ope H2S Warning Sign H2S Safety Equip	ged and a are outling eration Pl u	Suff to Circ on Andres formation for abandoned in a mano ed in the following att 7. Responsible an	r consistent tachments:
12 1/4 7 7/8  Texaco E & Productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C Exhibit #4- One	P Inc. p asing wil ion. Spec Location ity Map tion Ver  p	oroposes to draw to the cemented cific program on Plat cification May be a plan dius Map	17 rill to a depth s d. If non-products as per Onsho 4. Cert 5. Hyd Exh Exh 6. Blow Exh Exh	uctive, tore Oil tification (Irogen State of the Irogen State of t	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipart reventers BOPE Schematic Blowout Preventer	ged and a are outling eration Pl i ment	Suff to Circ on Andres formation for abandoned in a manor and the following at the followin	r consistent tachments: bility Stateme
12 1/4 7 7/8  Texaco E & Productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C Exhibit #4- One Exhibit #5- Prod Exhibit #6- Loca	P Inc. p asing wil ion. Spec Location nity Map ation Ver  p Derating Mile Rad luction Fation Lay	oroposes to draw to the comment of t	5. Hydrom Exh	uctive, tore Oil tification (Irogen State	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipore reventers BOPE Schematic Blowout Prevented Choke Manifold	ged and and and and and and and and and an	Suff to Circ  In Andres formation for abandoned in a manous manous at the following at the	tr consistent tachments: bility Statements
12 1/4 7 7/8  Texaco E & Productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C Exhibit #4- One Exhibit #5- Prod Exhibit #6- Loca	P Inc. p asing wil ion. Spec Location ity Map tion Ver  p Decrating Mile Rad luction Fation Lay	oroposes to draw to the cemented sific program of the program of t	5. Hydo Exh but Exh but Exh	uctive, tore Oil tification  Irogen Sibit #7- ibit #8- wout Profibit #9 tibit #10 tibit #1	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  On Sulfide Drilling Ope H2S Warning Sign H2S Safety Equip reventers BOPE Schematic Blowout Prevente Choke Manifold	ged and a are outling eration Pl i ment er Requir	Suff to Circ  In Andres formation for abandoned in a mano ed in the following attempt of the fol	er consistent tachments: bility Stateme
12 1/4 7 7/8  Texaco E & Productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C Exhibit #4- One Exhibit #5- Prod Exhibit #6- Locally Above Space Descript deepen directionally, give perioderally give perioderally space perioderally give perioderal given given give perioderal given give give perioderal given give perioderal given give give give give given give give give give give give give give	P Inc. p asing wil ion. Spec Location ity Map tion Ver  p Decrating Mile Rad luction Fation Lay	oroposes to draw to the comment of t	5. Hydromath is as per Onshore Exhresis and measured and solutions and measured and solutions in the solutions and measured and solutions in the solutions and measured and solutions are solutions.	uctive, to re Oil tification (Irogen State   18- ibit #8- wout Probibit #9 tibit #10 tibit #11 tibit #11 tibit #11	5500  Int to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipor reventers BOPE Schematic Blowout Prevente Choke Manifold	eration Planent  er Requirer Requirer Requirer Requirer Requirer Requirer Programment	Suff to Circ in Andres formation for abandoned in a mano ed in the following att  7. Responsible an ements  A P P P D - 5  possed new productive zone. If jumps, if any.	tr consistent tachments: bility Statements
Texaco E & Productive, 5 1/2" c with federal regulat  1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca  2. Drilling Program  3. Surface Use & C Exhibit #4- One Exhibit #5- Proc Exhibit #6- Loca IN ABOVE SPACE DESCRI deepen directionally, give perions  24.  SIGNED	P Inc. p asing wil ion. Spec Location ity Map ation Ver  Degrating Mile Rad luction F ation Lay BE PROFO:	oroposes to draw or	5. Hydromath is as per Onshore Exhresis and measured and solutions and measured and solutions in the solutions and measured and solutions in the solutions and measured and solutions are solutions.	uctive, to re Oil tification (Irogen State   18- ibit #8- wout Probibit #9 tibit #10 tibit #11 tibit #11 tibit #11	5500  Int to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipor reventers BOPE Schematic Blowout Prevente Choke Manifold	eration Planent  er Requirer Requirer Requirer Requirer Requirer Requirer Programment	Suff to Circ in Andres formation for abandoned in a mano ed in the following att  7. Responsible an ements  A PIRED - 5 posed new productive zone. If part, if any.	tr consistent tachments: bility Statements
12 1/4 7 7/8  Texaco E & Productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C Exhibit #4- One Exhibit #5- Proc Exhibit #6- Loca IN ABOVE SPACE DESCRI deepen directionally, give pen 24.  SIGNED  Mack Energy  (This space for Fede	P Inc. p asing will ion. Spec Location ity Map ation Ver  Degrating Mile Rad luction F ation Lay BE PROFORM finent data or Corporation	oroposes to draw or	17 rill to a depth s d. If non-products as per Onsho 4. Cert 5. Hyd Exh Exh 6. Blov Exh Exh Out Exh Exh Tif proposal is to decous and measured and	uctive, tore Oil tificatio trogen S ibit #7- ibit #8- wout Pr hibit #10 tibit #10 tibit #11 pen, give of true verti	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipa reventers BOPE Schematic BOPE Schematic BOPE Schematic Choke Manifold  Interval on present productive a cal depths. Give blowout pre	eration Planent  er Requirer Requirer Requirer Requirer Requirer Programment Analyst	Suff to Circ on Andres formation for abandoned in a mano ed in the following attempt of the foll	tr consistent tachments: bility Statements  -/- 202 proposal is to drill
Texaco E & productive, 5 1/2" c. with federal regulat  1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca  2. Drilling Program  3. Surface Use & C Exhibit #4- One Exhibit #5- Proc Exhibit #6- Loca IN ABOVE SPACE DESCRI deepen directionally, give pen  24.  Mack Energy  (This space for Federal	P Inc. p asing will ion. Spec Location nity Map ation Ver n Operating Mile Rad luction F ation Lay the PROFOS finent data of	oroposes to draw oropos	17 rill to a depth s d. If non-products as per Onshore 4. Cert 5. Hyde Exh Exh 6. Blow Exh Exh Out If proposal is to dee ons and measured and xaco E & P Inc.)	uctive, tore Oil tificatio trogen S ibit #7- ibit #8- wout Pr ibit #1 tibit #1 tibit #1	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipa Teventers BOPE Schematic Blowout Prevente Choke Manifold Lata on present productive a cal depths. Give blowout pro  Production a	eration Plument  er Requirer R	Suff to Circ in Andres formation for abandoned in a mano ed in the following att 7. Responsible an ements  A P RED - 5  possed new productive zone. If an, if any.  DATE	tr consistent tachments: bility Statements  proposal is to drill  2/2/01
12 1/4 7 7/8  Texaco E & Productive, 5 1/2" c with federal regulat 1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca 2. Drilling Program 3. Surface Use & C Exhibit #4- One Exhibit #5- Proc Exhibit #6- Loca IN ABOVE SPACE DESCRI deepen directionally, give per 24.  SIGNED  Mack Energy (This space for Fede	P Inc. p asing will ion. Spec Location nity Map ation Ver n Operating Mile Rad luction F ation Lay the PROFOS finent data of	oroposes to draw oropos	17 rill to a depth s d. If non-products as per Onshore 4. Cert 5. Hyde Exh Exh 6. Blow Exh Exh Out If proposal is to dee ons and measured and xaco E & P Inc.)	uctive, tore Oil tificatio trogen S ibit #7- ibit #8- wout Pr ibit #1 tibit #1 tibit #1	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipa Teventers BOPE Schematic Blowout Prevente Choke Manifold Lata on present productive a cal depths. Give blowout pro  Production a	eration Plument  er Requirer R	Suff to Circ in Andres formation for abandoned in a mano ed in the following att  7. Responsible an ements  A P P P D - 5  possed new productive zone. If jumps, if any.	tr consistent tachments: bility Statements  proposal is to drill  2/2/01
Texaco E & productive, 5 1/2" c. with federal regulat  1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca  2. Drilling Program  3. Surface Use & C Exhibit #4- One Exhibit #5- Proc Exhibit #6- Loca IN ABOVE SPACE DESCRI deepen directionally, give pen  24.  Mack Energy  (This space for Federal	P Inc. p asing will ion. Spec Location nity Map ation Ver  Derating Mile Rac luction Fation Lay BE PROFOS tinent data of Corporatio eral or Sta	oroposes to draw oropos	17 rill to a depth s d. If non-products as per Onshore 4. Cert 5. Hyde Exh Exh 6. Blow Exh Exh Out If proposal is to dee ons and measured and xaco E & P Inc.)	uctive, tore Oil tificatio trogen S ibit #7- ibit #8- wout Pr ibit #1 tibit #1 tibit #1	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipa Teventers BOPE Schematic Blowout Prevente Choke Manifold Lata on present productive a cal depths. Give blowout pro  Production a	eration Plument  er Requirer R	Suff to Circ in Andres formation for abandoned in a mano ed in the following att 7. Responsible an ements  A P RED - 5  possed new productive zone. If an, if any.  DATE	tr consistent tachments: bility Statements  proposal is to drill
Texaco E & productive, 5 1/2" c with federal regulat  1. Surveys Exhibit #1- Well Exhibit #2- Vicin Exhibit #3- Loca  2. Drilling Program  3. Surface Use & C Exhibit #4- One Exhibit #5- Proc Exhibit #6- Loca IN ABOVE SPACE DESCRI deepen directionally, give performance of the performance of the permit NO.  Application approval does conditions of APPROV	P Inc. p asing wil ion. Spec Location ity Map tion Ver  Derating Mile Rac luction F ation Lay BE PROFOT finent data or Corporatio eral or Sta	or certify that the a	17 rill to a depth s d. If non-products as per Onsho 4. Cer 5. Hyd Exh Exh 6. Blov Exh Exh Out Exh Exh Ti proposal is to dee ons and measured and xaco E & P Inc.)	uctive, tore Oil tificatio trogen S ibit #7- ibit #8- wout Pr tibit #10 tibit #11 pen, give of true verti	5500  It to test the Paddoo the well will be plug and Gas Order #1 a  Sulfide Drilling Ope H2S Warning Sign H2S Safety Equipa Teventers BOPE Schematic Blowout Prevente Choke Manifold Lata on present productive a cal depths. Give blowout pro  Production a	eration Planent  er Requirer Requirer Requirer Requirer Programment Analyst	Suff to Circ on Andres formation for abandoned in a mano ed in the following att  7. Responsible an amano ements  A PIRED - Spoosed new productive zone. If ann, if any.  DATE  MAD 6	tr consistent tachments:  bility Statements  proposal is to drill  2/2/01

DISTRICT 1 P. O. Box 1980, Hoobs, NM 88240

DISTRICT II P. D. Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brozos Rd., Aztec, NM 87410

DISTRICT IV P. O. Box 2088, Santa Fe, NM 87504-2088

State of New Mexico

Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION PO Box 2088 Santa Fe, NM 87504-2088

Form C-102 Revised February 10, 1994

Instructions on back

Submit to Appropriate District Office

■ AMENDED REPORT


State Lease-4 copies Fee Lease-3 copies

## WELL LOCATION AND ACREAGE DEDICATION PLAT

API Number	<sup>2</sup> Pool Code	, <sup>3</sup> Paol Name	
	Fre	en-Paddock	
Property Code	5Property Name		<sup>6</sup> Well Number
Topony 5555	Skelly Unit		911
OGRID No.	8Operator Name		<sup>9</sup> Elevation
GOINE NO.	TEXACO EXPLORATION &	PRODUCTION, INC.	3763'

UL or lot no.	Section 21	Township	Range 31—E	_ot ldn	Feet from the 2310'	ocation Narth/South line South	Feet from the	East/West line <b>West</b>	County Eddy
UL or lot no.	Section	Township	11 B	ottom Hol Lot Idn	e Location If	Different From North/South line	Surface Feet from the	East/West line	<sup>7</sup> County
1Dedicated Acres	13,10	int or Infill	<sup>1</sup> Consolic	ation Code	<sup>15</sup> Order No.		<u></u>		


NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION.

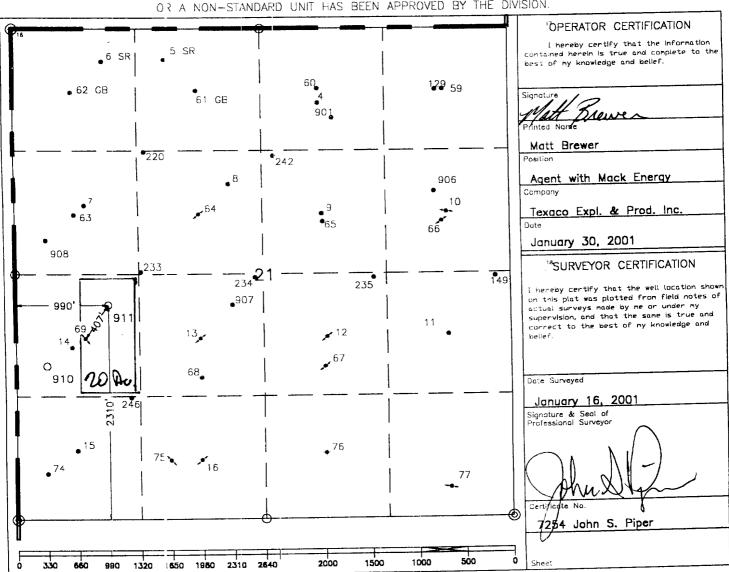

O = Staked Location • = Producing Well 💉 = Injection Well 💠 = Water Supply Well • Plugged & Abandon Well Equal Section Corner, 2 or 3" Iron Pipe & GLO B.C. = Found /4 Section Corner, 1" Iron Pipe & GLO B.C.

## ADDITIONAL INFORMATION ON THE LOCATION

State Plane Coord	inates (1927=661970.02)	Easting 680596.60 (192	27=639417.94)	
Latitude 32°49'(	08.898" (1927=32*49'08.474")  North American Datum	Longitude 103°52'48.06 Combined Grid Factor	67" (1927=103'52'46.244")  Coordinate File	
East	1983	0.9997675	Skelly.cr5	
Drawing File		Field Book		
Skel_911.dwg		Eddy County 8, Pg. 14		

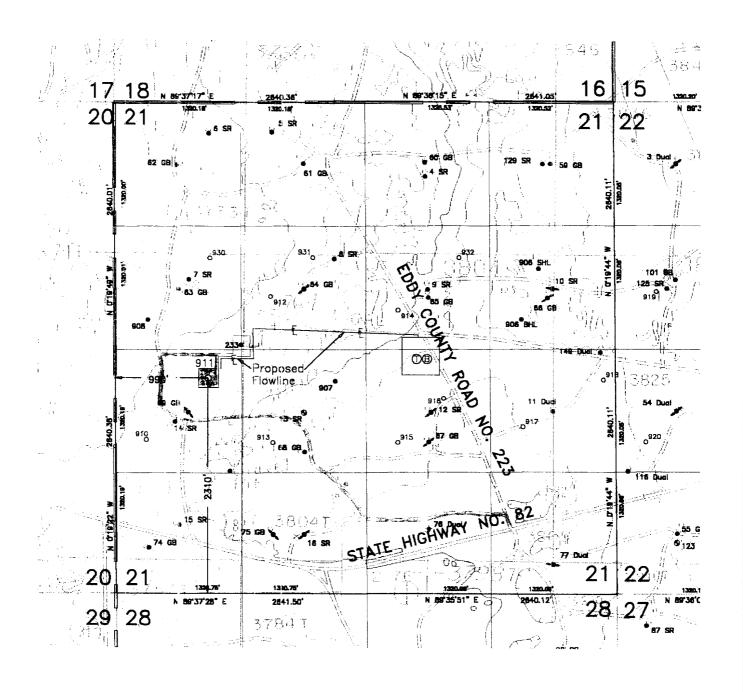

## LEGEND OF SYMBOLS

Access Road (Yellow)
Resource Road on Lease (Purple)
Resource Road on State Land (Blue)
Resource Road on Private Land (Pink)
Resource Road on Federal Land (Brown)
Resource Road on Federal Land (Brown)
Resource Road (Red)
Proposed Resource Road (Red)
Proposed Electric Line (Orange)
Proposed Production Flow Line (Green)

O = Staked Well Location
Producing Well Location
Resource Road (Red)
Resource Road on Federal Land (Blue)
Resource Road on Private Land (Brown)
Resource Road (Red)
Resou

## EXHIBIT "A" ACCESS ROAD AND FACILITIES MAP

#### TEXACO EXPLORATION AND PRODUCTION INC.

SKELLY UNIT No. 911 Located 2310' FSL & 990' FWL, Section 21, T-17-S, R-31-E, NMPM, Eddy County, NM

Drawn by: Gene M. Rodriguez	Scale: 1" = 1000'			
Date: January 30, 2001	A. Phil Ryan			
Checked by itS Piner	Dwa File: Skel 911a Dwa			

Attached to Form 3160-3
Texaco Explora. & Production, Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

## **DRILLING PROGRAM**

### 1. Geologic Name of Surface Formation

Quaternary

## 2. Estimated Tops of Important Geologic Markers:

Quaternary	Surface
Top of Salt	505'
Base of Salt	1025
Yates	1600'
Queen	2130'
San Andres	3050'
Glorietta	4320'

## 3. Estimated Depths of Anticipated Fresh Water, Oil and Gas:

150'	Fresh Water
2580'	Oil/Gas
3050'	Oil/Gas
4400'	Oil/Gas
	2580' 3050'

No other formations are expected to give up oil, gas or fresh water in measurable quantities. Setting 13 3/8" casing to 450' and circulating cement back to surface will protect the surface fresh water sand. Salt Section will be protected by setting 8 5/8" casing to 1620' and circulating cement back to surface. Any shallower zones above TD, which contain commercial quantities of oil and/or gas, will have cement circulated across them by cementing 5 1/2" production casing which will be run at TD.

#### 4. Casing Program:

Hole Size	e Interval	OD Casing	Weight, Grade, Jt, Cond., Type
17 1/2"	0-450'	13 3/8"	48#, K-55, ST&C, New, R-3 24#, K-55, ST&C, New, R-3
12 ¼" 7 7,8"	0-1620' 0-TD	8 5/8" 5 1/2"	17#, J-55, LT&C, New, R-3

Drilling Pr xgram Page 1

Attached to For 3160-3 Texaco Explora. A & Production, Inc. Skelly Unit #911 2310 FSL & 990 FWL NW/4 SW/4, Sec 21 T17S R31E Eddy County, NM

#### 5. Cement Program:

- 13 3.8" Surface Casing: Circulate to Surface with Class C w/2% CaCl2.
- 8 5/8 Intermiate Casing: Circulate to Surface with Class C W/2% CaCl2.
- 5 1/2" Production Casing: Cement Casing with Class C w/6# Salt & 2/10 of 1% CFR-3 per sack. We will run a hole caliper and run sufficient cement to tie back to 8 5/8" Casing.

## 6. Minimum Specifications for Pressure Control:

The blowout preventer equipment (BOP) shown in Exhibit #9 will consist of a double ramtype (2000 psi WP) preventer. This unit will be hydraulically operated and the ram type preventer will be equipped with blind rams on top of 4 1/2" drill pipe rams on bottom. The BOP will be nippled up on the 8 5/8" Intermiate casing and used continuously until TD is reached. All BOP's and accessory equipment will be tested to 1000 psi before drilling out of intermediate casing. Before drilling out of intermediate casing, the ram type BOP and accessory equipment will be tested to 2000 psi. Pipe rams will be operationally checked each 24-hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment (Exhibit #10) will include a Kelly cock and floor safety valve and choke lines and choke manifold (Exhibit #11) with 2000 psi WP rating.

## 7. Types and Characteristics of the Proposed Mud System:

The well will be drilled to TD with a combination of brine, cut brine and polymer mud system. The applicable depths and properties of this system are as follows:

DEPTH	TYPE	WEIGHT	VISCOSITY	WATERLOSS
0-450'	Fresh Water	8.5	28	N.C.
425-1620'	Brine	10	30	N.C.
1620'-TD	Cut Brine	9.1	29	N.C.

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept at the well site at all times.

## 8. Auxiliary Well Control and Monitoring Equipment:

- A. Kelly cock will be kept in the drill string at all times.
- B. A full opening drill pipe-stabbing valve with proper drill pipe connections will be on the rig floor at all times.

Drilling Frogram Page 2

Attached to For 3160-3 Texaco Explora a & Production, Inc. Skelly Unit #911 2310 FSL & 990 FWL NW/4 SW/4, Sec 21 T17S R31E Eddy County, NM

## 9. Logging, Testing and Coring Program:

- A. The electric logging program will consist of GR-Dual Laterolog, Spectral Density, Dual Spaced Neutron, CSNG Log and will be ran from T.D. to 8 5/8 casing shoe.
- B. Drill Stem test is not anticipated.
- C. No conventional coring is anticipated.
- D. Further testing procedures will be determined after the 5 1/2" production casing has been cemented at TD based on drill shows and log evaluation.

## 10. Abnormal Conditions, Pressures, Temperatures and Potential Hazards:

No abnormal pressures or temperatures are anticipated. The estimated bottom hole at TD is 110 degrees and estimated maximum bottom hole pressure is 2300 psig. Low levels of Hydrogen sulfide have been monitors in producing wells in the area, so H2S may be present while drilling of the well a plan is attached to the Drilling program. No major loss of circulation zones has been reported in offsetting wells.

## 11. Anticipated Starting Date and Duration of Operations:

Road and location work will not begin until approval has been received from the BLM. The anticipated spud date is March 1, 2001. Once commenced, the drilling operation should be finished in approximately 10 days. If the well is productive, an additional 30 days will be required for completion and testing before a decision is made to install permanent facilities.

Drilling Frogram Page 3

Attached to Form 3160-3 Texaco Exploration & Production, Inc. Skelly Unit #911 2310 FSL & 990 FWL NW/4 SW/4, Sec 21 T17S R31E Eddy County, NM


## SURFACE USE AND OPERATING PLAN

### 1. Existing & Proposed Access Roads

- A. The well site and elevation plat for the proposed well is shown in Exhibit #1. It was staked by
- B. All roads to the location are shown in Exhibit below. The existing roads are illustrated in Blue and are adequate for travel during drilling and production operations. Upgrading existing roads prior to drilling well will be done where necessary.

Directions to Location: A second of the seco

D. Routine grading and maintenance of existing roads will be conducted as necessary to maintain their condition as long as any operations continue on this lease.

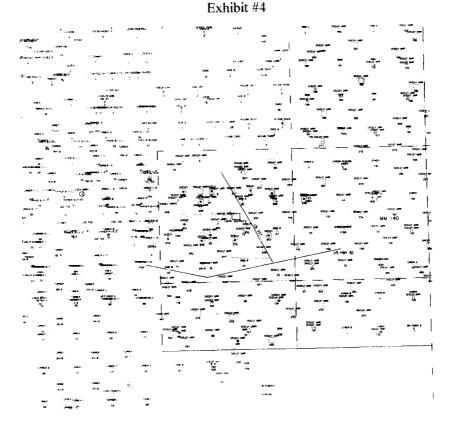

### 2. Proposed Access Road:

Surface Use Plan Page 4

Attached to For 3160-3
Texaco Explora & Production, Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

#### 2. Proposed Access Road:

Exhibit #3 shows the 100' of new access road. The road will be constructed as follows:

- A. The Maximum width of the running surface will be 14'. The road will be crowned and ditched and constructed of 6" rolled and compacted caliche.

  Ditches will be at 3:1 slope and 4 feet wide. Water will be diverted where necessary to avoid ponding, prevent erosion, maintain good drainage, and to be consistent with local drainage patterns.
- B. The average grade will be less than 1%.
- C. No turnouts are planned.
- D. No culverts, cattleguard, gates, low water crossings or fence cuts are necessary.
- E. Surfacing material will consist of native caliche. Caliche will be obtained from the nearest BLM approved caliche pit or reserve pit area.
- F. The proposed access road as shown in Exhibit #3 has been centerline flagged by Piper Surveying Co.

## 3. Location of Existing Wells & Proposed flow lines for New Wells:

Exhibit #4 shows all existing wells within a one-mile radius of this well. As shown on this plat there are numerous wells that are producing from the Grayburg San Andres and Paddock pool. The flowline will follow the archaeologically approved ROW from the Skelly Unit 911 to the Skelly Unit Federal battery located on Exhibit 4.

## 4. Location of Existing and/or Proposed Facilities:

- A. Texaco E & P Inc. does operate a production facility on this lease.
- B. If the well is productive, contemplated facilities will be as follows:
  - 1) Paddock Completion: Will be added to the Skelly Unit tank battery. The Facility is shown in Exhibit #5.
  - 2) The tank battery and facilities including all flow lines and piping will be installed according to API specifications.
  - Any additional caliche for firewalls, etc. will be obtained from a BLM approved caliche pit. Any additional construction materials will be purchased from contractors.

Attached to For 3160-3
Texaco Explora. 1 & Production, Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

4) It will be necessary to run electric power if this well is productive. Power will be run by CVE and they will send in a separate plan for power.

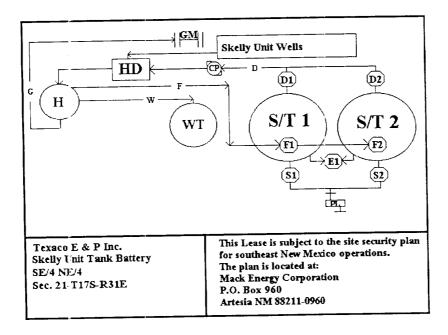


Exhibit #5

- A. If the well is productive, rehabilitation plans are as follows:
  - 1) The reserve pit will be back filled after the contents of the pit are dry (within 120 days after the well is completed).
  - 2) Topsoil removed from the drill site will be used to recontour the pit area to the original natural level, as nearly as possible, and reseeded as per BLM specifications.

## 5. Location and Type of Water Supply:

The well will be drilled with combination brine and fresh water mud system as outlined in the drilling program. The water will be obtained from commercial water stations in the area and hauled to location by transport truck over the existing and proposed access roads shown in Exhibit #4. If a commercial fresh water source is nearby, fasline may be laid along existing road ROW's and fresh water pumped to the well. No water well will be drilled on the location.

Surface Use Plan Page 6

Attached to For 3160-3
Texaco Exploration & Production, Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

## 6. Source of Construction Materials:

All caliche required for construction of the drill pad and proposed new access road (approximately 2500 cubic yards) will be obtained from a BLM approved caliche pit or the reserve pit.

## 7. Methods of Handling Water Disposal:

- A. Drill cuttings not retained for evaluation purposes will be disposed into the reserve pit.
- B. Drilling fluids will be contained in a lined working pit. The reserve pit will contain any excess drilling fluid or flow from the well during drilling, cementing and completion operations. The reserve pit will be an earthen pit, approximately 150' X 100' X 10' deep and fenced on three sides prior to drilling. It will be fenced on the fourth side immediately following rig removal. The reserve pit will be only lined 100' X 100' X 10' the remaining 50' of pit will not be lined and used only as an emergency pit. In the event that it is used fluid will be removed in 48 hours. The reserve pit and working pit will be lined (5-7-mil thickness) to minimize loss of drilling fluids and saturation of the ground with brine water.
- Water produced from the well during completion may be disposed into the reserve pit or a steel tank (depending on the rates). After the well is permanently placed on production, produced water will be collected in tanks (fiberglass) until pumped to an approved disposal system; produced oil will be collected in steel tanks until sold.
- D. Garbage and trash produced during drilling or completion operations will be collected in a trash bin and hauled to an approved landfill. All water and fluids will be disposed of into the reserve pit. Salts and other chemicals produced during drilling or testing will be disposed into the reserve pit. No toxic waste or hazardous chemicals will be produced by this operation.
- E. After the rig is moved out and the well is either completed or abandoned, all waste materials will be cleaned up within 30 days. The reserve pit will be completely fenced and kept closed until it has dried. When the reserve pit is dry enough to breakout and backfill and reseeded as per BLM specifications as weather permits. In the event of a dry hole only a dry hole marker will remain.

## 8. Ancillary Facilities:

No airstrip, campsite or other facilities will be built as a result of the operation on this well.

Surface Jse Plan

Attached to For 160-3
Texaco Exploration & Production, Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

## 9. Well Site Layout:

- A. The drill pad layout, with elevations staked by Piper Surveying Co., is shown in Exhibit #5. Dimensions of the pad and pits are shown. Topsoil, if available, will be stockpiled per BLM specifications. Because the pad is almost level no major cuts will be required.
- B. Diagram below shows the proposed orientation of reserve pit, working pit and access road. There is a possibility that the pits will be moved around depending on Caliche in the area. No permanent living facilities are planned, but a temporary foreman/toolpusher's trailer will be on location during the drilling operations.
- C. The reserve pit will be lined with a high quality plastic sheeting (5-7 mil thickness).

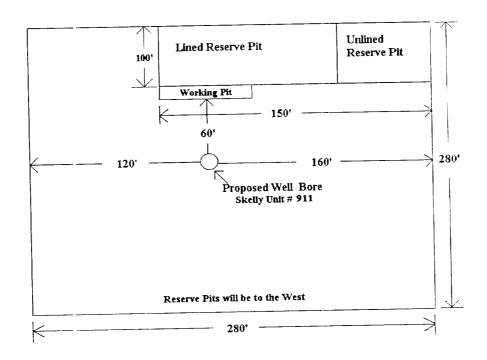


Exhibit #6

## 10. Plans for Restoration of the Surface:

Attached to For 3160-3
Texaco Exploration & Production, Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

- A. Upon completion of the proposed operations, the pit area, after allowing drying, will be broken out and leveled. The original topsoil will be returned to the pit area, which will be leveled and contoured to as nearly the original topography as possible.
- B. The disturbed area will be revegetated by reseeding during the proper growing season with a seed mixture of native grasses as recommended by the BLM.
- C. Three sides of the reserve pit will be fenced prior to and during drilling operations. At the time that the rig is removed, the reserve pit will be fenced on the rig (fourth) side to prevent livestock from being entrapped. The fencing will remain in place until the pit area is cleaned up and leveled. No oil will be left on the surface of the fluid in the pit.
- D. Upon completion of proposed operations, if the well is completed, the reserve pit area will be treated as outlined above within the same prescribed time. Any additional caliche required for facilities will be obtained from a BLM approved caliche pit. Topsoil removed from the drill site will be used to recontour the pit area to its original natural level and reseeded as per BLM specifications.

#### 11. Surface Ownership:

The well site and lease is located entirely on Federal surface. We have notified the surface lessee of the impending operations. According to BLM the lease is Charles Martin, P.O. Box 706 Artesia, NM 88211.

#### 12. Other Information:

- A. The area around the well site is grassland and the topsoil is sandy. The vegetation is native scrub grass with sagebrush.
- B. There is no permanent or live water in the immediate area.
- C. A Cultural Resources Examination has been requested and will be forwarded to your office in the near future.

## 13. Lessee's and Operator's Representative:

The Mack Energy Corporation representative responsible for assuring compliance with the surface use plan is as follows:

Matt J. Brewer
Mack Energy Corporation (Agent for Texaco E & P)
P.O. Box 960
Artesia, NM 88211-0960
Phone (505) 748-1288 (office)

Surface Use Plan

Attached to For 160-3
Texaco Exploration & Production Inc.
Skelly Unit #911
2310 FSL & 990 FWL
NW/4 SW/4, Sec 21 T17S R31E
Eddy County, NM

#### CERTIFICATION

I hereby certify that I, or person under my direct supervision, have inspected the proposed drill site and access route; that I am familiar with the conditions which currently exist; that the statements made in this plan are to the best of my knowledge, true and correct; and the work associated with the operations proposed herein will be performed by Mack Energy Corporation and its contractors and subcontractors in conformity with this plan and the terms and conditions which it is approved. This statement is subject to the provisions of 18 U.S.C. 1001 for the filing of a false statement.

Date <u>2/5/0/</u>

Signed:

Crissa D. Carter

Mack Energy Corporation (Agent for Texaco E & P Inc.)

Certification Page 10

## Hydrogen Sulfide Drilling Operation Plan

## I. HYDROGEN SULFIDE TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards an characteristics of hydrogen sulfide (H2S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- The proper use of H2S detectors alarms warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile tubular are to be used, personnel well be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan and Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H2S zone (within 3 days or 500 feet) and weekly H2S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H2S Drilling Operations Plan and the Public Protection Plan. This plan shall be available at the well site. All personnel will be required to carry documentation that they have received the proper training.

## II. H2S SAFETY EQUIPMENT AND SYSTEMS

Note: All H2S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonable expected to contain H2S.

## 1. Well Control Equipment:

- A. Flare line.
- B. Choke manifold.
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit.
- D. Auxiliary equipment may include if applicable: annular preventer & rotating head.

## 2. Protective equipment for essential personnel:

A. Mark II Survive air 30-minute units located in the doghouse and at briefing areas, as indicated on well site diagram.

## 3. H2S detection and monitoring equipment:

A. 1 portable H2S monitors positioned on location for best coverage and response. These units have warning lights and audible sirens when H2S levels of 20 PPM are reached.

#### 4. Visual warning systems:

- A. Wind direction indicators as shown on well site diagram (Exhibit #8).
- B. Caution/Danger signs (Exhibit #7) shall be posted on roads providing direct access to location. Signs will be painted a high visibility yellow with black lettering of sufficient size to be readable at a reasonable distance from the immediate location. Bilingual signs will be used, when appropriate. See example attached.

#### 5. Mud program:

A. The mud program has been designed to minimize the volume of H2S circulated to surface. Proper mud weight, safe drilling practices, and the use of H2S scavengers will minimize hazards when penetrating H2S bearing zones.

#### 6. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold and lines, and valves shall be suitable for H2S service.
- B. All elastomers used for packing and seals shall be H2S trim.

#### 7. Communication:

- A. Radio communications in company vehicles including cellular telephone and 2-way radio.
- B. Land line (telephone) communication at Office.

#### 8. Well testing:

- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safely and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H2S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

## EXHIBIT #7

## WARNING


## YOU ARE ENTERING AN H2S

## AUTHORIZED PERSONNEL ONLY

- 1. BEARDS OR CONTACT LENSES NOT ALLOWED
- 2. HARD HATS REQUIRED
- 3. SMOKING IN DESIGNATED AREAS ONLY
- 4. BE WIND CONSCIOUS AT ALL TIMES
- 5. CHECK WITH MACK ENERGY FOREMAN AT OFFICE

MACK ENERGY CORPORATION 1-505-748-1288

## DRILLING LOCATION H2S SAFTY EQUIPMENT Exhibit # 8

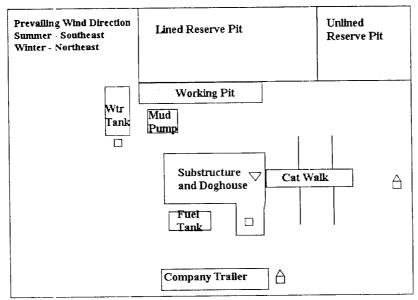


- $\nabla \mathcal{I}$  H2S Monitors with alarms at the bell nipple
- [ ] Wind Direction Indicators
- Safe Briefing areas with caution signs and breathing equipment min 150 feet from

# Attachment to Exhibit #9 NOTES REGARDING THE BLOWOUT PREVENTERS Skelly Unit #911 Eddy County, New Mexico


- 1. Drilling nipple to be so constructed that it can be removed without use of a welder through rotary table opening, with minimum I.D. equal to preventer bore.
- 2. Wear ring to be properly installed in head.
- 3. Blow out preventer and all fittings must be in good condition, 2000 psi WP minimum.
- 4. All fittings to be flanged.
- 5. Safety valve must be available on rig floor at all times with proper connections, valve to be full 2000 psi WP minimum.
- 6. All choke and fill lines to be securely anchored especially ends of choke lines.
- 7. Equipment through which bit must pass shall be at least as large as the diameter of the casing being drilled through.
- 8. Kelly cock on Kelly.
- 9. Extension wrenches and hands wheels to be properly installed.
- 10. Blow out preventer control to be located as close to driller's position as feasible.
- 11. Blow out preventer closing equipment to include minimum 40-gallon accumulator, two independent sources of pump power on each closing unit installation all API specifications.

Blowout Preventers Page 15

# Exhibit #9 BOPE Schematic

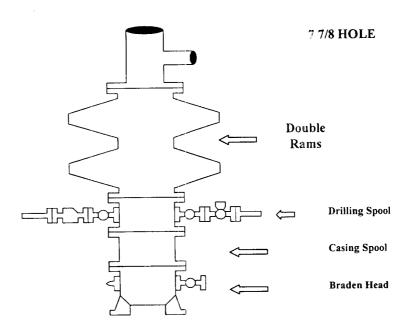

## Choke Manifold Requirement (2000 psi WP) No Annular Required

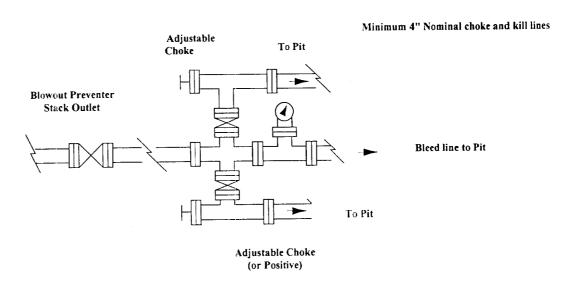


## Minimum Blowout Preventer Requirements

2000 psi Working Pressure 2 MWP EXHIBIT #10

## **Stack Requirements**

NO.	Items	Min.	Min.
		I.D.	Nominal
1	Flowline		2"
2	Fill up line		2"
3	Drilling nipple		
4	Annular preventer		
5	Two single or one dual hydraulically operated rarns		
6a	Drilling spool with 2" min. kill line and 3" min choke line outlets		2" Choke
6b	2" min. kill line and 3" min. choke line outlets in ram. (Alternate to 6a above)		
7	Valve Gate Plug	3 1/8	
8	Gate valve-power operated	3 1/8	
9	Line to choke manifold		3"
10	Valve Gate Plug	2 1/16	
11	Check valve	2 1/16	
12	Casing head		<u> </u>
13	Valve Gate Plug	1 13/16	
14	Pressure gauge with needle valve		
15	Kill line to rig mud pump manifold		2"

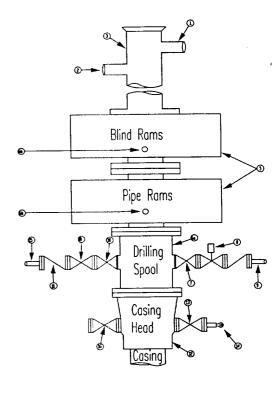

#### **OPTIONAL**

	OI II OI II III	
16	Flanged Valve	1 13/16

#### CONTRACTOR'S OP FION TO FURNISH:

- All equipment and connections above bradenhead or casinghead. Working pressure of preventers to be 2000 psi minimum.
- Automatic accumulator (80 gallon, minimum) capable of closing BOP in 30 seconds or less and, holding them closed against full rated working pressure.
- BOP controls, to be located near drillers' position
- 4. Kelly equipped with Kelly cock.
- Inside blowout preventer or its equivalent on derrick floor at all times with proper threads to fit pipe being used.
- Kelly saver-sub equipped with rubber casing protector at all times.
- 7. Plug type blowout preventer tester.
- Extra set pipe rams to fit drill pipe in use on location at all times.
- Type RX ring gaskets in place of Type R.

#### MEC TO FURNISH:


- 1. Bradenhead or casing head and side valves.
- 2. Wear bushing. If required.

#### GENERAL NOTES:

- Deviations from this drawing may be made only with the express permission of MEC's Drilling Manager.
- All connections, valves, fittings, piping, etc., subject to well or pump pressure must be flanged (suitable clamp connections acceptable) and have minimum working pressure equal to rated working pressure of preventers up through choke valves must be full opening and suitable for high pressure mud service.
- Controls to be of standard design and each marked, showing opening and closing
- Chokes will be positioned so as not to hamper or delay changing of choke beans. Replaceable parts for adjustable choke, or bean

- sizes, retainers, and choke wrenches to be conveniently located for immediate use.
- All valves to be equipped with hand-wheels or handles ready for immediate use.
- Choke lines must be suitably anchored.
- 7. Handwheels and extensions to be connected and ready for
- Valves adjacent to drilling spool to be kept open. Use outside valves except for emergency.
- All seamless steel control piping (2000 psi working pressure) to have flexible joints to avoid stress. Hoses will be permitted.
- Casinghead connections shall not be used except in case of emergency.
- 11. Do not use kill line for routine fill up operations.

Exhibit #11
MIMIMUM CHOKE MANIFOLD
3,000, 5,000, and 10,000 PSI Working Pressure
2 M will be used or greater
3 MWP - 5 MWP - 10 MWP

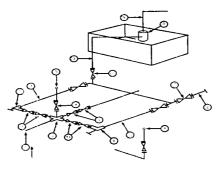

Mud Pit

Reserve Pit

\* Location of separator optional

**Below Substructure** 

#### Mimimum requirements

			N	1imimun	ı require	ments					
		3,000 MWP			5	,000 MWP		_1	10,000 MWP		
No.		I.D.	NOMINAL	Rating	I.D.	Nominal	Rating	I.D.	Nominal	Rating	
1	Line from drilling Spool		3"	3,000		3"	5,000		3"	10,000	
$-\frac{1}{2}$	Cross 3" x 3 x 3" x 2"			3,000			5,000				
- 2	Cross 3" x 3 x 3" x 2"									10,000	
3	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000	
4	Valve Gate Plug	1 13/16		3,000	1 13/16		5,000	1 13/16		10,000	
<u>4a</u>	Valves (1)	2 1/16		3,000	2 1/16		5,000	2 1/16		10,000	
	Pressure Gauge			3,000			5,000			10,000	
6	Valve Gate Plug	3 1/8		3,000	3 1/8	1	5,000	3 1/8		10,000	
7	Adjustable Choke (3)	2"		3,000	2"		5,000	2"		10,000	
	Adjustable Choke	1"		3,000	1"		5,000	2"		10,000	
9	Line		3"	3,000		3"	5,000		3"	10,000	
10	Line		2"	3,000		2"	5,000		2"	10,000	
11	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000	
12	Line	<u> </u>	3"	1,000		3"	1,000		3"	2,000	
13	Line		3"	1,000		3"	1,000		3"	2,000	
14	Remote reading compound Standpipe pressure quage			3,000			5,000			10,000	
15	Gas Separator		2' x5'			2' x5'			2' x5'	<u> </u>	
16	Line	<u> </u>	4"	1,000	1	4"	1.000		4"	2,000	
17	Valve Gate Plug	3 1/8		3,000	3 1/8		5,000	3 1/8		10,000	

- (1) Only one required in Class 3M
- (2) Gate valves only shall be used for Class 10 M
- (3) Remore operated hydraulic choke required on 5,000 psi and 10,000 psi for drilling.

#### EQUIPMENT SPECIFICATIONS AND INSTALLATION INSTRUCTION

- 1. All connections in choke manifold shall be welded, studded, flanged or Cameron clamp of comparable rating.
- 2. All flanges shall be API 6B or 6BX and ring gaskets shall be API RX or BX. Use only BX for 10 MWP.
- 3. All lines shall be securely anchored.
- 4. Chokes shall be equipped with tungsten carbide seats and needles, and replacements shall be available.
- 5. Choke manifold pressure and standpipe pressure gauges shall be available at the choke manifold to assist in regulating chokes. As an alternate with automatic chokes, a choke manifold pressure gauge shall be located on the rig floor in conjunction with the standpipe pressure gauge.
- 6. Line from drilling spool to choke manifold should bee as straight as possible. Lines downstream from chokes shall make turns by large bends or 90 degree bends using bull plugged tees.

## United State Department of the Interior

## BUREAU OF LAND MANAGEMENT Roswell Resource Area P.O. Drawer 1857 Roswell, New Mexico 88202-1857

## Statement Accepting Responsibility for Operations

Operator name Street or box City, State Zip Code,	:	Texaco Explor P.O. Box 960 Artesia, NM 88211-0960	ation & Production In	ic. (Mack Energy Agent)
The undersigned accepts all applicable terms, conditions, stipulations, and restrictions concerning operations conducted on the leased land or portion thereof, as described below:				
Lease No.:		NM-98122	Skelly Unit #911	
Legal Description of land:			Sec 21 T17S R31E	NW/4 SW/4
Formation(s) (if applicable):			Fren Paddock	
Bond Coverage: (State if individually bonded or another's bond)  Nationwide				
BLM Bond Fi	le No.:	CO-00	58	
Authorized Signature:  Crissa D. Carter Mack Energy Corporation (Agent for Texaco E & P Inc.)  Title:  Production Analyst				
			Date:	2/5/01