

submitted in lieu of Form 3160-5

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Sundry Notices and Reports on Wells

RECEIVED

2004 MAR 19 AM 9:55

070 Farmington, NM

1. Type of Well
WIW

2. Name of Operator
Hart Oil & Gas, Inc.

3. Address & Phone No. of Operator
PO Box 307, Farmington, NM 87499 (505) 326-1163

Location of Well, Footage, Sec., T, R, M

1980' FNL and 1980' FWL, Section 4, T-31-N, R-17-W,

5. Lease Number
14-20-603-2034
6. If Indian, All. or
Tribe Name
7. Unit Agreement Name

8. Well Name & Number
Navajo TI "F" #128
9. API Well No.
30-045-11095
10. Field and Pool
Horseshoe Gallup
11. County & State
San Juan County, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other -


☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

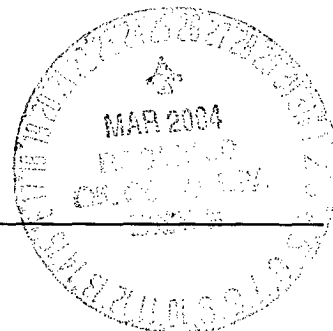

13. Describe Proposed or Completed Operations:

Hart Oil & Gas plugged and abandoned this well on February 16, 2004.

2-11-04 MOL & RU. Wellhead rusted. Unable to release packer. Stretch readings, stuck at 690'. Records show packer at 1085'. SDFD.

2-12-04 Attempt to pressure test annulus casing, small leak. Run tubing gauge ring to 1042'. J. Walker, EPA, approved procedure. Jet cut tubing at 1032'. Work tubing, free. TOH and found packer, would not come through BOP. ND BOP and remove tubing head. LD 15 joints tubing, packer and 1 joint tubing; packer at 457'. PU 35 joints 2-3/8" workstring and tag at 1100'. Shut in well.

2-13-04 Circulate well clean with 25 bbls water. Plug #1 with 52 sxs cement w/2% CaCl2 inside casing from 1100' to 512' to fill Gallup perforations. LD tubing. Shut in well and WOC. Attempt to PT casing, 500# then bled down to 450# in 3 min. RU wireline and tag cement at 621'. Perforate 3 holes at 97'. Establish circulation out bradenhead with total 7 bbls of water. Plug #2 with 41 sxs cement pump down 4-1/2" casing from 97' to surface, circulate good cement out bradenhead. Shut in well.

2-16-04 Cut off wellhead and found cement at surface. Mix 20 sxs cement and install P&A marker. RD & MOL. W. Ashley, V. Urntillie, Navajo Nation Minerals and J. Walker, B. Freeman Navajo EPA were on location.

14. I hereby certify that the foregoing is true and correct.

Signed

Gina M. Saied

Title

Vice President

Date

2/28/04

(This space for Federal or State Office use)

APPROVED BY

Title

Date

FOR RECORD

CONDITION OF APPROVAL, if any:

MAR 22 2004

NMOC

ADMINISTRATIVE OFFICE