

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well
GAS

2. Name of Operator

**BURLINGTON
RESOURCES**

OIL & GAS COMPANY

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

1090' FNL, 850' FEL, Sec.16, T-30-N, R-10-W, NMPM, San Juan County

API # (assigned by OCD)
30-045-09531

5. Lease Number

6. State Oil&Gas Lease #
B-10400-1-NM

7. Lease Name/Unit Name

Atlantic D Com B

8. Well No.

3

9. Pool Name or Wildcat
Blanco Mesaverde

10. Elevation:

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other -

☐ Change of Plans

☐ New Construction


☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

Burlington Resources completed workover operations as per attached daily summary.

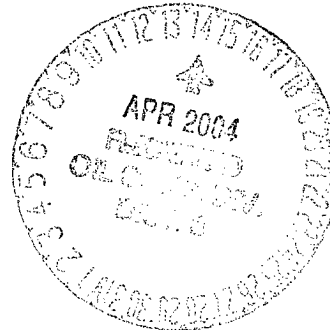

SIGNATURE

Frances Bond

Regulatory Specialist April 12, 2004

FSB

(This space for State Use)

Approved by

Charles H.

Title

DEPUTY OIL & GAS INSPECTOR, DIST. #3

Date

APR 14 2004

BURLINGTON
RESOURCES**San Juan Division - Intranet Well Information System
(DIMS)**

Friday, April 2, 20

--Logon--	--By Date--	--By Well--	--By AFE--	--By Rig--
--Printouts--	--Production Notes--	--Accountability--	--Safety--	
	--Other--	API Units		

Export to Excel**Operations Detail Report for: ATLANTIC D COM B #3
LOE WORK**Entire Well / All EventsTime Breakdown Summary

DAY	FROM	TO	HRS	DEPTH (ft)	PHASE	CODES	OPERATION
1 (LWK)	02/18/2004 06:00	07:00	1.00		PREWRK	MIMO a	ROAD CREW TO LOC, WARM UP AND SERVICE RIG
1 (LWK)	02/18/2004 07:00	08:00	1.00		PREWRK	MIMO a	ROAD RIG AND CREW TO LOC.
1 (LWK)	02/18/2004 08:00	08:15	0.25		PREWRK	SAFE a	SAFETY MEETING - H2S, SHOWED 10 PPM, PUMPED BIOCLITE, CHECKED, 0 PPM, KEEP BACK, DO DO BREATH OVER OPEN TUBING - 4 CREW, RIG SUPERV, HOT OILER
1 (LWK)	02/18/2004 08:15	09:00	0.75		MIRU	RURD a	SPOT RIG, RIG UP RIG
1 (LWK)	02/18/2004 09:00	09:15	0.25		OBJECT	RURD a	RDHH, PULL POLISH ROD, 1 RODS, TIH W/POLISH ROD
1 (LWK)	02/18/2004 09:15	10:15	1.00		OBJECT	HOTO a	RIG UP HOT OIL TRUCK, PUMP 30 BBLS WATER DOWN TUBING
1 (LWK)	02/18/2004 10:15	11:30	1.25		OBJECT	TRIP a	LAY DOWN POLISH ROD, TOH W/RODS AND PUMP, 223 .750 RODS, MIXTURE GUIDED AND PLAIN, 2 - 8' PONY RODS, 1 - 2' PONY ROD, RODS HAVE HEAVY SCALE, 8' SAND SCREEN COMPLETELY SCALED OFF, PUMP HEAVY SCALE
1 (LWK)	02/18/2004 11:30	12:30	1.00		OBJECT	NUND a	NIPPLE DOWN WELLHEAD, NIPPLE UP BOP, RU FLOOR
1 (LWK)	02/18/2004 12:30	13:00	0.50		OBJECT	PULD a	PICKUP 1 JOINT, PULL ON TUBING, 52,000, COULD NOT GET DONUT HIGH ENOUGH TO REMOVE. CLUTCHES SLIPPING
1 (LWK)	02/18/2004 13:00	14:00	1.00		OBJECT		TIE BACK RIG TO BE ABLE TO PULL MORE WEIGHT,
1 (LWK)	02/18/2004 14:00	14:15	0.25		OBJECT		PULL 57,000#, SET SLIPS, REMOVE TUBING HANGER, TUBING HAS SCALE ON TOP JOINT.

1 (LWK)	02/18/2004 14:15	14:45	0.50		OBJECT	STUK a	T S	TRY WORKING TUBING DOWN HOLE, PULL UP, TUBING WOULD NOT GO DOWN, SEEMS TO BE STRETCHING COMING UP, WILL GO TO PLAN B
1 (LWK)	02/18/2004 14:45	15:15	0.50		OBJECT	SHDN a	T S	WINTERIZE RIG, SECURE RIG, SENT CREW TO HOUSE
1 (LWK)	02/18/2004 15:15	17:00	1.75		OBJECT	WAIT a	T S	WAIT ON ACID TO ARRIVE, WENT TO WRONG LOCATION
1 (LWK)	02/18/2004 17:00	18:00	1.00		OBJECT	PUMP a	T S	NIPPLE UP ACID TRUCK, PUMP 160 GALLONS 28% HCL, TRIPLE INHIBITED DOWN TUBING, 80 GALLONS WATER DISPLACEMENT, PUMP 590 GALLONS 28% HCL DOWN CASING, ACID IS TRIPLE INHIBITED, DISPLACE WITH 16 GALLONS WATER, NIPPLE DOWN ACID TRUCK, MAKE SURE ALL VALVES ARE CLOSED
2 (LWK)	02/19/2004 06:00	07:00	1.00		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
2 (LWK)	02/19/2004 07:00	07:15	0.25		PREWRK	SAFE a	N	SAFETY MEETING - SMOKING - DESIGNATED AREA ONLY - 4 CREW
2 (LWK)	02/19/2004 07:15	07:45	0.50		OBJECT	PUMP a	T	PUMP 30 BBLS WATER DOWN TUBING
2 (LWK)	02/19/2004 07:45	08:00	0.25		OBJECT	STUK a	T	TRY AND FREE UP STUCK TUBING
2 (LWK)	02/19/2004 08:00	08:30	0.50		FISH	RURD a	T	RIG UP WIRELINE SPECIALTIES INC
2 (LWK)	02/19/2004 08:30	10:45	2.25		FISH	TRIP a	T	TIH TO 5658, CALIBRATE @ 5300, 100 POINTS, FREE ABOVE SEAT NIPPLE, TOH, TIH WITH PREP SHOT, TOH, TIH W/CHEMICAL CUTTER, CUT TUBING @ 5616, 7' ABOVE SEAT NIPPLE, TOH.
2 (LWK)	02/19/2004 10:45	11:15	0.50		FISH	RURD a	T	RIG DOWN WIRE LINE UNIT, PULL UP ON TUBING, TUBING PARTED @ CUT.
2 (LWK)	02/19/2004 11:15	11:45	0.50		FISH		T	GET OFF DEAD LINE, BACK ON DRUM
2 (LWK)	02/19/2004 11:45	13:45	2.00		FISH	TRIP a	T	TOOH WITH TUBING, 179 JOINTS 2.375 TUBING, 1 CHEMICAL CUT JOINT (23.82), JOINT 63 THRU 68 HAD BAD COLLARS (TOOK SAMPLE TO OFFICE)
2 (LWK)	02/19/2004 13:45	15:45	2.00		FISH	TRIP a	T	TIH WITH FOLLOWING: 3 7/8 OVERSHOT, FLOAT SUB, BUMPER SUB, JARS, 4 DRILL COLLARS (3 1/8), INTENSIFIER, CHANGE OVER, 176 JTS TUBING (5616)
2 (LWK)	02/19/2004 15:45	16:15	0.50		FISH	FISH a	T	SET DOWN ON FISH, PULL UP, SET BACK DOWN, PULL UP TO 45,000, SET OFF INTENSIFIER, REPEAT 7 TIMES, SOMETHING CAME LOOSE, SET BACK DOWN, ROTATE, PULL UP, SET DOWN.
2 (LWK)	02/19/2004 16:15	16:45	0.50		FISH	TRIP a	T	TOH W/20 STANDS
2 (LWK)	02/19/2004 16:45	17:15	0.50		OBJECT	SHDN a	N	WINTERIZE PUMP, LOCK RAMS, SHUT WELL IN, SDFN

3 (LWK)	02/20/2004 06:00	07:00	1.00		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP AND SERVICE RIG
3 (LWK)	02/20/2004 07:00	07:30	0.50		PREWRK	SAFE a	N	SAFETY MEETING - HANDLING COLLARS, TIGHTEN LIFT SUBS, USE LOW GEAR, MAKE SURE SWIVEL ON BLOCKS WORKING - 4 CREW, RIG SUPERV., FISHERMAN
3 (LWK)	02/20/2004 07:30	09:00	1.50		FISH	TRIP a	T S	TOH WITH TUBING, CUTOFF JOINT, 3' OF PERFORATED SUB, PERF SUB DID NOT SHOW ANY CORROSION, HAD BEEN PULLED APART
3 (LWK)	02/20/2004 09:00	11:00	2.00		FISH	TRIP a	T S	PICKUP EXTENSION, TIH WITH FISHING TOOLS
3 (LWK)	02/20/2004 11:00	11:30	0.50		FISH		T S	TIE BACK DRILL LINE
3 (LWK)	02/20/2004 11:30	13:00	1.50		FISH	FISH a	T S	SET DOWN OVER FISH, PULL UP, 30,000, SET DOWN, ROTATE, PULL UP TO 40,000, START JARRING, KEEP JARRING, PULL AS MUCH AS 55,000, SEEMS TO BE MOVING. FINALLY HAD SOMETHING COME LOOSE
3 (LWK)	02/20/2004 13:00	13:30	0.50		FISH		T S	DOUBLE LINE
3 (LWK)	02/20/2004 13:30	15:00	1.50		FISH	TRIP a	T S	TOH WITH FISHING TOOLS AND FISH, 1' OF PERF SUB, 1 JOINT TUBING WITH PURGE VALVE (SHOWS SETTING 15' INTO SAND, 98' OF FILL, PBTD @ 5728, SAND @ 5640.
3 (LWK)	02/20/2004 15:00	16:00	1.00		FISH	PULD a	T S	LAY DOWN ALL FISHING TOOLS, SENT ALL FISHING TOOLS EXCEPT COLLARS AND WASH PIPE TO TOWN ON KEN FOR BAKER, SENT COLLARS AND WASH OVER PIPE ON MONARCH TO BAKER
3 (LWK)	02/20/2004 16:00	17:00	1.00		OBJECT	TRIP a	N	PICKUP 3 7/8 MILL, INLINE CHECK, TRIP IN HOLE WITH 50 STANDS, PUT IN TIW VALVE
3 (LWK)	02/20/2004 17:00	17:30	0.50		OBJECT	SHDN a	N	WINTERIZE RIG, PICKUP TOOLS, LOCK RAMS, SECURE RIG, SDTM 2-23-2004
4 (LWK)	02/23/2004 06:00	07:15	1.25		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
4 (LWK)	02/23/2004 07:15	07:30	0.25		PREWRK	SAFE a	N	SAFETY MEETING - AIR PKG, STAY BACK FROM LINES, WATCH HIGH PRESSURE, BLEED DOWN BEFORE USING HAMMER ON ANY UNIONS, 4 CREW, RIG SUPERV., AIR OPER.
4 (LWK)	02/23/2004 07:30	09:00	1.50		OBJECT	TRIP a	N	TIH WITH TUBING, PU 2 JOINTS OFF TRAILER, TAG 2ND JOINT IN, 5643, PBTD 5728, 85' OF FILL, BOTTOM PERF 5704, 61' OF PERFS COVERED, INSTALL NEW STRIPPING RUBBER, RIG UP MANIFOLD TO PUMP AIR AND WATER.
4 (LWK)	02/23/2004 09:00	10:45	1.75		CLEAN	COUT a	N	START AIR DOWN HOLE, 450#, DROPPED TO 400, CIRCULATE TO SURFACE, START MIST, 12 BBL P/HR, 1 GAL SOAP P/20, 1 GAL INHIBITOR P/20, 1200 MCF
4 (LWK)	02/23/2004 10:45	13:00	2.25		CLEAN	COUT a	N	MAKE CONNECTION, MOVE 3" FLOW LINE TO OTHER SIDE OF THE TANK, CLEAN OUT W/AIR

								AND MIST TO PBTD, 5728, BLOW TO FLOW" BACK, MADE HEAVY SAND THAN TRACE OF SAND
4 (LWK)	02/23/2004 13:00	14:30	1.50		CLEAN	FLOW a	N	PULL UP 1 STAND, LET WELL NATURAL FLOW TO FLOW BACK TANK, MADE 21' OF SAND IN 1.5 HOURS
4 (LWK)	02/23/2004 14:30	17:00	2.50		CLEAN	COUT a	N	RIH, START AIR PKG, CO TO PBTD, LET WELL BLOW ON BOTTOM WITH AIR AND MIST,
4 (LWK)	02/23/2004 17:00	18:00	1.00		OBJECT	TRIP a	N	TRIP OUT OF HOLE WITH TUBING, 91 STANDS AND SINGLE PLUS MILL, SN, INLINE CHECK.
4 (LWK)	02/23/2004 18:00	18:30	0.50		OBJECT	SHDN a	N	WINTERIZE PUMP, LOCK RAMS, PICK UP TOOLS, PUT WELL DOWN LINE, SDFN
5 (LWK)	02/24/2004 06:00	07:00	1.00		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
5 (LWK)	02/24/2004 07:00	07:15	0.25		PREWRK	SAFE a	N	SAFETY MEETING, SNOWY CONDITIONS, SLIPPERY SURFACES, VISABILITY, BE DELIBERATE, 4 CREW, RIG SUPERV., AIR OPERATOR
5 (LWK)	02/24/2004 07:15	08:00	0.75		OBJECT	RURD a	N	NIPPLE DOWN STRIPPER HEAD, RU HEAD FOR BAILER, PICK UP BAILER.
5 (LWK)	02/24/2004 08:00	08:30	0.50		CLEAN	COUT a	N	TIH WITH SAND LINE BAILER, HITTING HARD ON BOTTOM, TOH, NO SAND, TRACE OF WATER
5 (LWK)	02/24/2004 08:30	09:15	0.75		OBJECT	PUMP a	N	PUMP 20 BBLS WATER DOWN CASING AHEAD OF BAILER
5 (LWK)	02/24/2004 09:15	09:30	0.25		OBJECT	COUT a	N	TIH WITH SAND LINE BAILER, BAIL ON BOTTOM, TOH, CAN NOT BAIL
5 (LWK)	02/24/2004 09:30	10:00	0.50		OBJECT	RURD a	N	RIG DOWN BAILER HEAD, NIPPLE UP STRIPPER HEAD, LAY DOWN BAILER ON JUNK TRAILER
5 (LWK)	02/24/2004 10:00	11:15	1.25		OBJECT	TRIP a	N	INSTALL NOTCHED COLLAR ON BOTTOM OF TUBING JOINT, TRIP IN HOLE WITH TUBING, TAG UP @ 5668, 60' FILL, 5704 BOTTOM PERF, 5728 PBTD
5 (LWK)	02/24/2004 11:15	17:30	6.25		OBJECT	COUT a	N	START AIR PKG, CLEAN OUT WITH AIR AND MIST, SOAP, INHIBITOR. TOOK 1.5 HOURS TO GET RETURNS MAKING 1 CUP SAND P/5 GALLONS ON BUCKET TEST, CLEAN OUT ON BOTTOM FOR 2 HOURS (PBTD 5728)
5 (LWK)	02/24/2004 17:30	17:45	0.25		OBJECT	TRIP a	N	TOH WITH FIVE STANDS
5 (LWK)	02/24/2004 17:45	18:15	0.50		OBJECT	SHDN a	N	WINTERIZE PUMP, PICKUP TOOLS, SECURE RIG, LOCK RAMS, SDFN FLOW TO FLOWBACK TANK UNTIL OXYGEN LEVEL OF .5 IS ACHIEVED, PUT WELL DOWN LINE AND LET PRODUCE OVERNIGHT.
6 (LWK)	02/25/2004 06:00	07:00	1.00		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
6 (LWK)	02/25/2004 07:00	07:15	0.25		PREWRK	SAFE a	N	SAFETY MEETING - HOUSE KEEPING, KEEP DOG HOUSE AS CLEAN AS POSSIBLE W/MUD, LAT, LONG, POSTED, 4 CREW, RIG SUPERV., AIR

								OPER.
6 (LWK)	02/25/2004 07:15	08:45	1.50		OBJECT	TRIP a	N	TRIP IN HOLE WITH TUBING, TAG, 28' OF FILL
6 (LWK)	02/25/2004 08:45	10:15	1.50		CLEAN	COUT a	N	START AIR PKG, CLEAN OUT WITH AIR/MIST, SOAP, INHIBITOR
6 (LWK)	02/25/2004 10:15	11:30	1.25		CLEAN	COUT a	N	NATURAL FLOW WELL (8' OF FILL, SEEMS SOFT, WILL TRIP IN WITH BAILER)
6 (LWK)	02/25/2004 11:30	12:45	1.25		OBJECT	TRIP a	N	TRIP OUT OF HOLE WITH TUBING
6 (LWK)	02/25/2004 12:45	13:30	0.75		OBJECT	NUND a	N	NIPPLE DOWN STRIPPER HEAD, NIPPLE UP FLANGE FOR LUBRICATOR ON BAILER, PU BAILER
6 (LWK)	02/25/2004 13:30	14:15	0.75		OBJECT	COUT a	N	TIH WITH BAILER, TRY AND CLEAN OUT, BAILER HANGING UP GOING IN, WELL MAKING SAND, BAIL ON BOTTOM, HANGING UP COMING OUT, NO SAND IN BAILER
6 (LWK)	02/25/2004 14:15	14:45	0.50		OBJECT	NUND a	N	LAY DOWN LUBRICATOR AND BAILER, NIPPLE DOWN LUBRICATOR FLANGE, NIPPLE UP STRIPPER HEAD
6 (LWK)	02/25/2004 14:45	16:00	1.25		OBJECT	TRIP a	N	TIH WITH NOTCHED COLLAR, TUBING STRING, TAG, 35' SAND.
6 (LWK)	02/25/2004 16:00	18:00	2.00		CLEAN	COUT a	N	CLEAN OUT TO PBTD WITH AIR AND MIST
6 (LWK)	02/25/2004 18:00	18:15	0.25		OBJECT	TRIP a	N	TRIP OUT OF HOLE WITH 5 STANDS.
6 (LWK)	02/25/2004 18:15	18:45	0.50		OBJECT	SHDN a	N	WINTERIZE PUMP, PICKUP TOOLS, SECURE WELL, SRDFN
6 (LWK)	02/25/2004 18:45	19:30	0.75		OBJECT	BLOW a	N	BLOW WELL UNTIL AIR IS GONE, PUT WELL DOWN LINE, LOCK RAMS
7 (LWK)	02/26/2004 06:00	07:00	1.00		OBJECT	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
7 (LWK)	02/26/2004 07:00	07:15	0.25		OBJECT	SAFE a	N	SAFETY MEETING - PUMPING AIR, COMMUNICATE WITH EACH OTHER ON OPENING AND CLOSING VALVES, 4 CREW, AIR OPER., RIG SUPERV.
7 (LWK)	02/26/2004 07:15	07:30	0.25		OBJECT	TRIP a	N	TIH W/TUBING, TAG UP @ 5711, 17' OF FILL
7 (LWK)	02/26/2004 07:30	07:45	0.25		CLEAN	COUT a	TJ	START AIR AND MIST, PRESSURE CAME UP TO 1500#, SHUT DOWN AIR PKG.
7 (LWK)	02/26/2004 07:45	08:00	0.25		CLEAN	PUMP a	N	PUMP 10 BBLS. WATER DOWN TUBING
7 (LWK)	02/26/2004 08:00	10:00	2.00		CLEAN	COUT a	N	START AIR, MIST, SOAP, PRESSURE CAME UP TO 574#, DROPPED TO 540#, TOOK 1 HOUR TO GET RETURNS, BLOW TO FLOW BACK TANK, 5 GAL SWEEP, HEAVY SOAP, CLEAN OUT TO PBTD 5728'
7 (LWK)	02/26/2004 10:00	11:00	1.00		CLEAN	FLOW a	N	FLOW BACK NATURAL TO FLOW BACK TANK

7 (LWK)	02/26/2004 11:00	11:15	0.25		OBJECT	FLOW a	N	TIH W/TUBING, TAG, 4' OF FILL
7 (LWK)	02/26/2004 11:15	13:30	2.25		OBJECT	COUT a	N	START AIR AND MIST, SOAP, INHIBITOR, RUN 5 BBL SWEEP/HEAVY SOAP, GOOD RETURNS, HEAVY SAND, CLEAN OUT TO PBTD 5728
7 (LWK)	02/26/2004 13:30	14:30	1.00		OBJECT	FLOW a	N	LET WELL NATURAL FLOW UP 4 1/2" CASING, (TAGGED UP, 5' FILL)
7 (LWK)	02/26/2004 14:30	17:00	2.50		CLEAN	COUT a	N	START AIR PKG, MIST AND SOAP, CLEANOUT TO PBTD, , RUN 5 BBL SWEEP.
7 (LWK)	02/26/2004 17:00	18:30	1.50		OBJECT	SHDN a	N	PULL 5 STANDS, WINTERIZE RIG, SECURE, SDFN, GET LEL OK, PRODUCE WELL DOWN LINE
8 (LWK)	02/27/2004 06:00	07:00	1.00		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
8 (LWK)	02/27/2004 07:00	07:15	0.25		PREWRK	SAFE a	N	SAFETY MEETING - TRIPPING TUBING SAFELY, PINCH POINTS, RAILINGS ON FLOOR, GERONIMO, 4 CREW, RIG SUPERV., AIR OPERATOR
8 (LWK)	02/27/2004 07:15	07:30	0.25		OBJECT	TRIP a	N	TIH, TAG FILL, 6'
8 (LWK)	02/27/2004 07:30	10:30	3.00		CLEAN	COUT a	N	CLEAN OUT WITH AIR/MIST, SOAP, INHIBITOR, 1200 CFM, RUN 5 BBL SWEEP
8 (LWK)	02/27/2004 10:30	12:15	1.75		OBJECT	TRIP a	N	TOH WITH TUBING, HAD TO LET WELL BLEED DOWN, 3" LINE TO FLOWBACK PLUGGED, GOT FLOWING AGAIN.
8 (LWK)	02/27/2004 12:15	13:30	1.25		OBJECT	TRIP a	N	TIH WITH FOLLOWING: 1 - 2.375 EUE PURGE VALVE 1 - JT. 2.375 EUE J-55 4.7# EUE TUBING 1 - 2.375 EUE PERFORATED PUP JOINT (4') 1 - 2.375 EUE SEATING NIPPLE 1.78 ID 180 - JTS 2.375 EUE J-55 4.7# TUBING LAND TUBING @ 5652.54, SN 5615.32, PBTD @ 5728, BOTTOM PERF 5704, TOP PERF 466 1, 4 1/2" 10.5# LONGSTRING, 10' KB
8 (LWK)	02/27/2004 13:30	14:45	1.25		OBJECT	NUND a	N	LAND TUBING, RIG DOWN FLOOR, NIPPLE DOWN BOP, NIPPLE UP WELLHEAD, RIG UP TO RUN RODS
8 (LWK)	02/27/2004 14:45	15:15	0.50		OBJECT	PUMP a	N	START PUMP, PUMP 10 BBLs DOWN TUBING TO MAKE SURE ANY SAND IS WASHED DOWN.
8 (LWK)	02/27/2004 15:15	16:45	1.50		OBJECT	TRIP a	N	PU PUMP, TIH WITH FOLLOWING: 1 - 2" X 1 1/4" X 10' X 14' RHAC-Z IN SERT PUMP, SCPID-001 BBL., 4SM-003 PLUNGER, A/TC VALVES, 83" MAX STROKE, BR154, 3/4" PIN, SANDCHECK, LIFTSUB, SPIRAL ROD GUIDE, 8' SAND SCREEN 1 - .750 PONY ROD (8") 100 - .750 TYPE "D" GUIDED RODS 124 - .750 TYPE "D" PLAIN RODS 2 - .750 PONY RODS (8' & 4') 1 - 1.250 POLISH ROD W/1.500 POLISH ROD LINER 10' 1 - NEW BIG STUFF STUFFING BOX.
8 (LWK)	02/27/2004 16:45	17:45	1.00		OBJECT			SEAT PUMP, LOAD TUBING WITH WATER, PRESSURE TEST TO 1500#, HOLD TEN MINUTES, BLEED OFF, LONGSTROKE FROM

								200# TO 600#, GOOD PUMP ACTION, BLEED OFF. (HAD TO RUHH AND HANG OFF RODS TO GET PUMING UNIT TO RUN) SET SOFT TAG, CHECK DUMPS, OK, LEAVE PUMPING UNIT PUMPING AND WELL FLOWING, WINTERIZE PUMP, LOAD TOOLS IN PICKUP ALONG WITH ELEVATORS, SECURE RIG, SDTM 3-1-2004
9 (LWK)	03/01/2004 06:00	07:00	1.00		PREWRK	MIMO a	N	ROAD CREW TO LOC., WARM UP & SERVICE RIG
9 (LWK)	03/01/2004 07:00	07:15	0.25		PREWRK	SAFE a	N	SAFETY MEETING - RIGGING DOWN SAFELY - PINCH POINTS, LINES FROZE IN GROUND, 4 CREW, RIG SUPERV.
9 (LWK)	03/01/2004 07:15	08:00	0.75		OBJECT	RURD a	N	RIG DOWN RIG, RELEASE RIG, WELL PUMPED ALL WEEKEND, MOVE TO SCHUMACHER 13 USED 2 JOINTS TUBING OFF TRAILER, PUT CUTOFF AND JUNK JOINT ON TRAILER MOVE ON LOC., PULLED RODS AND PUMP, HEAVY SCALE, TUBING STUCK, PUMPED 28% DOWN TUBING AND CASING, TUBING STILL STUCK, FREE POINT, FISH 8' CUTOFF, SN, 4' PERF SUB, 1 JT, PV, PULLED PERF PUP APART, FISHED BALANCE, 98' OF FILL, CLEANED OUT WITH AIR, COULD NOT CLEANOUT WITH SANDLINE BAILER, CLEANED OUT TO PSTD 5728, RAN NEW PUMP, LET PUMP OVER WEEKEND, RIGGED DOWN AND MOVED TO SCHUMACHER 13 CLEANED UP ALL SPILLS AND TRASH

[Global Intranet](#) | [Comments and Feedback](#) | [Legal Notice](#) | [Privacy Statement](#)

