

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 1301 W. Grand Ave., Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

PN

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO.
 30-045-23119

5. Indicate Type of Lease
 STATE FEE


6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM PC-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well Other

2. Name of Operator
 Four Star Oil and Gas Company

3. Address of Operator
 P.O. Box 1289 Farmington, New Mexico 87499-1289

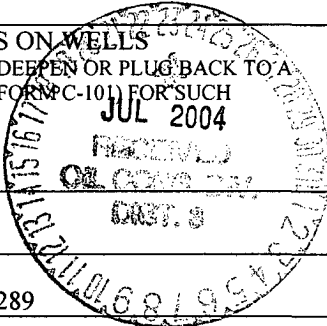

7. Lease Name or Unit Agreement Name:
 Ward A

8. Well No.
 #1

9. Pool name or Wildcat
 Otero Charca

4. Well Location
 Unit Letter L : 1710 feet from the South line and 1180 feet from the West line
 Section 13 Township 29N Range 11W NMPM San Juan County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 5579 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe prop osed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

Four Star Oil and Gas has plugged and abandoned the subject well according to the attached procedure:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ken Jackson TITLE Regulatory Specialist DATE 7/14/04

Type or print name Ken Jackson Telephone No. (281) 561-4991

(This space for State use)
 APPROVED BY A. Villanueva TITLE REGULATORY DIVISION DATE JUL 23 2004

Conditions of approval, if any:

Ward A #1
P & A Procedure

- 1) **MIRU. Conducted safety meeting with all personnel on location. N/U Relief line. Blew well down to 0. N/D Wellhead. N/U BOPE and tested.**
- 2) **TOOH and tally tubing.**
- 3) **RIH w/ scraper to 2900'. Set CIBP @ 2900'.**
- 4) **Loaded hole and pressure test to 500 PSI for fifteen minutes. Held.**
- 5) **Plug #1 (Charca) 2900'-2700'. 12sx. POOH to 1925'.**
- 6) **Plug #2 (PC Fruitland) 1926'-1505'. 32sx. POOH to 787'.**
- 7) **Schlumberger mixed too much cement and brought it up to 787' Circ 5 bbls cmt to surface and wait on cmt.**
- 8) **Plug #3 (Kirtland -Surface) 787'-Surface. 62sx Glass G.**
- 9) **ND BOP's and fill casing to surface from top.**
- 10) **RD floor. Cut off wellhead. RD and MOL. Cut off anchors and install dry hole marker.**