

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED

2003 APR 23 PM 1:17

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir

Use "APPLICATION FOR PERMIT - -" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Redwolf Production, Inc.

3. Address and Telephone No.

P. O. Box 5382, Farmington, NM 87499

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

930' FSL & 800' FWL
Section 15, T25N, R11W

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NOO-C-14-20-5200

6. If Indian, Allottee or Tribe Name

Navajo Allotted

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Lost Wapiti 15 No. 13

9. API Well No.

30-045-26846

10. Field and Pool, or Exploratory Area

Bisti Lower Gallup

11. County or Parish, State

San Juan County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completions or Well Completion or Recompletion Report and Log)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Redwolf Production, Inc. proposes to plug and abandon the subject well as follows:

1. Set cast iron bridge plug at 4845' and cap with 6 sx of cement (50' plug).
2. Place 100' plug (17 sx) from 3246' to 3346'.
3. Place 100' plug (17 sx) from 1947' to 2047'.
4. Place 175' plug (30 sx) from 1115' to 1290'.
5. Place 321' plug (55 sx) from 321' to surface.
7. Erect dry hole marker and reclaim location.

14. I hereby certify that the foregoing is true and correct

Signed Dana S. DeBenthal Title Vice-President Date 4/21/2003

(This space for Federal or State office)

Approved by Original Signed: Stephen Mason Title Date APR 24 2003

Conditions of approval, if any:

RECEIVED

2003 APR 23 PM 1:17

070 Farmington, NM


LOST WAPITI 15 #13 (Current)

930' FSL, 800' FWL
Sec. 15, T25N, R11W

8 5/8", 24# CSA 271'
CMT W/ 200 SX CMT

DV TOOL AT 3296'

5 1/2", 15.5# & 17#
CASING SET AT 5488'
W/ 1634 CF CMT
PBD 5447'

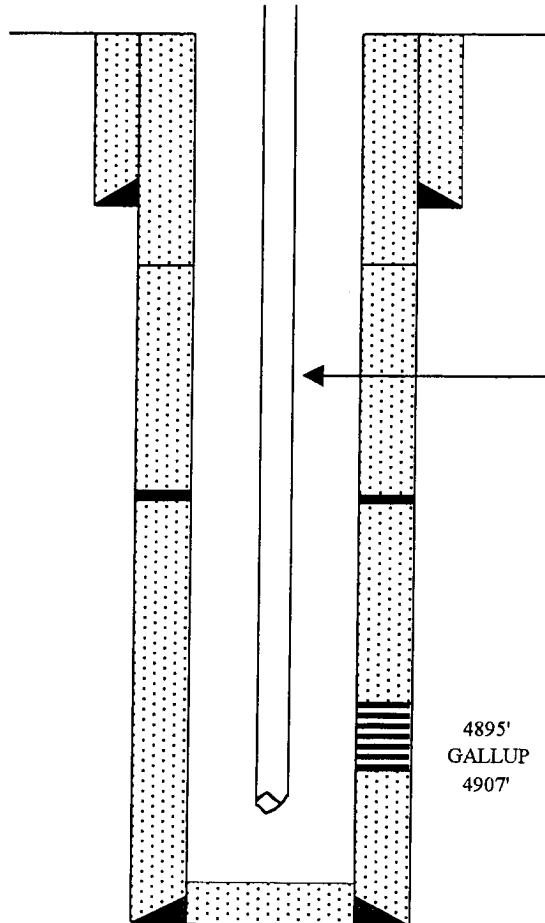

2 7/8" TBG AT 5002'

4895'
GALLUP
4907'

RECEIVED

2003 APR 23 PM 1:17

070 Farmington, NM


LOST WAPITI 15 #13 (Proposed)

930' FSL, 800' FWL
Sec. 15, T25N, R11W

8 5/8", 24# CSA 271'
CMT W/ 200 SX CMT

DV TOOL AT 3296'

5 1/2", 15.5# & 17#
CASING SET AT 5488'
W/ 1634 CF CMT
PBD 5447'

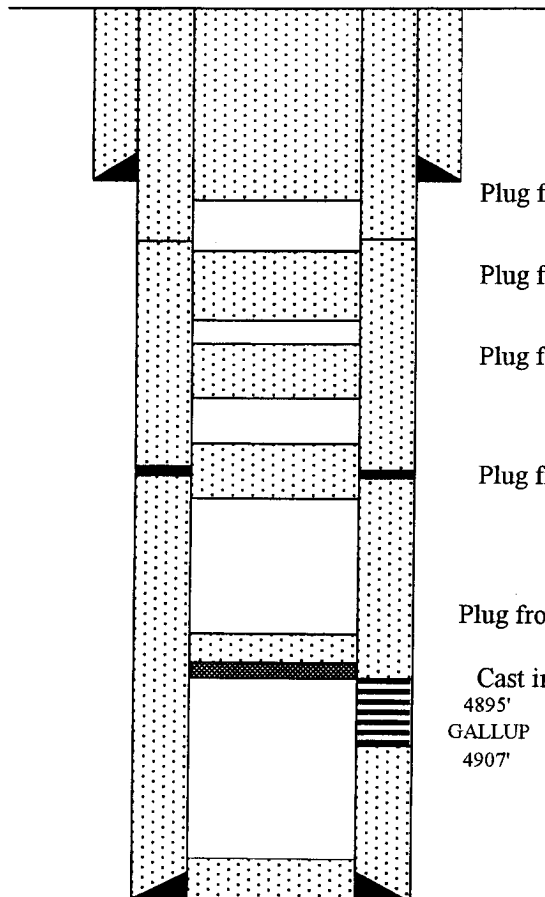

Plug from 321' to surface

Plug from 1115' to 1290'

Plug from 1947' to 2047'

Plug from 3246' to 3346'

Plug from 4795' to 4845'

Cast iron bridge plug at 4845'
4895'
GALLUP
4907'