

Submit 1 Copy To Appropriate District Office  
 District I - (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II - (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III - (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV - (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

Form C-103  
 Revised July 18, 2013

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

<b>SUNDRY NOTICES AND REPORTS ON WELLS</b> (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-031-05176
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Dominion Production Company, LLC		6. State Oil & Gas Lease No.
3. Address of Operator 1414 W Swann Av, Suite 100, Tampa, FL 33606		7. Lease Name or Unit Agreement Name Hospah Sand Unit
4. Well Location Unit Letter <u>J</u> <u>2310</u> feet from the <u>S</u> line and <u>2310</u> feet from the <u>E</u> line Section <u>1</u> Township <u>17N</u> Range <u>9W</u> NMPM County <u>McKinley</u>		8. Well Number <u>9</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 6628 GR		9. OGRID Number
10. Pool name or Wildcat Upper Hospah		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

<b>NOTICE OF INTENTION TO:</b> PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPL <input type="checkbox"/> DOWNHOLE COMMINGLE <input type="checkbox"/> CLOSED-LOOP SYSTEM <input type="checkbox"/> OTHER: <input type="checkbox"/>		<b>SUBSEQUENT REPORT OF:</b> REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> P AND A <input type="checkbox"/> CASING/CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>	
---	--	---	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dominion Proposes to plug this well in accordance with the attached procedure and any agreed modifications thereto.

ESTIMATED START DATE 2/20/20

NMOCD  
 JAN 02 2020  
 DISTRICT III

Point Lookout top 440'

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Drake McCulloch TITLE Authorized Contractor 12/30/19 DATE 12/20/20

Type or print name Drake McCulloch E-mail address: drake@dwsrigs.com PHONE: 505 320 1180

APPROVED BY: [Signature] TITLE District Supervisor DATE 1/15/20  
 Conditions of Approval (if any): A

**Plug and Abandonment Plan**  
Dominion Production Co, LLC.  
Hospah Sand Unit 9  
API# 3003105176  
2310' FSL & 2310' FEL  
Sec. 1 T17N R9W  
McKinley County, New Mexico

1. Comply with all OCD, DPC and contractor safety rules and regulations. Hold safety meetings each morning.
2. MIRU, Check Braden head for pressure. Bleed pressure off of well if necessary.
3. **Plug # 1- (Gallup Perforations and Formation Top 1570'-1420')** RIH with 2 7/8" 4.7#, WS with mule shoe sub. Wash wellbore to depth of 1570'. Mix and Pump 20 Sks, Class G Cement @ 15.5 ppg to cover Gallup with 50' cap and 50' excess.
4. **Plug #2-(Mancos Plug/ Surface Plug, 750'-Surface)** MIRU Wireline Truck, RIH with CBL Tool, from approx 1420' to Surface. Shoot 3-3/8" Squeeze holes (120 Degree Phasing) at approx. 750', actual to be determined from Bond Log. MIRU Pump Truck, Pump Approx. 20 bbls Fresh Water to establish circulation through Squeeze Holes. At Successful Circulation, Mix and Bullhead 130 Sks, Class B Cement @ 15.5 ppg, for outside annulus, Mancos Surface Plug, followed with 102 Sks of Class B Cement @ 15.5 ppg from 750' to Surface. Allow well to stabilize overnight. Top Casing off with Cement if necessary.
5. Cut off well 3' below ground and install P&A marker per OCD specifications. RD, cleanup MOL.
6. Restore location to OCD specifications.
7. All cement volumes are subject to change once surface and production casing sizes are confirmed in the field when operations begin. All current volumes and depths are assumptions based on previous wellbores.

---

# Wellbore Diagram

Hospah Sand Unit #9

API #: 3003105176


McKinley County, New Mexico

## Surface Casing

8.625" 24# @ ?? ft

Cemented with ?? sks  
(Casing to be confirmed  
once operations  
commence)

GR - 6628 ft

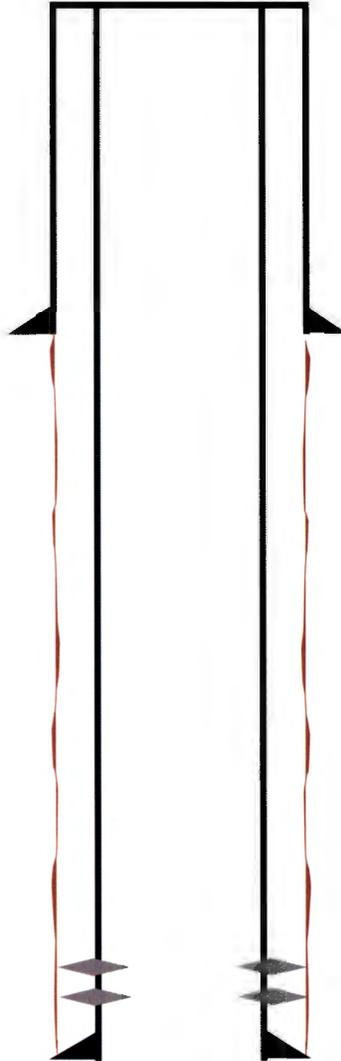

## Production Casing

5.5" 14# @ ?? ft

Cemented with ?? sks

## Gallup Perforations

1534 ft - 1570 ft

---

# Wellbore Diagram

Hospah Sand Unit #9

API #: 3003105176

McKinley County, New Mexico

## Plug 2

750 feet - Surface

750 feet plug

232 sacks of Class B Cement

## Plug 1

1570 feet - 1420 feet


150 feet plug

20 sacks of Class G Cement

## Surface Casing

8.625" 24# @ ?? ft

Cemented with ?? sks  
(Casing to be confirmed  
once operations  
commence)

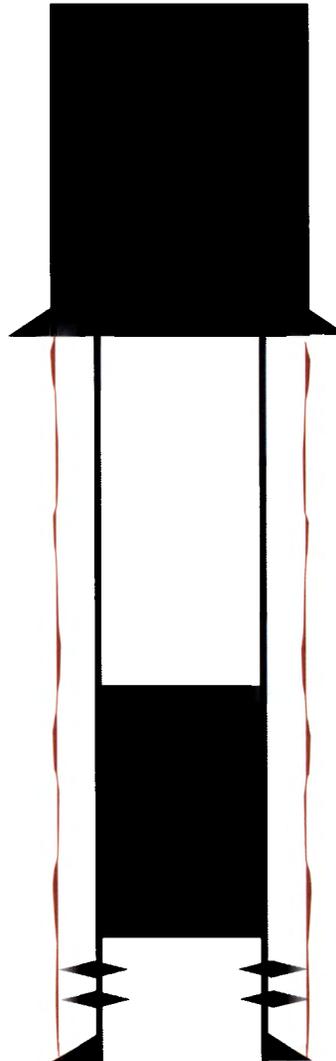

GR - 6628 ft

## Gallup Perforations

1534 ft - 1570 ft

## Production Casing

5.5" 14# @ ?? ft

Cemented with ?? sks