

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
OMB NO. 1004-0137
Expires March 31, 2007

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.


SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well
 Oil Well Gas Well Other

2. Name of Operator
XTO Energy Inc.

3a. Address
2700 Farmington Ave., Bldg. K, Ste 1 Farmington,

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1345' FNL & 1420' FEL, SWNE, SEC 09-T25N-R11W

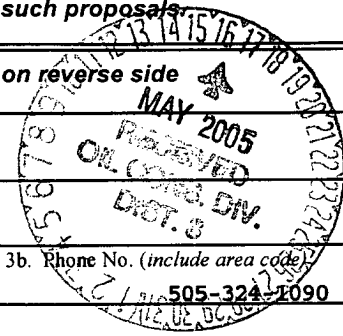

5. Lease Serial No.
NOOC-14203 666

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.
CHARLY HEIRS COM #1

9. API Well No.
30-045-30980

10. Field and Pool, or Exploratory Area
BLANCO FRUITLAND COAL

11. County or Parish, State
SAN JUAN COUNTY NM

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.)

XTO Energy Inc. proposes to plug & abandon this well per the following procedure:

- 1) Notify BLM & NMOCD 24 hrs in advance of pending operations.
- 2) Install & tst rig anchors. Prepare blow pit. Comply w/NMOCD, BLM & XTO safety rules & regs. Conduct safety mtg for all personnel on loc. MIRU PU. NMU relief line & blow well dwn; kill w/wtr as necessary. ND WH. NU BOP & stripping head; test BOP.
- 3) TOH & LD rods & pmp. TOH w/prod tbg (ttl 1456'). Round-trip 4-1/2" gauge ring to 1250'.
- 4) Plug #1 (Fruitland Coal, 1220'-1640'): Set 4-1/2" WL CIBP @ 1220'. TTH w/2-3/8" tbg & tag CIBP. Load csg w/wtr & circ well clean. PT csg to 500 psig. If csg doesn't tst, then spot or tag subsequent plugs as appropriate. Mix 1/4 sx Type III cmt (15.6 ppg, 1.18 cuft/sx) & spot balanced plug inside csg to isolate FTC perms & cover the Fruitland top. PUH w/tbg to 650'.
- 5) Plug #2 (Kirtland & Ojo Alamo tops, 650'-350'): Mix 23 sx Type III cmt (15.6 ppg & 1.18 cuft/sx) & spot balanced plug inside csg fr/650'-350' to cover Kirtland & Ojo Alamo tops. PUH w/tbg to 200'.
- 6) Plug #3 (7" csg shoe, 230'-surf): Spot approx 18 sx Type III cmt (15.6 ppg & 1.18 cuft/sx) inside 4-1/2" csg to surf. Circ good cmt out csg vlv. TOH & LD tbg. Shut well in & WOC.
- 7) ND BOP & cut off WH below surf csg flange. Install P&A marker w/cmt to comply w/regs. RDMO PU & cut

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed) **HOLLY PERKINS** Title **REGULATORY COMPLIANCE TECH**

Holly C. Perkins Date **5/6/05**

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by **Original Signed: Stephen Mason** Title _____ Date **MAY 13 2005**

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office _____

Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.