

District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised October 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company	ConocoPhillips Company	Contact	Monica D. Johnson
Address	5525 Hwy. 64, Farmington, NM 87401	Telephone No.	505-599-3458
Facility Name	San Juan 29-5 #34	Facility Type	Gas Well
Surface Owner	Fee	Mineral Owner	Fee
		Lease No.	API # 30-039-07515

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
G	34	T29N	R5W	1425'	North	2080'	East	Rio Arriba

Latitude 36.68536° Longitude 107.34299°

NATURE OF RELEASE

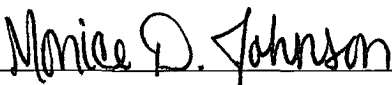

Type of Release - Condensate	Volume of Release - 44 BBL	Volume Recovered - none
Source of Release: Frozen 2" drain valve on tank	Date and Hour of Occurrence 1/26/06	Date and Hour of Discovery 1/26/06 - 11:20 a.m.
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Denny Foust - OCD - via email	
By Whom? Juanita Farrell	Date and Hour - 1/26/06 - 1:45 p.m.	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

Describe Cause of Problem and Remedial Action Taken.* **A condensate spill of 44 BBL was discovered at the San Juan 29-5 #34 on Thursday, 1/26/06 at 11:20 a.m., where the 2" drain valve on the condensate tank froze and broke, spilling 44 BBL condensate into the bermed area. All spilled fluids remained within the berm but soaked into the soil.**

Describe Area Affected and Cleanup Action Taken.* **All spilled fluids remained within the berm but soaked into the soil. The tank was moved and an investigation was conducted to determine how deep the condensate penetrated into the soil. On 2/2/06, remediation activities began where soils were excavated to a depth of 13' and a soil sample from the bottom was taken with results of 0.0135 ppm total BTEX, benzene of non-detect, and 32.9 ppm TPH. See the attached copies of the laboratory analysis results. All stained soils were excavated and hauled to Envirotech's landfarm with the excavated area being backfilled with clean fill dirt.**

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION		
Printed Name: Monica D. Johnson	Approved by District Supervisor:  For: Charlie Perrin		
Title: Environmental Specialist	Approval Date: 6/1/06	Expiration Date:	
E-mail Address: monica.johnson@conocophillips.com	Conditions of Approval:		Attached <input type="checkbox"/>
Date: 5/24/06 Phone: 505-599-3458			

* Attach Additional Sheets If Necessary

n BPOU15233266