

District I - (505) 393-6161

P.O. Box 1940

Hobbs, NM 88241-1980

District II - (505) 748-1283

811 South First

Artesia, NM 88210

District III - (505) 334-6178

1000 Rio Brazos Road

Aztec, NM 87410

District IV - (505) 827-7131

State of New Mexico

Energy Minerals and Natural Resources Department


Oil Conservation Division

2040 South Pacheco Street

Santa Fe, New Mexico 87505

(505) 827-7131

Form C-141
Originated 2/13/97

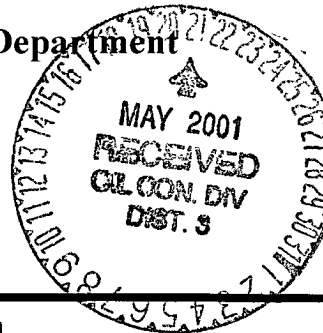

Submit 2 copies to:
Appropriate District
Office in accordance
with Rule 116.

Release Notification and Corrective Action

30 039-23054

OPERATOR

☐ Initial Report

☒ Final Report

Name:	Burlington Resources	Contact:	Ed Hasely
Address:	P.O. Box 4289 Farmington NM 87499	Telephone No.:	(505) 326-9841
Facility Name:	LA JARA CANYON	IR	Facility Type: Gas Well

Surface Owner:	Federal	Mineral Owner:	Federal	Lease Number:	NMNM-0558140
----------------	---------	----------------	---------	---------------	--------------

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet From the	North/South Line	Feet From the	East/West Line	County: Rio Arriba
M	10	029N	005W	790	South	1110	West	

NATURE OF RELEASE

Type of Release:	Condensate & Produced Water	Volume of Release:	27 BBLS.	Volume Recovered:	10 BBLS.
Source of Release:	Condensate Storage Tank	Date and Hour of Occurrence:	5/17/2001	Date and Hour of Discovery	5/17/2001
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If Yes, To Whom?	Denny Foust		
By Whom?	Ed Hasely	Date and Hour:	5/17/2001 1:15:00 PM		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	0		

If a Watercourse was Impacted, Describe Fully. (Attach Additional Sheets If Necessary)

NA

Describe Cause of Problem and Remedial Action Taken. (Attach Additional Sheets If Necessary)

Approximately 17 bbls of condensate and 10 bbls of produced water leaked out a hole in the bottom of the condensate tank into the bermed area. The tank was emptied to prevent further leakage. The tank will be repaired or replaced.

Describe Area Affected and Cleanup Action Taken. (Attach Additional Sheets If Necessary)

All fluids were contained inside the bermed area. A vacuum truck recovered 10 bbls of condensate. Impacted soils (approx. 32 yds) were excavated and landfarmed on location.

Note: A message was left w/ Mark Kelly (BLM) on 5/17/01.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature:	<i>Ed Hasely</i>	OIL CONSERVATION DIVISION	
Printed Name:	Ed Hasely	Approved by	<i>Denny Foust</i>
Title: Environmental Representative		District Supervisor:	<i>for Frank Chavez</i>
Date: 5/17/01	Phone: (505) 326-9841 or 326-9842	Approval Date:	05/25/01
		Expiration Date:	
		Conditions of Approval:	
		Attached:	<input type="checkbox"/>

n DGFO113748278