

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised June 10, 2003

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

30 045 09146

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company: Energen Resources Corporation	Contact : Larry M. Brooks
Address : 2198 Bloomfield Hwy, Farmington, NM 87401	Telephone No.: 505-325-6800
Facility Name: McCord #5	Facility Type : Producing Natural Gas Well Site

Surface Owner :	Mineral Owner	Lease No.:
BLM	BLM	NMSF 078214

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
N	27	30N	13W	1050	SOUTH	1450	WEST	SAN JUAN

NATURE OF RELEASE

Type of Release: Condensate Storage Tank Leak	Volume of Release: 82 BBLS.	Volume Recovered : Negligible
Source of Release: 500 BBL site storage tank	Date and Hour of Occurrence: Between 12/5/2005 and 12/7/2005 @ 11:00 AM	Date and Hour of Discovery: 12/7/2005 11:00 AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Henry Villanueva	
By Whom? Larry Brooks	Date and Hour - 12/8/2005 10:00 am	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse	

If a Watercourse was Impacted, Describe Fully.*

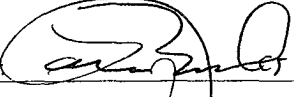
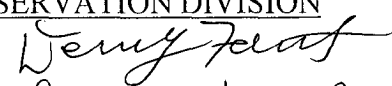
Describe Cause of Problem and Remedial Action Taken.*

The leak originated from the failure of the tank 2" BS&W drain valve. Water within the drain valve body froze and cracked the valve. Immediate action was taken to isolate the leak and repair the valve and also recover pooled liquid. Pooled liquid was recovered with a vacuum truck and placed within containment facilities on site.

Describe Area Affected and Cleanup Action Taken.*

Clean-up action will include replacement of tank valves with appropriate "freeze resistant" equipment and an upgrade of the secondary containment and leak detection. Excavate and remove contaminated soils and perform necessary remedial action for the affected areas.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Larry M. Brooks	Approved by District Supervisor:  for Charlie Pennington	
Title: Production Foreman	Approval Date:	Expiration Date:
E-mail Address: lbrooks@energen.com	Conditions of Approval: Plan is to biopile	Attached <input type="checkbox"/>
Date: 12/4/2005 Phone: 505-326-6131		

* Attach Additional Sheets If Necessary

n DGF0535636867