

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R149
5. LEASE DESIGNATION AND SERIAL NO.

Jic 99

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT--" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME
2. NAME OF OPERATOR <i>Mobil Oil Corporation</i>	8. FARM OR LEASE NAME <i>Jic 99</i>
3. ADDRESS OF OPERATOR <i>Box 633, Midland, Texas 79201</i>	9. WELL NO. <i>5</i>
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface	10. FIELD AND POOL, OR WILDCAT <i>Blanca M V</i>
14. PERMIT NO. <i>Unit M, 840' Fwh & 990 Fsh of sec. 14, T-26-N, R-3-W</i>	11. SEC., T., R., M., OR BLE. AND SURVEY OR AREA <i>sec. 14, T-26-N, R-3-W</i>
15. ELEVATIONS (Show whether DF, RT, OR, etc.) <i>7252 Gr.</i>	12. COUNTY OR PARISH <i>Big Horn</i>
	13. STATE <i>NEBRASKA</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☒	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting at proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

To Plug And Abandon as Per attached Procedures.



U. S. GEOLOGICAL SURVEY
DENVER, COLO.

18. I hereby certify that the foregoing is true and correct

SIGNED <i>J. J. McDaniel</i>	TITLE <i>Authorized Agent</i>	DATE <i>12-3-71</i>
(This space for Federal or State office use)		
APPROVED BY	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		

*See Instructions on Reverse Side

MIDLAND E & P DIVISION

WELL WORK RECOMMENDATIONS

Proposals for Well Reconditioning and Subsurface Maintenance
Workovers, Expense DD's, PB's, and Conversions


Lease: Licarilla "D" Well No. 5
Field: Blanco Mesa Verde
County: Rio Arriba State: New Mexico

RECOMMENDED PROCEDURE:

1. Pull and rerun tubing without gas lift valves.
 2. Run tubing to 5600' and spot 15 5x plug (100') back up to 5475'. For 50' over perfs.
 3. Circulate hole to wash loose fluid
 4. Spot 30 5x plug (100') across the top of Ojo Alamo (3382' on log) with top of plug at 3330'±.
 5. Check 7 5/8" casing for free point cut and pull (Cmt top-surveyed at 2900')
 6. Spot 50 5x plug (100') across 7 5/8" casing stub (50' above & 50' below) and 50 5x plug (100') across 10 3/4" casing shoe and surface sands.
 7. Spot 10 5x plug at surface.
 8. Erect monument and clear location
- Vertically reviewed w/ OCC & USGS

JCG/ 10-26-71

WJB

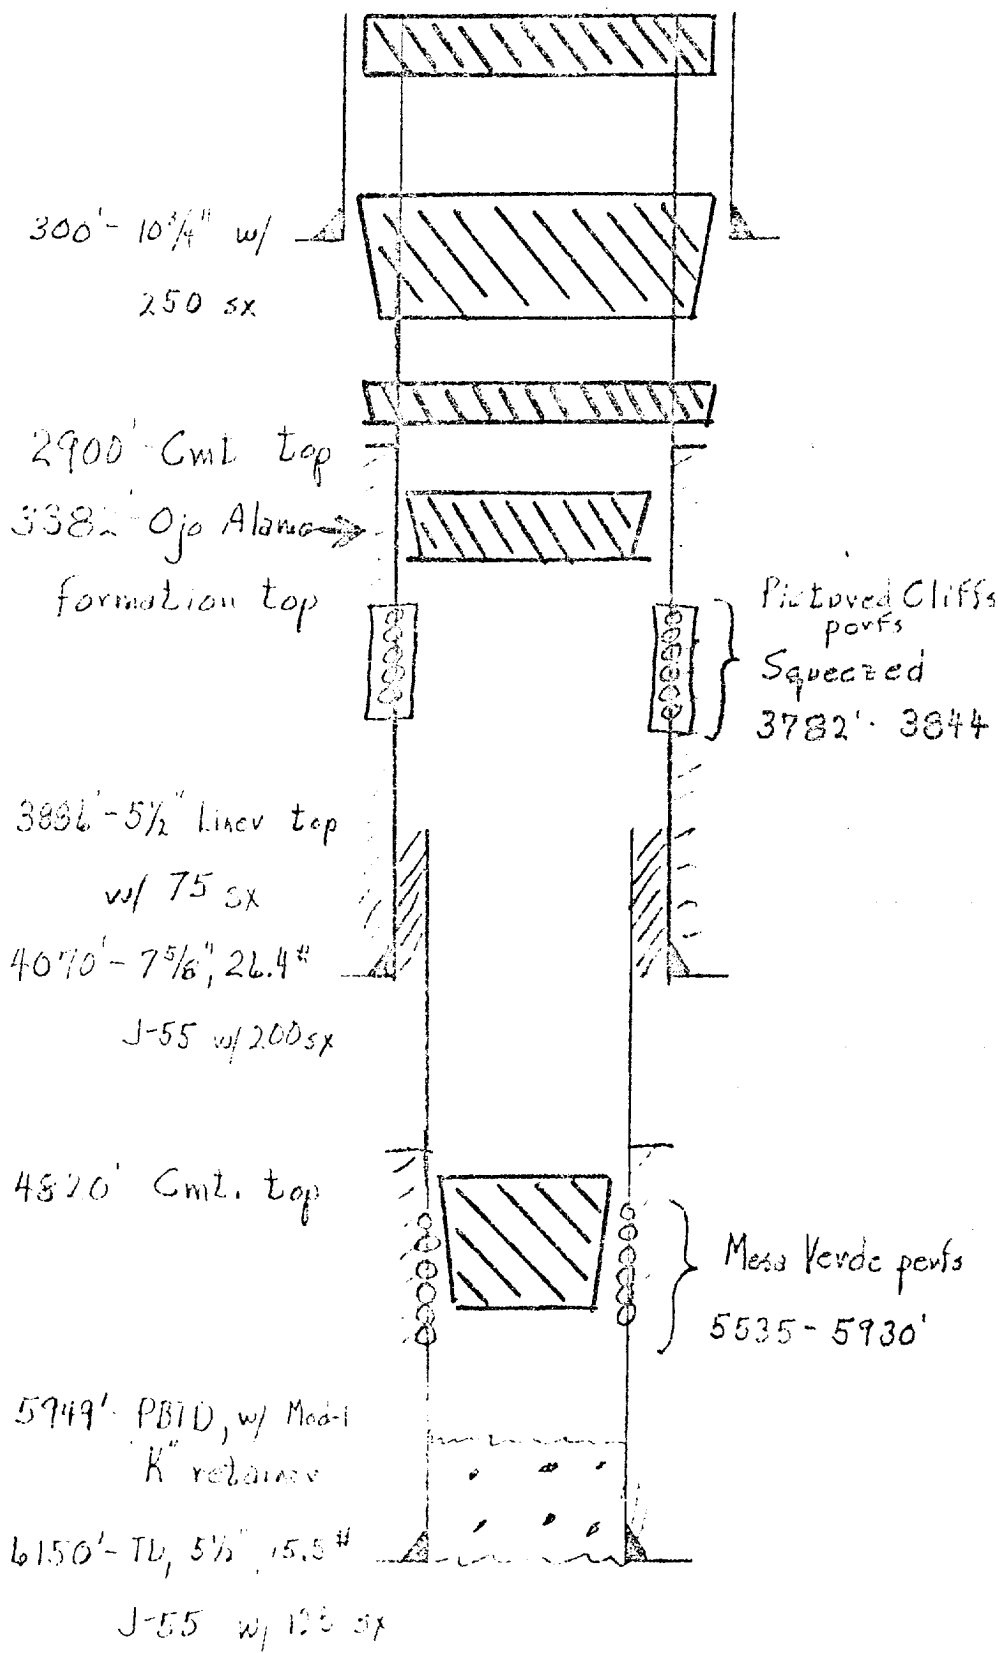

P.F.M.
 Licorine D#5
 M, Sec 14, T 25N, R 3W
 Rio Arriba County
 New Mexico

(2" Lbg. @ 5920 to 4 ft. plus

- Cement plug in
1. Mesa Verde
 2. Ojo Alamo cap
 3. Surface strata below 10 ft and the 7 $\frac{5}{8}$ in.
 4. Surface

JCG, 12-18-71