UNITED STATES FORM APPROVED Form 3160-5 Budget Bureau No. 1004-0135 (June 1990) DEPARTMENT OF THE INTERIOR Expires: March 31, 1993 **BUREAU OF LAND MANAGEMENT** 5. Lease Designation and Serial No. Contract 120 SUNDRY NOTICES AND REPORTS ON WELLS 6. If Indian, Allottee or Tribe Name Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals 7. If Unit or CA, Agreement Designation SUBMIT IN TRIPLICATE 1. Type of Well Oil Well ⊠ Gas Well 8. Well Name and No. 2. Name of Operator Jicarilla No. 6 9. API Well No. 3. Address and Telephone No. عمت 30-039-20126 10 Field and Pool, or Exploratory Area
Basin Dakota 10 Desta Dr. Ste 100W, Midland, TX 79705
4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State 1620' FSL & 800; FW1 Sec. 29, T-268, R-4EW Rio Arriba 12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent Abandonment Change of Plans Recompletion **New Construction** Subsequent Report Plugging Back Non-Routine Fracturing Water Shut-Off Casing Repair Final Abandonment Notice Altering Casing Conversion to Injection Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)* It is proposed to plug and abandon this well by the following procedure: POOH with tubing and Baker Model "R" packer set at 7480'. RIH with bit and scraper to 7500' Set 4-1/2" cement retainer at 7500' and pump 25 sxs Class B cement. Then spot 14 sxs cement on top of retainer.

Fill hole with 8.3 ppg fluid.

Perforate top of Ojo Alamo at 2300' with 4 squeeze holes.


Spot 42 sxs Class B at 2300' and squeeze 18 sxs into perfs.

Perforate Naciemiento at 1035' with 4 squeeze holes.

Spot 42 sxs Class B at 1035' and squeeze 18 sxs into perfs.

Perf casing at 285' and pump 100 sxs Class B circulated to surface.

Out off casing helow surface rasing head and install P&A marker. Cut off casing below surface casing head and install P&A marker.

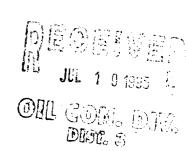

		No no. 1. 11	
14. I hereby ceptify that the foregoing is true and correct Signed Signe	Tide Sr. Conservation Coordinator	Date 6/22/95	_
This space for Federal of State office use) Approved by Conditions of approval, if any:	Chief, Lands and Mineral Resources	Date JUL 1 8 1995	-

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.