

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells

1. Type of Well
GAS

2. Name of Operator

**BURLINGTON
RESOURCES**

OIL & GAS COMPANY


3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

885' FSL, 2465' FWL, Sec. 1, T-26-N, R-5-W, NMPM

DHC-2687

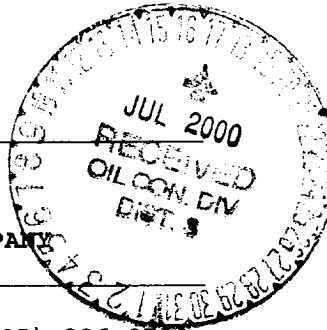

5. Lease Number

Jic Contract 150

6. If Indian, All. or

Tribe Name

Jicarilla Apache

7. Unit Agreement Name

8. Well Name & Number

Jicarilla 150 #12

9. API Well No.

30-039-24211

10. Field and Pool

Wildcat Cha/Blanco MV

BS Mesa Gallup

11. County and State

Rio Arriba Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☐ Abandonment

☒ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other - Commingle

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

5-9-00 MIRU. SDON.

5-10-00 SD for rig repairs.

5-11-00 ND WH. NU BOP. TOOH w/240 jts 2 3/8" tbq. TIH w/4 1/2" CIBP, set @ 6650'. Displace hole w/220 bbl 2% KCl wtr. PT CIBP & csg to 3000 psi/30 min. OK. SDON.

5-12-00 TOOH. TIH, ran CBL @ 4080-5800', TOC @ 4080'. TOOH. ND BOP. NU WH. RD. Rig released.

5-15-00 MIRU. Perf Point Lookout w/1 SPF @ 6212, 6227, 6236, 6252, 6272, 6282, 6304, 6309, 6315, 6335, 6357, 6379, 6391, 6402, 6414', w/2 SPF @ 6437, 6445, 6452, 6497, 6505, 6511, 6518, 6540' w/0.32" diameter holes. SDON.

5-16-00 Acidize w/1050 gal 15% HCl. Frac Point Lookout w/2115 bbl slk wtr, 100,000# 20/40 Brady sd. TIH w/CIBP, set @ 6184'. PT CIBP & csg to 3000 psi, OK. Perf Cliff House/Menefee w/1 SPF @ 5672, 5690, 5704, 5728, 5750, 5762, 5774, 5780, 5801, 5810, 5886, 5913, 5943, 5949, 5965, 5999, 6004, 6047, 6063, 6092, 6122, 6128, 6140, 6146, 6154' w/25 holes total. Acidize w/1050 gal 15% HCl. Frac Cliff House/Menefee w/2374 bbl slk wtr, 100,000# 20/40 Brady sd. TIH w/CIBP, set @ 5610'. PT csg & CIBP to 3000 psi, OK. Perf Chacra w/1 SPF @ 4854, 4858, 4869, 4985, 4987, 4990, 5043, 5047, 5054, 5065, 5073, 5165, 5167, 5175, 5177, 5191, 5195, 5199, 5205, 5207, 5241, 5244, 5249, 5258, 5309, 5313, 5319, 5324, 5399, 5411, 5415, 5424, 5434, 5469, 5473, 5478, 5484, 5492, 5548, 5552, 5558' w/41 holes total. Acidize w/1050 gal 15% HCl. Frac Chacra w/701 bbl 20# linear gel, 200,000# 20/40 Brady sd. CO after frac.

Continued on back

14. I hereby certify that the foregoing is true and correct.

Signed

no

Title Regulatory Supervisor

Date 6/22/00

(This space for Federal or State Office use) Lands and Mineral Resources

APPROVED BY Calvin M. Hester Title

Date 7-12-00

CONDITION OF APPROVAL, if any:

5-17/18-00 Blow well & CO.
5-19-00 Blow well & CO. RD.
6-5-00 MIRU. ND WH. NU BOP. TIH w/3 7/8" mill to 5452'. Establish circ. Circ hole clean.
6-6/7-00 Circ hole clean.
6-8-00 Circ hole clean. Mill out CIBP @ 5610'. TIH, circ hole clean.
6-9-00 Circ hole clean. Mill out CIBP @ 6184'. TIH, circ hole clean.
6-10/15-00 Circ hole clean.
6-16-00 Circ hole clean. TOOH. Tbg stuck on way out of hole. TIH w/free point. TOOH. TIH w/chemical cutter. Chemical cut tbg @ 4890'. TOOH. TIH w/fishing tools. Fishing.
6-17-00 Fishing. TOOH w/fish & fishing tools. Establish circ. Circ hole clean.
6-18-00 Circ hole clean.
6-19-00 Circ hole clean. TOOH. TIH w/4 1/2" pkr to CIBP @ 6650'. Establish circ. Circ hole clean. Set pkr @ 5572'. Blow well & CO. Release pkr, TOOH. SDON.
6-20-00 TIH w/mill. Establish circ. Mill out CIBP @ 6650'. Circ hole clean. SDON.
6-21-00 Establish circ. Circ hole clean to PBTD @ 7860'. TOOH w/mill. TIH w/241 jts 2 3/8" 4.7# J-55 EUE tbg, landed @ 7741'. ND BOP. NU WH. RD. Rig released.

Well will produce as a Chacra/Mesaverde/Gallup commingle under DHC-2687.