

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

| | | | |
|---|--|--|--|
| 1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER | | 5. LEASE DESIGNATION AND SERIAL NO. Jicarilla Cont. 108 | |
| 2. NAME OF OPERATOR Tenneco Oil Company | | 6. IF INDIAN, ALLOTTEE OR TRIBE NAME Jicarilla, Dulce, New Mexico | |
| 3. ADDRESS OF OPERATOR P. O. Box 1714, Durango, Colorado 81301 | | 7. UNIT AGREEMENT NAME | |
| 4. LOCATION OF WELL. (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 505 FSL, 1070 FWL, Unit M | | 8. FARM OR LEASE NAME Jicarilla "C" | |
| 14. PERMIT NO. | | 9. WELL NO. 7 | |
| 15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6689 Gr. | | 10. FIELD AND FOOT, OR WILDCAT Dual Basin Dak & Blanco MV | |
| | | 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 13, T-26-N, R-5-W | |
| | | 12. COUNTY OR PARISH Rio Arriba | |
| | | 13. STATE New Mexico | |

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:


WATER SHUT-OFF ☐
FRACTURE TREATMENT ☒
SHOOTING OR ACIDIZING ☒
(Other) Complete Mesaverde zone

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

MI & RU 5/4/67. Set BP at 5425. Perf 5320 w/2 holes, 4928 w/2 holes. Perf 2 holes at 5015, sq w/50 sx cmt. WOC. Perf 4958-52, 4996-92, 5010-5004, 5030-26, 5276-70, w/24 holes. Treated w/500 gals 15% acid, and balls. Frac w/70,000# sd & 75,000 gals wtr. 60 BPM @ 2400#. Drld BP and CO to 7720. Set pkr at 7430. Ran 255 jts 2-3/8" tbg. w/sliding sleeve and production tube. Rel Rig 5/9/67. WO Test.

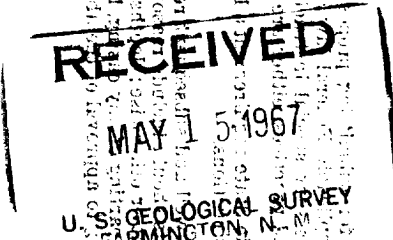

18. I hereby certify that the foregoing is true and correct

SIGNED

[Signature]

TITLE Senior Production Clerk

DATE May 11, 1967

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

6 USGS
1 Cont.
1 File
1 Atlantic

*See Instructions on Reverse Side