

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 079395

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

East Bisti Unit

8. FARM OR LEASE NAME

9. WELL NO.

70

10. FIELD AND FOM, OR WILDCAT

Bisti Lower Gallup

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Section 34-25N-10W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Skelly Oil Company

3. ADDRESS OF OPERATOR

1860 Lincoln Street - Denver, Colorado 80203

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1980' FSL & 660' FWL Section 34-25N-10W

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6744' GR

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

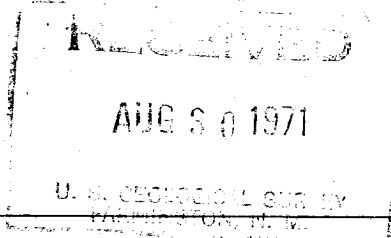
REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

All depths shown are from Ground Level

7-3-71 MI & RU Aztec Well Service Unit. Pulled rods. Spotted cement plug
5360-5260'. Pulled 2" tubing.Pulled and worked 5-1/2" casing to free same. Rigged up Blue Jet; perforated
1709-1710' with 4 shots. Ran 2" tubing. Spotted cement plug from 1710-1560'.
Pulled 2" tubing. Shot 5-1/2" casing off at 1521'. Spotted cement from 1571-1471';
50' inside casing and 50' above casing stub. Pulled 5-1/2" casing to 965' and
spotted cement plug from 965-865'. Pulled 46 jts. (1535') 5-1/2" casing.Spotted 10' cement plug in surface casing. Installed dry hole marker.
Completed P&A 7-10-71.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Lead Clerk

DATE

August 26, 1971

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side