

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐ Temporarily abandoned		5. LEASE DESIGNATION AND SERIAL NO. 14-20-603-1431
2. NAME OF OPERATOR TEXACO Inc.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Navajo
3. ADDRESS OF OPERATOR Box 810, Farmington, New Mexico 87401		7. UNIT AGREEMENT NAME Northwest Bisti
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' from south line and 660' from west line		8. FARM OR LEASE NAME //
14. PERMIT NO.		9. WELL NO. 4
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6448' DF		10. FIELD AND POOL, OR WILDCAT Bisti, Lower Gallup
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 14, T25N, R11W, NMPM
		12. COUNTY OR PARISH San Juan
		13. STATE New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐

(Other)

PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☒CHANGE PLANS ☐**Convert to water supply**

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐

(Other)

REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐


(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Reason for workover is to abandon Bisti, Lower Gallup Zone, perforate Mesa Verde Zone and complete well as a water supply well.

Procedure will be as follows:

Squeeze Bisti, Lower Gallup perforations 5004' to 5012' with 50 sack cement plug. Set C.I. bridge plug at 2600' and perforate 5-1/2" casing at 2550'. Establish circulation and cement behind 5-1/2" casing, through perforations at 2550' with 200 sacks of 8 percent Gel Class C cement plus 150 sacks of neat Class C cement. Perforate 5-1/2" casing in Mesa Verde formation from 2092' to 2140', 2212' to 2275', 2325' to 2390' and 2485' to 2535' and treat with 1,000 gallons of mud acid.

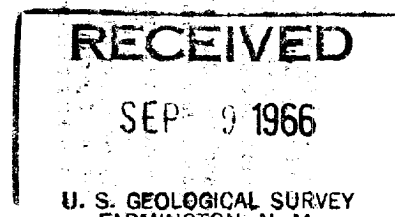

18. I hereby certify that the foregoing is true and correct

SIGNED

(This space for Federal or State office use)

TITLE

District Superintendent

DATE

9/9/66

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; and or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685229
807-851

