

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.
Mims No. 1
SF 078067
6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		7. UNIT AGREEMENT NAME Carson Unit	
2. NAME OF OPERATOR Shell Oil Company		8. FARM OR LEASE NAME	
3. ADDRESS OF OPERATOR 1700 Broadway, Denver, Colorado 80290		9. WELL NO. 43-14	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface: 1980' FSL & 660' FEL Section 14		10. FIELD AND POOL, OR WILDCAT Bisti	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Section 14-T25N-R12W	
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.)	12. COUNTY OR PARISH San Juan	13. STATE N. Mexico


16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	
(Other) <input type="checkbox"/>		(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)	

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

See attachment

WILL SEND FINAL SUNDRY WHEN LOCATION
CLEANED AND READY FOR INSPECTION

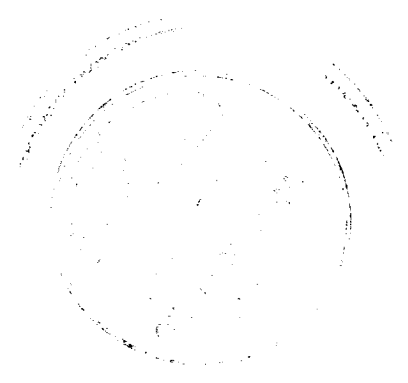

18. I hereby certify that the foregoing is true and correct
SIGNED R. P. Plauty TITLE Div. Ops. Engr. DATE JUL 29 1977
(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:
cc: New Mexico O&GCC w/attachment

PLUG AND ABANDON WELL

SHELL OIL COMPANY

FROM: 6/7-8/77

LEASE

DIVISION

COUNTY

CARSON UNIT

WESTERN

SAN JUAN

WELL NO.

ELEV

STATE

BISTI

43-14

NEW MEXICO

NEW MEXICO

BISTI FIELD

Carson Unit 43-14
(P&A)

"FR" TD 5025. WO #528926 provides funds to plug and abandon well. 6/6 RU Bedford; unable to release Bkr tbg AC @ 4950. Loaded hole w/mud. Spt'd 25 sx cmt mixed w/1# flocele/sx. Displ'd cmt out of tbg to 4600' w/18 BW. Backed off tbg @ 1603. Pulled & LD tbg.

JUN 07 1977

Carson Unit 43-14
(P&A)

TD 5025. RU hyd jacks; did not find enough free pipe. Perf'd Fruitland Coal & Pictured Cliffs interval 1220-21 w/4 jets/ft. Spt'd 50 sx cmt plug. Closed Bradenhead & displ'd 20 sx thru perfs @ 1220-1221. Max press 650 psi; final press 450 psi. WOC 2 hrs; 0 press. Shot off csg @ 720' & spt'd 35 sx cmt plug @ csg stub. Pulled csg to base of Ojo Alamo 400' & spt'd 35 sx cmt plug. Pulled csg to base of 8-5/8 csg & spt'd 25 sx cmt plug. Fin'd pull'g csg. Installed abandonment marker w/10 sx cmt plug. RD Bedford Inc. 6/7/77.
FINAL REPORT

JUN 08 1977