

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078064

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

--

7. UNIT AGREEMENT NAME

Carson Unit

8. FARM OR LEASE NAME

--

9. WELL NO.

43-13

10. FIELD AND POOL, OR WILDCAT

Bisti

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

**Section 13, T. 25 N.,
R. 12 W., N.M.P.M.**

12. COUNTY OR PARISH 13. STATE

San Juan

N. M.

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Shell Oil Company

3. ADDRESS OF OPERATOR

P. O. Box 999, Bakersfield, California

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)

At surface **1980' north and 660' east of southeast corner,
Section 13, T. 25 N., R. 12 W., N.M.P.M., San Juan County,
New Mexico**

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

K.B. 6408.38', Gr. 6396.28'

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☒
☒
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*


1. Pull rods and tubing.

2. Spearhead with 500 gallons of 15% HCl, followed by 7000 gallons of water down 4-1/2" casing.

3. Fracture with 15,000# of 20/40 sand in 18,000 gallons of water using 1100 HHP at 20 BPM and 2500 psi.

4. Displace sand, reduce injection rate and inject 3 barrels of Tretolite S.P. 177 scale inhibitor diluted with 15 barrels of water. Overflush with 80 barrels of water.

5. Bail sand to 4950', run tubing, pump and rods, and return to production.

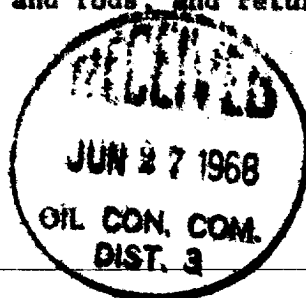

18. I hereby certify that the foregoing is true and correct

SIGNED

E. W. Smith

TITLE

DATE

JUN 25 1968

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE : 1963 - O-685229

897-851

