

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 07893
Unit Mayo

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		<u>Set Production Casing</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 6, 1957

Well No. 6 is located 1880 ft. from N line and 1900 ft. from E line of sec. 1

C-34, NE Section 1
($\frac{1}{4}$ Sec. and Sec. No.)

24N
(Twp.)

19W
(Range)

New Mexico P.M.
(Meridian)

Monte-Calle
(Field)


San Juan County
(County or Subdivision)

New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 6226 ft.
6226 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mud, cement, and all other important proposed work)

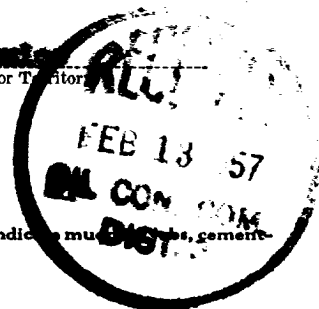

Drilled to a total depth of 5000' DB, completed logs, conditioned hole, and run 128 joints 5-8/2", 144 and 20 joints 3-1/2", 15.5' 3-55 Sals. Casing landed at 4999' DB. Casing equipped with Behr Washdown Whirlar Plant Shoe, Behr Baffle Collar, Centralizers and Spacers and cemented with 100 sac of 3' Gal Cement. Pumped plug to Float Collar @ 4934' DB. Ran Temperature Survey and Found Top of Cement @ 4200' DB.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company THE MEXICO-AMERICAN OIL PRODUCING COMPANY

Address Box 180
Denver 1, Colorado

Original Signed By:
Thomas M. Hogan

By _____

Title District Superintendent